

APPENDIX A
(of FRCRM Watershed Monitoring Program Final Report 2/2004)

Feather River Coordinated Resource Management
Pilot Watershed Monitoring Program
319(h) Clean Water Act Grant
Final Report

Prepared by Plumas Corporation
Quincy, CA
March 9, 2001

TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Summary	3
Background and Setting	4
Project Work Plan	5
Sampling Design and Protocols	6
Data Management and Analysis	12
Results and Discussion	14
Recommendations	15
References	16

<u>FIGURES</u>	<u>PAGE</u>
Fig. 1- Watershed Map	between pp. 3-4
Fig. 2- Reference Reach Locations	“ “ 7-8
Fig. 3- Permanent Station Locations	“ “ 9-10
Fig. 4a- Wolf Water Temperature Graph	“ “ 13-14
Fig. 4b- Wolf Water Stage Graph	“ “ 13-14

<u>TABLES</u>	<u>PAGE</u>
Table 1- FRCRM Agencies	4
Table 2- Enumerated Reference Reaches	7
Table 3- Permanent Station Measurements	9
Table 4- Permanent Station Equipment	10
Table 5- Permanent Station Installation	11
Table 6- Spanish Creek Rating Table	between pp. 14-15

<u>APPENDICES</u>
Appendix A- Watershed Monitoring Pilot Plan
Appendix B- Quality Assurance Protection Plan
Appendix C- Stream Condition Inventory, Ver. 4, 1998
Appendix D- Reference Reach Data Tables

Pilot Watershed Monitoring Program
319(h) Clean Water Act Grant
Final Report
March 9, 2001

Summary

In 1997, a Clean Water Act 319(h) grant was awarded to the Feather River Coordinated Resource Management (FRCRM) group to develop a Pilot Program for regional watershed monitoring in the upper Feather River basin. The specific purpose was to develop, field test, and evaluate protocols of a watershed monitoring network to obtain baseline and/or continuing data from which could be measured trends-through-time of watershed health. The general purpose was to begin a program of trend analysis with which to evaluate changes as they relate to land management and restoration efforts in the watershed.

The Pilot Program established twenty-one (21) permanent reference reaches (from which field data was collected on nine (9) physical, and two (2) biological parameters), two (2) sediment sampling sites, and eleven (11) continuous recording stations (which track stream-flow, water temperature and several water quality parameters). These are located in the North Fork (1100 mi²), East Branch (1000 mi²), and Middle Fork (1200 mi²) watersheds as follows:

<u>Watershed</u>	<u>Reference Reaches</u>	<u>Continuous Recording</u>	<u>Sediment</u>
North Fork Feather	5	0	0
East Branch Feather	12	10	2
Middle Fork Feather	4	1	0

The field methods used in the reference reaches follow closely those described in the US Forest Service "Stream Condition Inventory Guidebook", version 4, 1998.

The Pilot Program was planned and developed in 1997- 98. The field data was collected from the reference reaches in 1999. The installation of equipment at the continuous recording sites was accomplished in 1999- 2000. The selection of sediment sites was made in 1999, with data collection initiated in 2000- 01.

As a special contribution to this system, Ca. Department of Water Resources purchased and installed a satellite-accessible weather station at Doyle Crossing in the Last Chance Creek watershed (upper east Branch).

Background and Setting

The Feather River Coordinated Resource Management (FRCRM) group, a proactive consortium of 21 public agencies, private sector groups, and local landowners (Table 1), was formed in 1985 in response to widespread erosion and channel degradation in the Feather River watershed. The FRCRM has collectively completed over 50 watershed projects in the Feather River basin since 1985 including studies and assessments, resource management plans, stream restoration projects, community outreach and educational efforts. Over 15 miles of stream and 4,000 riparian acres have been treated at a cost of over five million dollars, which was contributed largely by FRCRM partners. The goal of the FRCRM program is to improve watershed condition over time, reduce erosion, restore meadow function, improve water quality and enhance habitat for fish and wildlife.

Table 1: Feather River Coordinated Resource Management Signatory Members

California Department of Forestry & Fire Protection	Plumas County
California Dept. of Fish & Game	Feather River College
California Dept. of water Resources	Pacific Gas & Electric
California Regional Water Quality Control Board	Plumas Corporation
USDA- Natural Resources Conservation Service	USDA- USFS, Plumas National Forest
U.S. Army Corps of Engineers	Plumas Unified School District
Feather River Resource Conservation District	USDA- Farm Services Agency
California Dept. of Transportation	Salmonid Restoration Federation
California Dept. of Parks & Recreation	U.S. Fish & Wildlife Service
Plumas County Community Development Commission	Univ. of Calif. Cooperative Extension
North Cal-Neva Resource Conservation and Development Area	

The Feather River watershed is located in California's northern Sierra Nevada, where the North, South and Middle Forks drain 3,222 square miles of variable terrain from the Great Basin Escarpment westward through the Sierran crest into the Sacramento River (Figure 1). The study area includes three (3) USGS Hydrologic Unit Code watersheds: HUC #18020121, North Fork Feather; HUC #18020122, East Branch, North Fork Feather; HUC #18020123, Middle Fork Feather. Elevation ranges from 2,250 to over 10,000 feet, and annual precipitation varies broadly from more than 70 inches on the wet western slopes to less than 12 inches on the arid east side. Vegetation is diverse and ranges from productive mixed conifer and deciduous forests in the west to sparse sage/yellow pine plant communities in the east. The Plumas National Forest manages most of the forested uplands while the mid-elevation alluvial valleys are predominantly in private ownership.

The Feather River watershed has long been recognized for its recreational and aesthetic value. An abundance of montane rivers, lakes and reservoirs grace the landscape, creating both summer and winter recreational opportunities. Water originating from this area represents a significant component of the State Water Project, which provides high quality water to meet downstream urban and agricultural demand. In addition, a series of hydroelectric dams, powerhouses and reservoirs produce over 4,000 MW of power, while the watershed produces significant forest and agricultural outputs. Water is, therefore, a valuable commodity in this resource-dependent community, and maintaining stable watershed condition is a key element in promoting economic and environmental stability.

The Feather River watershed has been impacted by 140 years of intense human use. Mining, over-grazing, timber harvesting, wildfire, railroad and road construction effects have all contributed to a watershed-wide stream channel entrenchment process. This entrenchment resulted in accelerated erosion, degraded water quality, decreased vegetation and soil productivity, and degraded terrestrial and aquatic habitats. Functionally, the disconnection of stream channels from their floodplains and meadows has led

to a dramatic change in hydrology, leading to reduced summer flow, higher summer water temperature, lower water tables, reduced meadow storage capacity, and a trend from perennial to intermittent flow. Many downcut streams no longer sustain late-season flow, causing adverse consequences to riparian and upland vegetation, aquatic communities, and downstream water users (Ponce and Lindquist 1990).

The FRCRM recognized that restoring watershed function was a major priority for reversing erosional trends. Stable, well-vegetated streams with functioning meadows, aquifers and uplands are critical in maintaining good watershed condition. Achieving this stable state begins with reestablishing water and sediment retention and release functions in headwater meadows, which is the current focus of the FRCRM (Lindquist and Wilcox 2000). Restoration activities play an important role in accelerating improvement in watershed function, the local economy and downstream uses. The results of this monitoring program will help the FRCRM assess the long-term trends in watershed condition in response to projects and may provide useful information in the future to help prioritize limited restoration funding to areas of greatest need.

Project Work Plan

The pilot monitoring program was developed in 1997-1998 under the guidance of FRCRM Monitoring Technical Advisory Committee (TAC). The program was implemented over a two-year period, from 1998-2000. The first year focused on developing a strategy and work plan (Appendix A) that was realistic, feasible and met project objectives. Data collection took place the second year of the project for both the reference reach and permanent station components which is described in more detail in the *Sampling Design and Protocol* section of this document.

The overall objectives of this program are to:

- Develop, implement and evaluate a monitoring program which documents, at the watershed scale, long-term trends in watershed condition cumulatively resulting from restoration activities, land management changes and natural processes in the Feather River basin.
- Develop a spatially referenced data management system to track, organize, and store monitoring data, facilitate analysis, provide a means for widespread distribution and education, and support production of reports needed to evaluate long-term trends. The system used should be compatible with other data sets managed by Quincy Library Group (QLG), Department of Water Resources (DWR), USFS, and others.
- When possible, use monitoring protocols currently used by resource management agencies to facilitate data sharing and to improve data analysis.

The monitoring approach consists of three basic components designed to address project objectives. They are:

- ◆ Biennial monitoring of physical and biological parameters at 21 designated permanent response reference reaches.
- ◆ Installation of 11 permanent recording stations where data loggers continuously record streamflow and temperature data, and where water chemistry samples are collected manually.
- ◆ Regional physical and climatic data are collected at a newly installed weather station at Doyle Crossing. This weather station was purchased and installed by CDWR as a contribution to the project (\$25,000). The Doyle Crossing weather station is satellite-accessed, with real-time data available through the Ca. Data Exchange Center (CDEC).

Major tasks carried out in this pilot program include:

- the development of a monitoring work plan;
- purchase and installation of monitoring equipment;

- reference reach initial surveys;
- direct measurements of stream flow for rating permanent stations;
- collection of turbidity, flow and stream temperature data via data logger;
- manual collection of water chemistry samples;
- development of a GIS-based data management system and web interface;
- installation of one meteorological station;
- securing landowner agreements to access equipment and collect data on private land;
- identify and secure funding for the monitoring program beyond the two year pilot phase.

1. Sampling Design and Protocols

Reference Reach Monitoring

Objective: Monitor physical and biological parameters in selected reference reaches at 21 locations in the watershed on a biennial basis. The data is expected to provide a baseline condition with which to discern changes in watershed condition resulting from land management, restoration and natural processes.

Reference reaches were selected based on several criteria. The major criteria include channel sensitivity to change, current and future management activity, accessibility for data collection, position in the watershed and reach length. From a monitoring perspective, we are more interested in sensitive or response reaches since these sites react more quickly to changes in management and natural events, and therefore, will demonstrate change more readily in a long term monitoring program. The selected reaches should be representative of the system. Sites selected for this program are characterized as low gradient, alluvial and have minimum on-site disturbance to avoid data “noise”. The reaches are located at or near the base of each sub-watershed to provide a cumulative measure, and are at least 20 channel widths in length (which is the designated minimum length of each reference reach).

The fieldwork for reference reach data collection is conducted by a team of trained technicians that are supervised by an experienced crew leader with extensive field and data collection experience and a technical background in hydrology and biology. To the extent possible, the fieldwork will follow scientific procedures and protocols that are well established in the primary literature or common practices of federal or state resource agencies in the watershed. Data quality control is discussed more fully in the FRCRM Quality Assurance Protection Plan (Appendix B) prepared as part of this CWA 319 grant.

Sampling Approach

The monitoring approach relies heavily on established procedures developed by resource management agencies and on collective expertise offered by FRCRM contributors. It was designed particularly in terms of assessing changes in channel structure, habitat and water quality factors. Field sampling procedures are based on protocols described in the "Stream Condition Inventory Guidebook" (SCI) version 4.0 (1998) (Appendix C). These protocols were developed over a five-year period (1993-98) by fisheries biologists and hydrologists in the US Forest Service Region 5, with support for sampling design and statistical analysis from the USFS Pacific Southwest Research Station. SCI methods were critiqued and in some cases modified by the FRCRM Monitoring Committee to meet project needs. Parameters included in the sampling design and the location of reference reaches are listed on Table 2.

The intent was to provide protocols that can be consistently applied in assessing and monitoring stream conditions in the Pacific Southwest Region, which includes the Feather River basin. Attributes were tested that had been demonstrated through research to be indicative of stream condition, could be sampled

by seasonal field crews, and yet had low enough measurement error to be useful in describing changes in stream habitat with a moderate to high level of confidence. The intensity of data collection meets the objective of comparing data over time, or from other streams with a reasonable level of statistical confidence.

Biennial reference reaches were established at the locations listed in Table 2 below. Physical and biological data collected at each reach is listed. Location of each site in the watershed is shown on Figure 2.

Table 2: Enumerated Reference Reaches

Reach #	Location	Reach #	Location
1.	NFFR above Lake Almanor	12.	Indian Creek at Taylorsville
2.	Goodrich Creek above Mountain Meadows Reservoir	13.	Indian Creek acw Spanish Creek
3.	NFFR below Lake Almanor	14.	Spanish Creek acw Rock Creek
4.	Butt Creek above Butt Valley Reservoir	15.	Greenhorn Creek acw Spanish Creek
5.	NFFR acw** EBNFFR	16.	Spanish Creek acw Greenhorn Creek
6.	EBNFFR acw NFFR	17.	Spanish Creek acw Indian Creek
7.	Wolf Creek above confluence with Indian Creek	18.	Middle Fork Feather River (MFFR) at Beckwourth
8.	Lights Creek acw Indian Creek	19.	Sulphur Creek acw MFFR
9.	Last Chance Creek acw Red Clover Creek	20.	Jamison Creek acw MFFR
10.	Red Clover Creek acw Last Chance Creek	21.	MFFR acw Nelson Creek
11.	Indian Creek acw Red Clover Creek		

**acw = above confluence with

Reference Reach Data Collection

Monitoring is conducted on a biennial basis. Physical and biological parameters are listed below:

- **Channel morphology**, including channel cross sections, channel slope, channel substrate sampling, and pool tail fines. Transect data includes bank stability, shade, width/depth ratio, stream shore water depth, and bank angle. Bankfull discharge will be estimated based on these measurements.
- **Water chemistry**, including water and air temperature.
- **Habitat**, including spatial distribution of fast and slow water via longitudinal gradient (i.e. pool and riffle orientation), pools (size, depth and number), pool tail substrate, shading, and stream bank stability (i.e. vegetation cover).
- **Macro-invertebrates**, including analysis of population numbers and species diversity in comparison to Sierra Nevada reference sites. Not originally part of SCI protocol, but has been added on with the availability of reference site data.
- **Aquatic fauna**, including fish surveys to identify species present and herpeto-fauna.
- **Aerial and ground photographs**, to provide visual documentation of instream and upland changes in vegetation and channel structure, and to support other monitoring results.

Results of long-term data analysis will be integrated with other Feather River watershed monitoring activities underway or contemplated by the USDA Forest Service, DWR, UCCE, QLG and others. A Technical Advisory Committee (TAC) composed of FRCRM Monitoring Committee members, agency specialists, and academic reviewers provided technical guidance and oversight on the implementation of the project. The TAC members were identified in spring 1999.

2. Permanent Station Monitoring

Objective: The primary objective of the permanent monitoring stations is to record stream stage over a broad range of flow conditions in order to provide a comparative measure of the changes at each station over time and to possibly detect changes in hydrographic conditions related to stream restoration efforts. Secondary objectives to provide comparative measures of expected changes at each station over time include monitoring stream temperature, and air temperature at each location. The water temperature provides supplemental information regarding the condition of the channel upstream of the monitoring site as well as some indication of the source water's characteristics. Air temperature can be used to explain behavior of water temperature as well as some hydrographic events. Water quality samples are collected manually to allow for further analysis of the origin, age and movement of in-stream flow.

Sampling Approach

Eleven sites were identified as appropriate permanent sampling stations. The name and respective data collection for each station are listed in Table 2. Criteria used to select a site include the existence of a bridge that equipment could be bolted to (one exception), a relatively stable location to install sensors, good access and a lower position in the respective drainage.

For Permanent Station monitoring, most data is being collected electronically and downloaded by field personnel on 60-day intervals. The equipment installed, discussed below, is state-of-the-art and is maintained and downloaded by experts familiar with the geographic area and the equipment. Technicians working with the FRCRM have extensive experience on with this equipment and bring that expertise to the FRCRM program.

Samples collected at permanent stations are listed in Table 3 below. Location of each site in the watershed is shown on Figure 3.

TABLE 3: Measurements taken at permanent stations

Station #	Location	Stream Flow & Temp.	Staff Gage	Weather Station*	Sediment & Turbidity	Water Quality
1.	Last Chance Creek at Doyle Crossing	X	X	X		X
2.	Red Clover Creek at Notson Bridge	X	X			X
3.	Indian Creek at Taylorsville	X	X	X	X	X
4.	Indian Creek at Flournoy Bridge	X	X			X
5.	Middle Fork Feather River at Sloat		X			
6.	Indian Creek above confluence with Red Clover	X	X			X
7.	Spanish Creek at Keddie (existing USGS)	X	X			
8.	Spanish Creek at Gansner Bridge	X	X			X
9.	Wolf Creek at Greenville Main Street Bridge	X	X		X	X
10.	Lights Creek at Deadfall Bridge	X	X			X
11.	Indian Creek at Crescent Mills	X	X			X

* Data taken at weather stations includes: rainfall, temperature, relative humidity, wind speed, wind direction, atmospheric pressure.

Permanent Station Data Collection

Monitoring is conducted continuously for data collected by data loggers, and on 60-day intervals for manually collected data. Parameters are listed below:

- Continuously monitor **water temperature** and **stage** at eleven permanent sampling stations with a Campbell 500 data logger system;
- Conduct continuous **turbidity** monitoring during high flow seasons at two stations with a laser sensor;
- Collect **conductivity, pH, and isotopic samples** manually at all stations during routine maintenance of data loggers;
- Collect **bedload and suspended sediment** data in various flow regimes at two stations;
- Collect **flow** data at various stages to produce stage/discharge rating curves for each station, and
- Collect **climatic data** at two installed meteorological stations that are linked via satellite to the CDEC database. Data includes relative humidity, temperature, wind speed, wind direction, atmospheric pressure, evapo-transpiration, solar radiation and precipitation.

Equipment Installation

Following an evaluation of available monitoring equipment, the study team chose the CR10X datalogger and associated equipment manufactured by Campbell Scientific to instrument each site. Table 4 and Table 5 provide details regarding the instrumentation deployed at each permanent station. This Campbell equipment was chosen largely based on the long-standing presence of the manufacturer in the remote monitoring market place and the reputation of product reliability. The CR10X was selected because of its ease of programming, flexibility and expandability.

Stream stage is measured using standard pressure transducer technology. Pressure transducers were selected because they provide acceptable accuracy while allowing rapid low cost deployment. The selected Druck 5-psi pressure transducers are accurate to ± 0.01 ft. over a range of 11.53 ft. These units have a typical life span of approximately 5 years. Pressure transducers measure the depth of water over the sensor probe, which is converted to the reference gage height using a site-specific mathematical formula. The reference gage heights are then used in conjunction flow measurements to develop a stage/discharge rating table that can be applied to the collected data from the instrument

The primary problem associated with transducers is a drift in relative accuracy. This drift can be due to age, changes in barometric pressure, and extreme ambient temperatures. The inaccuracies associated with changes in barometric pressure are minimized through the use of a vent tube from the sensor to the atmosphere. Fluctuations related to changes in temperature are calculated to be less than the accuracy resolution that is required of the instrument. Accuracy drift related to age can be accounted for with a strict QA/QC policy that evaluates change in transducer readings compared with reference gage heights.

Table 4:Permanent Station Monitoring Equipment

Equipment Description	Deployment Location
Datalogger (Campbell CR10X)	All stations
Air temperature sensor	All stations
Gill radiation shield	All stations
Druck 5 psi transducer	All stations
Turbidity (Analite 195)	Taylorsville, Doyle Crossing
Water temperature sensor	All stations
Battery (33 amp/hr gell cell)	All stations
Solar Panel	Doyle Crossing, Notson Bridge
Lockable enclosure (sealed)	All stations
Protective enclosure (metal)	All stations
Stillling well /probe attachment	All stations

Table 5: Permanent Station Installation Information

Station	Stream	Installation Date	Station Configuration
Notson Bridge	Red Clover Creek	10/22/1999	Full station installation
Taylorville Bridge	Indian Creek	10/29/1999	Full station installation
DWR Weir	Indian Creek	11/04/1999	Full station installation
Flournoy Bridge	Indian Creek	11/05/1999	Full station installation
Doyle Crossing Bridge	Last Chance Crk	11/19/1999	Up-graded existing
Wolf Creek Main Street	Wolf Creek	12/21/1999	Full station installation
Deadfall Bridge	Lights Creek	12/28/1999	Full station installation
Moccasin Reef at Hwy. 89	Indian Creek	01/06/2000	Staff gage only
Spanish Creek at Quincy	Spanish Creek	Pending	Full Station Installation Spring, 2001

Installation Methods

The specific method of equipment installation at each site was determined during scoping surveys conducted in April 1999. The location of each station is associated with a road bridge or flow control structure to help facilitate installation. Installation methods consisted of installing a permanent probe-mount housing in the stream below the minimum expected water level. The probe-mount housing was typically mounted to the bridge pier or bedrock. The primary objective of this type of installation is to prevent any movement in the probe-mount housing during high flow events.

A protective metal enclosure was then installed on the bridge or other suitable structure above the anticipated high water level. A sealed instrument enclosure was mounted inside the protective metal enclosure. Flexible and/or rigid conduit was then buried and/or attached to the bridge structure to provide a protected channel for the probe cables between the metal enclosure and the in-water probe-mount housing.

The probes were mounted inside the probe-mount housing using an aluminum pinch block. This method of attachment allows for a secure immovable attachment with ease of maintenance and repair of the equipment.

The CR10X data loggers were then installed and data collection initiated. The data loggers were programmed to sample stream stage and temperature every 15-minutes and using this data calculate and record an hourly average. The loggers were also programmed to roll-up the 15-minute information on daily basis, calculating the daily maximum, minimum, and average stream stage, and average daily stream and air temperature. Other parameters (instrument operation) were also included in the daily roll-up.

In addition to the pressure transducers a reference staff gage was installed at each station. This provided a permanent reference to facilitate checking transducer drift and providing a cross-reference to previous data when the transducer needs to be repaired or replaced.

Installation of the monitoring stations was begun in October 1999. Specific installation information for each station is included in Table 3. Seven of the eight permanent stations were installed by January 2000. The station at Spanish Creek was not installed as a result of logistical delays and the onset of high flows which prevented the attachment of the probe-mount housing below the minimum water level. Installation of the Spanish Creek station is scheduled for spring 2001. The existing station on Last Chance Creek at Doyle Crossing was upgraded with the installation of a CR10X to conform to the other stations in the monitoring network.

Flow, sediment and water quality monitoring

Discharge measurements at differing stages have been taken at eight locations. These measurements are taken on a measured cross-section with a Price 622 velocimeter mounted on a rod for wading or suspended by cable from a bridge crane, bridge board or truck mounted boom as needed. The protocol for these measurements is detailed in the QAPP. This data will be used to develop flow rating curves once enough points have been established.

Suspended sediment data will also be collected at two permanent station sites (see Table 3). Data will be collected using either a rod or cable system as per flow measurements above. The protocol for this sampling program is detailed in the QA/QC. Minimal turbidity and suspended sediment measurements have been collected due to relatively low flows and equipment delivery delays for the year 2000 winter period. No bedload sampling has been undertaken for the reasons stated above.

FRCRM staff manually collects water quality data when data loggers at permanent stations are downloaded, usually on 60-day intervals. This is an ancillary monitoring component conducted at the request of Plumas Geo-Hydrology and Desert Research Institute (DRI). The purpose is to analyze the naturally occurring chemical and isotopic characteristics in order to determine the origin of the water (surface, shallow meadow, deep aquifer, etc.) by season. DRI has offered to conduct the analysis so samples are labeled and sent to their facilities in Reno, Nevada.

Data Management and Analysis

The data will be used to provide a baseline from which to monitor long-term trends in the condition of the Upper Feather River watershed. It will also be used to document trends in watershed condition cumulatively resulting from restoration activities and natural events. To facilitate this comparative analysis, a series of Excel spreadsheets have been developed by Ken Cawley (Feather River College) for reference reach data and by Mike Kossow and Tim Sagraves (consulting watershed specialists) for permanent station data. (Water chemistry data is being analyzed separately by Desert Research Institute so is not discussed here). The spreadsheets are formatted to store the data as it is collected (in the case of data loggers) and to facilitate trend analysis. They are linked to a spatially referenced data management system or Geographic Information System (GIS) that was developed by the CDWR and California State University Chico scientists. Data layers will be set up for each parameter consistent with layers already developed by the Plumas National Forest to encourage data sharing. The data will be distributed via the FRCRM website and through the data "clearinghouse" on the California State University Chico website.

These data will provide critical input to the restoration program conducted by the FRCRM. Identification of conditions throughout the watershed will allow prioritization of restoration projects in terms of location and goals. This data may also be useful in quantifying the benefits of past restoration efforts. Information on watershed condition will serve as baseline data for future projects.

The data and analyses will be available to a wide resource management audience, including local land management agencies, academics and private landowners. These data will hopefully inform land

management decisions made by many organizations and individuals, which have the potential of affecting the Feather River watershed. In addition, this information will be useful to the public to gain insight on the overall condition of the Feather River watershed, and the connections between land use, restoration, and watershed condition. The data will be made available to a broad audience through the FRCRM website and through the CSU Chico website as previously mentioned.

Reference Reach Data

Reference reach data was collected in four passes along the stream, as detailed in the QAPP (Appendix B). The tables in Appendix D summarize all data for the Greenhorn Creek acw Spanish Creek Reference Reach is included as an example of the data output and how the spreadsheets are formatted. The raw data for all passes is currently stored at Plumas Corporation and is available to FRCRM members upon request. Due to the vast amount of raw data, data made available via the Internet for broader distribution will generally be in the summary table format.

Macroinvertebrate samples were collected, labeled and stored as described in the QAPP. The National Aquatic Monitoring Center, Utah Dept. of Fish & Wildlife, Ogden, Utah, which was recommended by Plumas National Forest staff, will process the samples. Samples will be sent out for identification once the Ambient Water Quality Monitoring contract is in place.

Water and ambient air temperature is monitored at each reference reach site with HOBO Temp data loggers. The temperature loggers are installed at the lower end of each reach in early June and collected in early September. Temperatures will be recorded to determine mean maximum temperature for the period July 1- August 31. The full temperature range for this period will also be recorded through hourly measurements for a minimum of 1468 data points (1 hr./62+ days). Software will be provided by the Lassen National Forest to manage and analyze the data.

Channel substrate samples are processed using nested sieves for <4mm particles and a millimetric ruler for >4mm particles. The purpose is to quantify the bed characteristics by weight/particle size class. This information will provide baseline information with which to compare future bed composition changes relative to watershed restoration projects, management changes and natural processes. This sampling methodology is more sensitive to changes in finer sediment classes (<2mm) than the standard Wolman pebble counts.

Permanent Station Data

The Campbell data loggers record stream stage, along with ambient air and water temperature data, in fifteen-minute intervals, year-round. The data loggers are capable of storing up to six (6) months of data. FRCRM staff and contract technicians download data on a bi-monthly interval. This more frequent operation is undertaken to ensure reliable station continuity and detect potential problems that would compromise data reliability. The data from the logger is entered into a laptop computer, station diagnostics are performed, then data is transported to Plumas Corporation and electronically entered into the data archive.

Automated turbidity measurements are being recorded at two (2) stations, Doyle Crossing and Indian Creek- Taylorsville Bridge, using Analite 195 laser sensors, a nephelometric (n.t.u.) probe. This is new technology that the FRCRM considered worthy of demonstration and critique for effectiveness and maintainability.

Figure 4a. is an example of data output that plots the average water temperature for Wolf Creek at Main St. Bridge, one of the instrumented permanent stations. Figure 4b. characterizes output for stream flow at the same location.

Rating Tables are being developed for each permanent station. In order to correlate stage records to stream flow volume, direct flow measurements are conducted at a variety of stages to develop a station-specific rating table. Table 6 is the preliminary rating table for Spanish Creek @ Gansner Bridge. These tables then allow for the assignment of discharge values to the recorded stages in the absence of direct measurement. It is anticipated that an initial minimum of seven readings will be necessary to develop an accurate rating curve, depending on the measurement site characteristics. The opportunity to conduct direct measurement at stages above bankfull (1.5 year return interval) are dependent on infrequent weather events and may require several years to accomplish. Due to instability, some stations may also require rating curves to be periodically re-calculated.

Results and Discussion

Reference Reach Monitoring

Each of the 21 reference reaches were monumented and monitored. One original reach (Hamilton Branch, below Lake Almanor) was exchanged for Goodrich Creek, above Mountain Meadows Reservoir. This was done because of the boulder nature, poor access and the reach lack of ability to respond to Hamilton Branch.

There were no major problems with the monitoring equipment or with the monitoring crew. Crew training took a week in the field during the monitoring of the first two reaches. Data collection oversight and additional training continued to insure that protocols and procedures were followed on each reach. Monitoring of each of the 21 reach took between 16-17 hours once the crew was trained.

The monitoring crew consisted of one Crew Leader (the contractor) and 3 Feather River College students and one crewmember supplied by DWR. It was necessary for the college students to return to college prior to completing all 21 reaches. The last two reaches were completed by the Crew leader and one crewmember.

The collection of maximum sediment lens depth (S^*) proved to be unworkable in most of the field conditions encountered and was dropped from data collection. The collection of aquatic fauna data was taken during the last of the four pass taken on each reach. This may have resulted in limited observations of fauna due to the disturbance caused by the first three passes. The installation of temperature data loggers on each reach proved to be difficult for the first monitoring season because the exact location of the reach to be monitored was not determined until a site visit took place. The temperature loggers need to remain at the reach for 60 to 90 days. Reaches monitored later in the field season have no temperature data because loggers could not be installed for the amount of time necessary to follow protocols.

Permanent Station Monitoring

All of the operating stations functioned without failure during the 1999-2000 high runoff period. No loss of data occurred as a result of monitoring equipment failure. On July 2, 2000, the Red Clover Creek at Notson Bridge station was vandalized and the transducer cable was damaged. Replacement was completed on August 11, 2000.

Installation of air temperature sensors was delayed when it was determined that the probes where fabricated incorrectly and had to be returned. A test of the new air temperature probes at Notson

indicated that they required special programming which was successfully completed in August 2000. The remaining air temperature probes were installed in the fall of 2000. The data loggers are programmed to record internal temperature that can be used as an indicator of ambient air temperature during the period when the air sensors are not deployed.

During the final phase of discussions regarding station configuration it was determined that an attempt to measure turbidity should be made at two stations. These stations (Taylorsville and Last Chance Creek) were selected primarily do to their ease of installation and the general thinking that they would provide the most useful information. The probe selected to monitor turbidity was the Analite Model 195 nephelometric probe. These units have a built in wiping mechanism that helps to eliminate biofouling caused by long term immersion. The deployment of these probes was delayed by the onset of high flows. These units will be deployed in summer 2001.

In addition to the completion of station installations and special probe deployment, other activities scheduled for 2001 include: compiling and developing the stream stage versus flow relationship to allow conversion of transducer readings to discharge, and a routine maintenance effort at each station to prepare for the high flow period.

Water quality data collected manually by FRCRM staff has not been received from DRI. This is due to the limited amount of samples collected to date. DRI is committed to carrying out this analysis in the upcoming field season when more samples are collected and analyzed.

Recommendations

Reference Reach Monitoring:

For the purpose of the Watershed Monitoring Program, two of the original SCI protocols have been dropped or replaced by other protocols and three additional protocols have been added. Large woody debris (LWD) counts and pebble counts have been dropped from the protocol. Pebble counts have been replaced by the sieve analysis of channel substrate material collected from point bars as well as riffle pavement and sub-pavement.

Pebble counts, while a relatively inexpensive method of characterizing bed surface composition, do not accurately represent all sediment size fractions being transported by the channel in bankfull or greater events. The smaller particle sizes, which will be most affected by changes in watershed condition, are often winnowed out of the surface component by the more frequent, longer duration sub-bankfull flows. Bar and riffle subpavement samples, which are collected below the bed surface and not subject to winnowing, more accurately represent the full range of sediment load. The drawback to this type of sampling is that the processing of these multiple samples is labor-intensive and expensive.

Recommendation: Significant changes in channel substrate composition are likely to be relatively slow due to in-channel storage and the infrequent interval of bed mobilizing flows. Therefore, collection and processing of substrate samples should be conducted at every second or third biennial visit, or, the next visit after the watershed has been subjected to a to-be-defined threshold hydrologic event (i.e. 10-year flood).

Water surface longitudinal channel profile survey and macroinvertebrate sampling have been added to the monitoring protocols for this project. Channel profiles are important in helping to determine the changes in the channel configuration, slope and geometry over time. Macroinvertebrate sampling is important in adding a biological element to the monitoring and provides a useful index to assess changes in biological integrity.

Temperature data loggers need to be installed on all reaches prior to the start of the monitoring season and retrieved as soon as the last reach is completed. This will provide the same number of monitored days for each reach. Data loggers need to be cabled into streams and riparian areas to limit loss or theft of the equipment in areas that have high public visitation for recreation.

Recommendation: Maximum sediment lens depth (S*) measurements were originally designed to measure sediment in shallow pools in small wading streams. This proved to be unworkable for most of reaches due to deep pools and low water visibility. The protocol dropped.

Recommendation: Aquatic Fauna data needs to be collected as the first pass before any channel disturbance takes place.

Recommendation: Originally a 5 person crew was used to conduct the monitoring. A crew of 4 would work just as well, especially if some of the measurements may be dropped from the procedure.

All other standard SCI protocols were implemented without undue difficulty and appear to provide useful baseline information.

Permanent Station Monitoring

In general the permanent station installations went well with very few problems. The selected equipment has performed beyond expectations at all locations. The attributes of each station site were thoroughly analyzed prior to selection to balance the opportunities and limitations specific to each. There does not appear to have been any significant deviation from the original analysis.

Installation is a fairly straightforward operation in which a two-person team can easily install one station a day assuming adequate prior material preparation. Adequate material preparation includes having all installation housings prefabricated uniformly, a complete selection of mounting hardware of various sizes and types, drilling templates, extra tool bits, batteries and a fully programmed logger with wiring diagrams.

Since initial installation, the only failure was gunfire vandalism at the Notson Bridge site. Bullets pierced the cable conduit and severed the sensor cables.

Recommendation: At this juncture no changes are recommended.

Flow and sediment monitoring

Streamflow monitoring has been conducted, and continuing at each of the stations. To date, this has been accomplished with the primary objective of developing a discharge rating table for each station. Since station installation there have been only modest changes in streamflow at any of the stations. This condition has resulted in very few (average of 3/station) streamflow measurements being conducted. Each direct measurement has an average cost of approximately \$200.00. In order to maximize the utility of these initial measurements, stage change thresholds to be measured were identified and prioritized that would provide reliable data points for rating table development. At most stations streamflows have not yet reached many of these threshold points. In general, the intent was to conduct several measurements at/near summer baseflow, then conduct measurements a .5' increments and, whenever a significant change in channel form occurred (bankfull stage, full-wetted gully, etc.). Most of the monitored streams have not achieved even a bankfull stage since station operations began.

More intensive streamflow monitoring will be conducted at those stations where sediment monitoring is being undertaken. Each time sediment sampling is conducted a flow measurement will be performed, regardless of the above described stage thresholds. These activities will generally be conducted and funded under the scope of other watershed projects, such as Proposition 204 and will augment the trend monitoring program. For the same reasons cited above, lack of streamflow, minimal sediment monitoring has been accomplished to date.

Recommendation: No changes are recommended at this time.

References:

"Stream Condition Inventory Guidebook" version 4.0, United States Department of Agriculture, Forest Service, Pacific Southwest Region, 1998.

"East Branch, North Fork Feather River Erosion Control Strategy", Clifton, 1994

"Management of Baseflow Augmentation: A Review", Ponce and Lindquist, 1990

"New Concepts for Meadow Restoration in the Northern Sierra Nevada", Lindquist and Wilcox, 2000

"Feather River Coordinated Resource Management Monitoring Plan- 319(h) Program", 1997

APPENDIX B
STREAM CONDITION
INVENTORY
DATA
SUMMARIES

SCI Pass Summary for Goodrich Creek											
Pass 2 Cross-section summary											
note: all units in feet											
Owner	Stream	Date	Crew	Cross-Section	Bankfull Width	Bankfull Depth	Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio	
Beaty&Assoc	Goodrich	9/8/99	Clifton/Yarnell	1	27.00	1.34	1.64	20.22	255.11	9.45	
Beaty&Assoc	Goodrich	9/8/99	Clifton/Yarnell	2	25.00	1.32	1.60	18.93	275.20	11.01	
Beaty&Assoc	Goodrich	9/8/99	Clifton/Yarnell	3	34.90	1.25	1.54	27.92	571.33	16.37	
PVT	Goodrich	8/7/01	Clifton et al.	1	16.90	1.05	1.47	16.09	516.90	30.58	
PVT	Goodrich	8/7/01	Clifton et al.	2	19.20	0.85	1.16	22.60	519.20	27.04	
PVT	Goodrich	8/7/01	Clifton et al.	3	24.70	0.91	1.41	27.14	524.70	20.45	
Pass 2 Transect Summary											
PVT	Goodrich	Date	Crew	Transect	Width	Depth	Depth	Ratio	Width	Ratio	
PVT	Goodrich	9/8/99	Clifton et al.	1	18	1.05		17.14	518	28.7	
PVT	Goodrich	9/8/99	Clifton et al.	2	25.6	0.94		27.23	525.6	20.53	
PVT	Goodrich	9/8/99	Clifton et al.	3	21	1.17		17.94	521	24.8	
PVT	Goodrich	9/8/99	Clifton et al.	4	25	1.07		23.36	525	21	
PVT	Goodrich	9/8/99	Clifton et al.	5	20	1.08		18.51	520	26	
PVT	Goodrich	8/7/01	Clifton et al.	1	22	0.95		23.15	522	23.72	
PVT	Goodrich	8/7/01	Clifton et al.	2	17.6	0.91		19.34	517.6	29.4	
PVT	Goodrich	8/7/01	Clifton et al.	3	18.7	0.68		27.5	518.7	27.73	
PVT	Goodrich	8/7/01	Clifton et al.	4	16.2	0.68		23.82	516.2	31.86	
PVT	Goodrich	8/7/01	Clifton et al.	5	16	0.87		18.39	516	32.25	
Pass 3 pool data											
				Total	Percent			Average	Average	Percent	
				Habitat Lengths		Habitat Lengths		Residual	% fines	Wood-Formed	Avg "Wood"
				Fast	Slow	Fast	Slow	Pool Depth	in pooltails	Pools	Value
Beaty&Assoc	Goodrich			428	865	33%	67%	0.0	16.1	0.0%	
PVT	Goodrich	8/7/01	Clifton et al	152	544	21.8	78.2	2.0	3.3		
Pass 4 (measurements on 2 banks at each of 50 transects)											
Owner	Stream	Date	Crew	Bank Stability Rating			Average	Shore Depth	Shore Depth	Bank Angle	Bank Angle
				# Stable	# Vulnerable	# Unstable	% Shade	% = 0	Avg of rest	%<90	% > 90
Beaty&Assoc	Goodrich	9/9/99	NS	64	34	1	0	85	1.1	11	86
n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a
Biota observations:											
1 bullfrog											
1 rainbow trout											
Definitions:											
Width:Depth - field-id'ed bankfull width / mean bankfull depth											
Floodprone width - width at 2x max bankfull depth											
Entrenchment ratio (i.e. channel confinement in valley) = Floodplain width / bankfull width											
Residual pool depth = max pool depth minus max depth of pooltail crest											
% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooltail)											
Bank stability measured at a one foot wide plot, going from bankfull upslope to break											
Stable - 75% veg, or other non-erodable cover, no sign of instability											
Vulnerable - same as stable, but with sign of instability											
Unstable - less than 75% cover, may have other instability indicators											
% shade - only one measurement per transect with a solar pathfinder											
Shore depth - measured @ the current water's edge											
Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation											
99 to '03 Residual pool depth changes could be due to observer error.											

SCI pass summary for Butt Creek above Butt Valley Reservoir											
NOTE: all units are in feet and tenths											
PASS #2 CROSS-SECTION SUMMARY						Mean	Max				
Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio	
Collins Pine	Butt	7/1/99	Clifton et. al	1	48.5	1.6	2.03	30.3	70.16	1.45	
Collins Pine	Butt	7/1/99	Clifton et. al	2	52.4	1.84	2.31	28.5	66.94	1.28	
Collins Pine	Butt	7/1/99	Clifton et. al	3	41.6	1.69	2.76	24.6	90.99	2.19	
PNF	Butt	7/23/01	Clifton et al.	1	53.30	2.36	3.26	22.58	186.65	3.50	
PNF	Butt	7/23/01	Clifton et al.	2	52.70	1.87	2.79	28.18	144.00	2.73	
PNF	Butt	7/23/01	Clifton et al.	3	47.10	1.93	3.21	24.40	104.40	2.21	
PVT	Butt	7/21/03	Clifton et al.	1	52.20	1.91	2.77	27.29	76.90	1.47	
PVT	Butt	7/21/03	Clifton et al.	2	61.00	2.38	3.33	25.60	142.20	2.33	
PVT	Butt	7/21/03	Clifton et al.	3	44.80	1.98	3.25	22.64	213.70	4.77	
PASS #2 TRANSECT SUMMARY				Transect							
Collins Pine	Butt	7/1/99	Hodge/Martin	1	31.6	1.7		18.77	67.1	2.12	
Collins Pine	Butt	7/1/99	Hodge/Martin	2	41.0	1.5		27.80	47.7	1.16	
Collins Pine	Butt	7/1/99	Hodge/Martin	3	22.7	1.8		12.43	70.9	3.12	
Collins Pine	Butt	7/1/99	Hodge/Martin	4	37.6	2.0		19.11	83.6	2.22	
Collins Pine	Butt	7/1/99	Hodge/Martin	5	30.9	3.2		9.70			
PVT	Butt	7/23/01	Clifton et al.	1	53.4	1.8		29.6	114.45	2.14	
PVT	Butt	7/23/01	Clifton et al.	2	29.7	1.61		18.44	87	2.92	
PVT	Butt	7/23/01	Clifton et al.	3	38.9	2.24		17.36	186.9	4.8	
PVT	Butt	7/23/01	Clifton et al.	4	42.7	1.81		23.59	213.2	4.99	
PVT	Butt	7/23/01	Clifton et al.	5	63.3	1.86		4.1	80.3	1.26	
PVT	Butt	7/21/03	Clifton et al.	1	42.80	2.59	4.00	16.52	227.20	5.31	
PVT	Butt	7/21/03	Clifton et al.	2	53.00	2.64	3.20	20.09	169.00	3.19	
PVT	Butt	7/21/03	Clifton et al.	3	56.00	2.14	4.15	26.17	172.30	3.08	
PVT	Butt	7/21/03	Clifton et al.	4	51.90	2.21	4.13	23.53	197.00	3.80	
PVT	Butt	7/21/03	Clifton et al.	5	61.00	2.01	3.33	30.37	114.00	1.87	
PASS#3 Pool Data				Total		Percent		Average	Average	# Pieces	Pebble
				Habitat Lengths		Habitat Length		Residual	% Fines	Large	Count
				Fast	Slow	Fast	Slow	Pool Depth*	in Pooftails	Wood	D ₅₀
Collins Pine	Butt	6/30/99	Clifton et. al	457	573	44%	56%	2.5	14.1	0.0	
PVT	Butt	7/23/01	Clifton et. al	451	653	40.9	59.1	1.7	9.5	n/a	29
PVT	Butt	7/21/03	Clifton et. al	577	516	52.79	47.21	2.04	12.53	0.00	27
PASS#4 (measurements on two banks at each of 50 transects)											
				Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
Collins Pine	Butt	6/30/99	Clifton et. al	37	25	41	9.6	82	1.4	17	82
Collins Pine	Butt	7/23/01	Clifton et. al	n/a	n/a	n/a	n/a	82	0.97	2	82
PVT	Butt	7/21/03	Clifton et al.	n/a	n/a	n/a	n/a	63	1.05	6	63
FLOW MEASUREMENT (feet & seconds)				width	area	velocity	discharge				
Collins Pine	Butt	7/23/01	Clifton et al	38.4	37.78	0.87	32.7				
PVT	Butt	7/22/03	Clifton et al	42	32.8	1.4	46				
Biota Observations: none											
Definitions:											
Width:Depth - field-id'ed bankfull width / mean bankfull depth											
Floodprone width - width at 2x max bankfull depth											
Entrenchment ratio (I.e. channel confinement in valley) = Floodplain width / bankfull width											
Residual pool depth = max pool depth minus max depth of pooltail crest											
% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooltail)											
Bank stability measured at a one foot wide plot, going from bankfull upslope to break											
Stable - 75% veg, or other non-erodable cover, no sign of instability											
Vulnerable - same as stable, but with sign of instability											
Unstable - less than 75% cover, may have other instability indicators											
% shade - only one measurement per transect with a solar pathfinder											
Shore depth - measured @ the current water's edge											
Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation											
*99 to'03 residual pool depth changes could be due to observer error.											

SCI Summary for NFFR above EBNFFR

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean	Max	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
						Bankfull Depth	Bankfull Depth			
PNF	NFFR above EastBranch	8/12/99	Clifton et al.	1	70.50	1.16	1.68	60.87	82.38	1.17
PNF	NFFR above EastBranch	8/12/99	Clifton et al.	2	63.50	1.30	2.46	48.68	72.48	1.14
PNF	NFFR above EastBranch	8/12/99	Clifton et al.	3	56.60	1.21	2.09	46.71	71.52	1.26
PNF	NFFR above EastBranch	7/18/01	Clifton et al.	1	70.50	1.13	1.73	62.38	82.97	1.17
PNF	NFFR above EastBranch	7/18/01	Clifton et al.	2	63.50	1.36	2.62	46.69	76.40	1.20
PNF	NFFR above EastBranch	7/18/01	Clifton et al.	3	56.10	1.60	2.31	35.06	81.05	1.44
PNF	NFFR above EastBranch	7/16/03	Clifton et al.	1	70.20	1.06	1.60	66.23	93.50	1.33
PNF	NFFR above EastBranch	7/17/03	Clifton et al.	2	62.50	1.27	2.50	49.06	76.50	1.22
PNF	NFFR above EastBranch	7/16/03	Clifton et al.	3	56.30	1.64	2.31	34.43	83.00	1.47

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio	
										PNF
PNF	NFFR above EastBranch	8/12/99	Clifton	2	38.8	1.5	25.06	64.5	1.66	
PNF	NFFR above EastBranch	8/12/99	Clifton	3	52.7	1.8	28.99	87.5	1.66	
PNF	NFFR above EastBranch	8/12/99	Clifton	4	78.0	1.0	76.16	88.8	1.14	
PNF	NFFR above EastBranch	8/12/99	Clifton	5	80.1	1.0	77.77	87.9	1.10	
PNF	NFFR above EastBranch	7/18/01	Clifton et al.	1	70	1.37	51.09	94.95	1.35	
PNF	NFFR above EastBranch	7/18/01	Clifton et al.	2	69.5	0.9	77.22	74.5	1.07	
PNF	NFFR above EastBranch	7/18/01	Clifton et al.	3	60.3	1.07	56.35	75.3	1.23	
PNF	NFFR above EastBranch	7/18/01	Clifton et al.	4	53.8	1.76	30.56	66.27	1.23	
PNF	NFFR above EastBranch	7/18/01	Clifton et al.	5	63.7	1.41	45.17	76.17	1.19	
PNF	NFFR above EastBranch	7/16/03	Clifton et al.	1	77.2	1.22	2.49	63.20	90.5	1.17
PNF	NFFR above EastBranch	7/16/03	Clifton et al.	2	62.5	1.41	1.9	44.46	81.4	1.30
PNF	NFFR above EastBranch	7/16/03	Clifton et al.	3	71.2	1.21	1.83	58.65	89.7	1.26
PNF	NFFR above EastBranch	7/16/03	Clifton et al.	4	68.2	0.90	1.53	75.66	73.7	1.08
PNF	NFFR above EastBranch	7/17/03	Clifton et al.	5	65.4	1.21	1.46	54.20	72.7	1.11

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces Large Wood	Pebble Count D ₅₀
				Habitat Lengths		Habitat Length		Residual	% Fines		
				Fast	Slow	Fast	Slow	Pool Depth*	in Pooftails		
PNF	NFFR above EastBranch	8/11/99	Clifton et al	841	209	80.10	19.90	3.45	8.7	0	
PNF	NFFR above EastBranch	7/19/01	Clifton et al	336	264	56.0	44.0	2.2	3	n/a	55
PNF	NFFR above EastBranch	7/17/03	Clifton et al	337	33	91.1	8.9				30

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
PNF	NFFR above EastBranch	8/11/99	Clifton et al	100	0	0	44.68	n/a	n/a	n/a	n/a

FLOW MEASUREMENT (feet & seconds)

Owner	Stream	Date	Crew	width	area	velocity	discharge
PNF	NFFR above EastBranch	7/19/01	Clifton et al	63.7	92.78	1.88	174.1
PNF	NFFR above EastBranch	7/16/03	Clifton et al	56	91.5	1.78	163.3

Biota Observations: none

Definitions:

Width:Depth - field-id'ed bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (I.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooftail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooftail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

*'99 to '03 residual pool depth changes could be due to observer error.

SCI Summary for NFFR above Lake Almanor (above Domingo Springs)

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean Bankfull Depth	Max Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
LNF	NFFRabvAlmanor	7/28/99	Clifton	1	35.70	2.57	4.06	13.87	117.09	3.28
LNF	NFFRabvAlmanor	7/28/99	Clifton	2	50.60	2.01	3.11	25.20	124.83	2.47
LNF	NFFRabvAlmanor	7/28/99	Clifton	3	65.10	2.28	3.80	28.57	94.60	1.45
LNF	NFFRabvAlmanor	7/30/01	Clifton et al.	1	38.60	2.62	4.19	14.73	116.80	3.03
LNF	NFFRabvAlmanor	7/30/01	Clifton et al.	2	53.00	1.70	3.21	31.17	122.40	2.30
LNF	NFFRabvAlmanor	7/30/01	Clifton et al.	3	68.10	2.56	4.06	26.60	105.00	1.54
LNF	NFFRabvAlmanor	7/22/03	Clifton et al.	1	55.70	2.96	5.14	18.82	126.30	2.27
LNF	NFFRabvAlmanor	7/22/03	Clifton et al.	2	59.60	2.60	4.18	22.92	134.60	2.26
LNF	NFFRabvAlmanor	7/23/03	Clifton et al.	3	75.40	2.26	4.72	33.36	112.30	1.49

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Mean Bankfull Depth	Max Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
LNF	NFFRabvAlmanor	7/28/99	Clifton	1	76.9	1.9	37.48	120.5	1.57	
LNF	NFFRabvAlmanor	7/28/99	Clifton	2	63.4	1.7	38.16	116.9	1.84	
LNF	NFFRabvAlmanor	7/28/99	Clifton	3	37.8	2.1	18.19	119.3	3.16	
LNF	NFFRabvAlmanor	7/28/99	Clifton	4	47.0	2.0	23.49	118.3	2.52	
LNF	NFFRabvAlmanor	7/28/99	Clifton	5	48.3	1.9	25.78	98.8	2.05	
LNF	NFFRabvAlmanor	7/30/01	Clifton et al.	1	79.7	1.69	47.15	117.4	1.47	
LNF	NFFRabvAlmanor	7/30/01	Clifton et al.	2	69	1.81	38.12	129	1.86	
LNF	NFFRabvAlmanor	7/30/01	Clifton et al.	3	47	1.66	28.31	87	1.85	
LNF	NFFRabvAlmanor	7/30/01	Clifton et al.	4	54.8	1.87	29.8	105.5	1.93	
LNF	NFFRabvAlmanor	7/30/01	Clifton et al.	5	33.8	1.5	22.53	115.5	3.41	
LNF	NFFRabvAlmanor	7/23/03	Clifton et al.	1	57.5	2.99	4.75	19.20	125.5	2.18
LNF	NFFRabvAlmanor	7/23/03	Clifton et al.	2	66.4	2.48	4.23	26.73	107.5	1.62
LNF	NFFRabvAlmanor	7/23/03	Clifton et al.	3	85.75	1.61	4	53.32	237.4	2.77
LNF	NFFRabvAlmanor	7/23/03	Clifton et al.	4	61.3	2.59	4.96	23.70	108.2	1.77
LNF	NFFRabvAlmanor	7/23/03	Clifton et al.	5	48	2.27	3.87	21.11	100	2.08

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces Large Wood	Pebble Count D ₅₀
				Habitat Lengths		Habitat Length		Residual	% Fines		
				Fast	Slow	Fast	Slow	Pool Depth*	in Pooftails		
LNF	NFFRabvAlmanor	7/28/99	Clifton	680	361	65%	35%	0.5	15.8	0	
LNF	NFFRabvAlmanor	7/31/01	Clifton et al	457	398	53.5	46.5	1.04	14.2	n/a	60
LNF	NFFRabvAlmanor	7/23/03	Clifton et al	628	401	61.0	39.0	1.6	16.33	n/a	110

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
LNF	NFFRabvAlmanor	7/28/99	Clifton et al	65	33	2	50.22	n/a	n/a	n/a	n/a

FLOW MEASUREMENT (feet & seconds)

Owner	Stream	Date	Crew	width	area	velocity	discharge
LNF	NFFRabvAlmanor	7/31/01	Clifton et al	43.1	42.81	0.74	31.8
LNF	NFFRabvAlmanor	7/22/03	Clifton et al	39.5	62.25	1.8	112.2

Biota Observations: none

Definitions:

Width:Depth - field-id'ed bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (i.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooltail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooltail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

*99 to '03 changes in pool depth could be due to observer error.

SCI Summary for Last ChanceCreek blw Murdock Crossing

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean	Max	Bankfull /width:Ratio	Floodprone width	Entrenchment Ratio
						Bankfull Depth	Bankfull Depth			
PNF	LastChance-Murdock	8/2/99	Clifton et al.	1	25.50	1.75	2.71	14.59	87.23	3.42
PNF	LastChance-Murdock	8/2/99	Clifton et al.	2	43.50	1.86	2.82	23.35	61.62	1.42
PNF	LastChance-Murdock	7/29/99	Clifton et al.	3	19.10	1.31	1.55	14.55	62.32	3.26
PNF	LastChance-Murdock	7/24/01	Clifton et al.	1	30.10	1.72	3.07	17.50	87.10	2.89
PNF	LastChance-Murdock	7/24/01	Clifton et al.	2	48.40	1.15	2.05	42.08	58.00	1.19
PNF	LastChance-Murdock	7/24/01	Clifton et al.	3	20.20	1.20	2.23	16.83	65.30	3.23
PNF	LastChance-Murdock	8/6/03	Clifton et al.	1	36.40	1.70	3.23	21.42	89.80	2.47
PNF	LastChance-Murdock	8/6/03	Clifton et al.	2	48.20	1.07	2.07	45.11	58.70	1.22
PNF	LastChance-Murdock	8/6/03	Clifton et al.	3	18.30	1.00	1.51	18.36	60.20	3.29

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Bankfull Depth	Bankfull Depth	Bankfull /width:Ratio	Floodprone width	Entrenchment Ratio
PNF	LastChance-Murdock	7/29/99	Clifton et al.	2	48.1	1.3	37.77	58.9	1.22	
PNF	LastChance-Murdock	7/29/99	Clifton et al.	3	46.5	1.3	36.72	54.7	1.18	
PNF	LastChance-Murdock	7/29/99	Clifton et al.	4	38.1	1.5	25.55	54.8	1.44	
PNF	LastChance-Murdock	7/29/99	Clifton et al.	5	29.6	1.3	23.43	65.5	2.21	
PNF	LastChance-Murdock	7/24/01	Clifton et al.	1	29.1	1	29.1	50.6	1.73	
PNF	LastChance-Murdock	7/24/01	Clifton et al.	2	27.6	1.34	20.58	50.2	1.81	
PNF	LastChance-Murdock	7/24/01	Clifton et al.	3	51.9	1.1	47.18	66.6	1.28	
PNF	LastChance-Murdock	7/24/01	Clifton et al.	4	29.9	1.05	28.47	85.7	2.86	
PNF	LastChance-Murdock	7/24/01	Clifton et al.	5	55.2	1.5	36.8	63.1	1.14	
PNF	LastChance-Murdock	8/5/03	Clifton et al.	1	27.3	1.31	1.76	20.90	44.7	1.64
PNF	LastChance-Murdock	8/6/03	Clifton et al.	2	41.8	1.44	1.88	29.06	62.3	1.49
PNF	LastChance-Murdock	8/6/03	Clifton et al.	3	40.5	1.82	2.65	22.22	62.8	1.55
PNF	LastChance-Murdock	8/6/03	Clifton et al.	4	26.5	1.53	2.55	17.30	126.8	4.78
PNF	LastChance-Murdock	8/6/03	Clifton et al.	5	22.3	1.28	1.84	17.40	82.1	3.68

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces Large Wood	Pebble Count D50
				Habitat Lengths		Habitat Length		Residual	% Fines		
				Fast	Slow	Fast	Slow	Pool Depth* in Pooftails	in Pooftails		
PNF	LastChance-Murdock	8/3/99	Clifton et al.	378	1564	19%	81%	2.0	55.3		
PNF	LastChance-Murdock	7/24/01	Clifton et al.	239	1731	12.1	87.9	1.8	18		18
PNF	LastChance-Murdock	9/12/03	Clifton, Min	191	1715	10.0	90.0	1.53	25.3		20

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
PNF	LastChance-Murdock	8/3/99	Clifton et al	4	20	76	14.7	78	0.62	21	79
PNF	LastChance-Murdock	8/2/01	Clifton et al	n/a	n/a	n/a	n/a	90	0.6	9	91
PNF	LastChance-Murdock	8/7/03	Clifton et al	n/a	n/a	n/a	n/a	72	0.3	3	72

FLOW MEASUREMENT (feet & second: width area velocity discharge)

PNF	LastChance-Murdock	8/6/03	Clifton et al	5.5	1.3	0.83	1.1
-----	--------------------	--------	---------------	-----	-----	------	-----

Biota Observations: none

Definitions:

Width:Depth - field-id'ed bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (I.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooltail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooltail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

*'99 to '03 residual pool depth changes could be due to observer error.

SCI Summary for Red Clover Cr below Chase Bridge

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean	Max	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
						Bankfull Depth	Bankfull Depth			
PNF	dClvrCrkC	9/19&26/95	Compton et al	1	55.1	1.47	2.27	37.5	60.61	1.1
PNF	dClvrCrkC	9/19&26/95	Compton et al	2	64.4	1.39	2.48	46	180.32	2.8
PNF	dClvrCrkC	9/19&26/95	Compton et al	3	36.6	1.4	2.66	26.1	71.00	1.94
PNF	Red Clove	8/4/03	Clifton et al.	1	50.60	1.72	2.86	29.42	202.30	4.00
PNF	Red Clove	8/4/03	Clifton et al.	2	60.60	1.63	2.22	37.18	65.60	1.08
PNF	Red Clove	8/4/03	Clifton et al.	3	74.10	1.62	2.55	45.74	79.60	1.07

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Mean Bankfull Depth	Max Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
PNF	Red Clove	8/4/03	Clifton et al.	2	63.1	1.80	2.58	35.06	78.3	1.24
PNF	Red Clove	8/4/03	Clifton et al.	3	56.9	1.54	2.4	36.95	64.4	1.13
PNF	Red Clove	8/5/03	Clifton et al.	4	89	1.50	2.32	59.33	104.7	1.18
PNF	Red Clove	8/5/03	Clifton et al.	5	55.8	2.00	2.81	27.90	106.9	1.92

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces Large Wood	Pebble Count D50
				Habitat Lengths		Habitat Length		Residual	% Fines		
				Fast	Slow	Fast	Slow	Pool Depth*	in Pooltails		
PNF	RedClover	9/20/95	Cunningham	1274.00	1454.00	46.70	53.30	2.07	19.63	0	15
PNF	RedClover	8/5/03	Clifton et al	793	1463	35.2	64.8	1.95	39.7		22.5

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
PNF	RedClover	9/19/95	Cunningham	19	21	60	1.4	57%	0.17	11	89
PNF	RedClover	8/5/03	Clifton et al					90	0.62	0	90

Observations: none in 2003; dead cow in 1995

Definitions:

Width:Depth - field-measured bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (i.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooltail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per po

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodible cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

*95 to '03 changes in residual pool depth could be due to observer error.

SCI Summary for IndianCr above Red Clover (Flournoy Br)

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean		Max		Width:Depth Ratio	Floodprone width	Entrenchment Ratio
						Bankfull Depth	Bankfull Depth	Bankfull Depth	Bankfull Depth			
PVT	Indian-Flournoy	8/23/99	Clifton	1	81.0	2.70	4.52	30.0	201.0	2.5		
PVT	Indian-Flournoy	8/23/99	Clifton	2	97.5	1.76	2.66	55.3	193.2	2.0		
PVT	Indian-Flournoy	8/23/99	Clifton et al.	3	56.3	1.71	2.42	32.9	94.6	1.7		
PVT	Indian above Flornoy	7/2/01	Clifton et al.	1	84.0	2.81	5.16	29.8	212.0	2.5		
PVT	Indian above Flornoy	7/2/01	Clifton et al.	2	103.6	2.29	3.46	45.2	303.6	2.9		
PVT	Indian above Flornoy	7/2/01	Clifton et al.	3	63.1	2.05	3.05	30.7	276.1	4.4		
PVT	Indian above Flornoy	7/9/03	Clifton et al.	1	81.0	2.44	5.00	33.3	224.0	2.8		
PVT	Indian above Flornoy	7/9/03	Clifton et al.	2	99.0	1.92	3.24	51.5	242.0	2.4		
PVT	Indian above Flornoy	7/9/03	Clifton et al.	3	60.0	1.80	2.83	33.3	214.9	3.6		

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Bankfull Depth	Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
PVT	Indian-Flournoy	8/23/99	Clifton	2	98.5	1.1		91.5	169.5	1.7
PVT	Indian-Flournoy	8/23/99	Clifton	3	94.7	1.7		56.1	126.0	1.3
PVT	Indian-Flournoy	8/23/99	Clifton	4	61.7	1.7		37.2	110.4	1.8
PVT	Indian-Flournoy	8/23/99	Clifton	5	53.0	2.0		27.0	122.5	2.3
PVT	Indian Above Flornoy	7/2/01	Clifton et al.	1	94.0	1.68		56.0	128.3	1.4
PVT	Indian Above Flornoy	7/2/01	Clifton et al.	2	106.5	1.73		61.6	290.5	2.7
PVT	Indian Above Flornoy	7/2/01	Clifton et al.	3	77.0	1.9		40.5	134.6	1.7
PVT	Indian Above Flornoy	7/2/01	Clifton et al.	4	74.3	1.61		46.1	170.6	2.3
PVT	Indian Above Flornoy	7/2/01	Clifton et al.	5	65.3	1.85		35.3	226.1	3.5
PVT	Indian Above Flornoy	7/9/03	Clifton et al.	1	87.5	2.04	2.8	42.9	125.5	1.4
PVT	Indian Above Flornoy	7/9/03	Clifton et al.	2	93.6	1.99	2.8	47.1	113.2	1.2
PVT	Indian Above Flornoy	7/9/03	Clifton et al.	3	94.5	2.02	3.2	46.8	176.5	1.9
PVT	Indian Above Flornoy	7/9/03	Clifton et al.	4	61.4	2.02	3.2	30.5	125.5	2.0
PVT	Indian Above Flornoy	7/9/03	Clifton et al.	5	60.5	1.73	2.5	34.9	116.4	1.92

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces Large Wood	Pebble Count D50
				Habitat Lengths		Habitat Length		Residual	% Fines		
				Fast	Slow	Fast	Slow	Pool Depth*	in Pooftails		
PVT	Indian-Flournoy	8/24/99	Clifton	490	828	37%	63%	2.8	36.6		
PVT	Indian above Flornoy	7/2/01	Clifton et al.	424	777	35.3	64.7	1.9	6.5	n/a	30
PVT	Indian above Flornoy	7/9/03	Clifton et al.	419	680	38.13	61.87	2.82	23	0	27

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
PVT	Indian-Flournoy	8/24/99	Clifton	1	6	93	2.98	100	0	0	100
PVT	Indian At Flornoy	6/27/01	Clifton et al.	n/a	n/a	n/a	n/a	100	0	0	100
PVT	Indian At Flornoy	7/9/03	Clifton et al.	n/a	n/a	n/a	n/a	92	0.49	0	92

FLOW MEASUREMENT (feet & second: width area velocity discharge see continuous recording station data)

PVT	Indian above Flornoy	7/2/01	Clifton et al.
-----	----------------------	--------	----------------

Biota Observations: none

Definitions:

Width:Depth - field-id'ed bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (I.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of poottail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per poottail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

*'99 to '03 changes in residual pool depth could be due to observer error.

CRM SCI Summary for Red Clover below Drum Bridge

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean	Max	Bankfull Width:Depth Ratio	Floodprone width	Entrenchment Ratio
						Bankfull Depth	Bankfull Depth			
PNF	RedClover	7/19/99	Clifton et al.	1	55.50	2.20	2.77	25.28	312.62	5.63
PNF	RedClover	7/19/99	Clifton et al.	2	62.30	2.52	3.43	24.74	121.15	1.94
PNF	RedClover	7/19/99	Clifton et al.	3	53.80	1.89	2.87	28.42	85.85	1.60
PNF	RedClover	6/21/01	Clifton et al.	1	54.50	1.83	2.77	29.78	427.90	7.85
PNF	RedClover	6/21/01	Clifton et al.	2	61.90	2.72	4.31	22.75	111.50	1.80
PNF	RedClover	6/21/01	Clifton et al.	3	59.85	2.05	3.39	29.19	85.50	1.42

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Bankfull Depth	Bankfull Width:Depth Ratio	Floodprone width	Entrenchment Ratio
PNF	RedClover	7/19/99	Webster & Martin	2	42.2	1.8	22.96	71.0	1.68
PNF	RedClover	7/19/99	Webster & Martin	3	44.0	2.5	17.96	68.0	1.55
PNF	RedClover	7/19/99	Webster & Martin	4	66.0	2.2	30.23	85.5	1.30
PNF	RedClover	7/19/99	Webster & Martin	5	55.6	2.0	28.11	92.2	1.66
PNF	RedClover	6/21/01	Clifton et al.	1	65	2.17	29.9	123	1.89
PNF	RedClover	6/21/01	Clifton et al.	2	60.55	2.84	21.32	130.9	2.16
PNF	RedClover	6/21/01	Clifton et al.	3	61.7	2.12	29.1	75.5	1.22
PNF	RedClover	6/21/01	Clifton et al.	4	66.5	1.8	36.94	90.5	1.36
PNF	RedClover	6/21/01	Clifton et al.	5	55	1.71	32.16	71.5	1.3

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces Large Wood
				Habitat Lengths		Habitat Length		Residual	% Fines	
				Fast	Slow	Fast	Slow	Pool Depth	in Pooftails	
PNF	RedClover	7/20/99	Clifton et al	769	268	74%	26%	2.0	9.3	
PNF	RedClover	6/20/01	Clifton et al	1221	305	80.0	20.0	2.2	4.2	

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
PNF	RedClover	7/20/99	Clifton et al	44	26	8		n/a	n/a	n/a	n/a
n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a

FLOW MEASUREMENT (feet & sec)

Owner	Stream	Date	Crew	width	area	velocity	discharge
PNF	RedClover	6/20/01	Clifton et al	35.6	42.47	0.15	6.5

Biota Observations: none

Definitions:

Width:Depth - field-ided bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (I.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooltail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooltail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

SCI Summary for Indian@ Tville (downstream of bridge)

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean	Max	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
						Bankfull Depth	Bankfull Depth			
PVT	Indian-Tville	7/14/99	Clifton e.t al	1	163.80	2.31	3.08	71.00	196.72	1.20
PVT	Indian-Tville	7/14/99	Clifton e.t al	2	102.30	1.82	2.65	56.36	318.12	3.11
PVT	Indian-Tville	7/14/99	Clifton e.t al	3	125.40	2.48	3.52	50.51	451.79	3.60
PVT	Indian-Tville	6/26/01	Clifton et al.	1	167.50	2.00	3.22	83.75	261.40	1.56
PVT	Indian-Tville	6/26/01	Clifton et al.	2	98.50	1.64	2.57	60.06	503.50	5.11
PVT	Indian-Tville	6/26/01	Clifton et al.	3	118.70	1.78	2.76	66.68	252.20	2.12
PVT	Indian-Tville	7/7/03	Clifton et al.	1	170.50	2.56	2.56	66.51	201.50	1.18
PVT	Indian-Tville	7/7/03	Clifton et al.	2	106.70	2.39	3.41	44.66	503.50	4.72
PVT	Indian-Tville	7/7/03	Clifton et al.	3	129.00	2.25	3.32	57.42	174.70	1.35

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Bankfull Depth	Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
PVT	Indian-Tville	7/7/99	Martin and Hodge	2	74.3	2.0		37.50	226.0	3.04
PVT	Indian-Tville	7/7/99	Martin and Hodge	3	46.0	1.5		29.74		
PVT	Indian-Tville	7/7/99	Martin and Hodge	4	91.0	1.8		50.82		
PVT	Indian-Tville	7/7/99	Martin and Hodge	5	92.0	1.6		57.62	241.0	2.62
PVT	Indian-Tville	6/26/01	Clifton et al.	1	112.6	1.27		88.6	450.5	4
PVT	Indian-Tville	6/26/01	Clifton et al.	2	65.1	1.31		49.69	521	8
PVT	Indian-Tville	6/26/01	Clifton et al.	3	87.3	1.53		57.05	597	6.84
PVT	Indian-Tville	6/26/01	Clifton et al.	4	73.5	1.45		50.6	336.5	4.57
PVT	Indian-Tville	6/26/01	Clifton et al.	5	96.4	1.79		53.85	198.4	2.05
PVT	Indian-Tville	7/7/03	Clifton et al.	1	128.60	2.39	3.94	53.91	169.40	1.32
PVT	Indian-Tville	7/7/03	Clifton et al.	2	139.50	1.82	2.82	76.70	277.00	1.99
PVT	Indian-Tville	7/7/03	Clifton et al.	3	106.70	1.88	2.78	56.86	468.00	4.39
PVT	Indian-Tville	7/7/03	Clifton et al.	4	91.60	2.20	3.19	41.65	597.00	6.52
PVT	Indian-Tville	7/7/03	Clifton et al.	5	99.00	2.50	3.41	39.57	176.30	1.78

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces	Pebble
				Habitat Lengths		Habitat Length		Residual	% Fines	Large Wood	Count D50
				Fast	Slow	Fast	Slow	Pool Depth*	in Pooftails		
PVT	Indian-Tville	7/7/99	Clifton et al	350	1289	21%	79%	3.8	34.9	1.35	
PVT	Indian-Tville	6/27/01	Clifton et al	357	1277	21.8	78.2	1.7	2.5	n/a	35
PVT	Indian-Tville	7/8/03	Clifton et al.	281	1377	16.95	83.05	1.89	11.87	0	36

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
PVT	Indian-Tville	7/6/99	Clifton	1	6	93	2.8	96	2.7	2	97
PVT	Indian-Tville	6/27/01	Clifton et al	n/a	n/a	n/a	n/a	98	0.4	1	99
PVT	Indian-Tville	7/7/03	Clifton et al.	n/a	n/a	n/a	n/a	93	0.93	0	93

FLOW MEASUREMENT (feet & seconds)

Owner	Stream	Date	Crew	width	area	velocity	discharge
PVT	Indian-Tville	6/27/01	Clifton et al	20	11.47	0.67	7.7
PVT	Indian-Tville	7/8/03	Clifton et al	52.5	42.43	0.71	30

Biota Observations: none

Definitions:

Width:Depth - field-measured bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (i.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooltail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooltail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

* '99 to '03 residual pool depth changes could be due to observer error.

SCI Summary for Lights Cr above Deadfall Bridge

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Mean		Max		Floodprone width	Entrenchment Ratio
					Bankfull Width	Bankfull Depth	Bankfull Depth	Width:Depth Ratio		
PVT	Lights	6/24/99	Clifton et al.	1	47.20	1.88	2.55	25.15	55.79	1.18
PVT	Lights	6/24/99	Clifton et al.	2	48.80	1.74	2.61	28.05	56.62	1.16
PVT	Lights	6/24/99	Clifton et al.	3	53.70	2.25	4.10	23.86	69.60	1.30
PVT	Lights	6/14/01	Clifton et al.	1	49.95	0.94	1.48	53.13	65.23	1.30
PVT	Lights	6/14/01	Clifton et al.	2	33.50	1.32	1.21	25.45	73.00	2.20
PVT	Lights	6/14/01	Clifton et al.	3	20.10	1.73	2.94	11.61	57.30	2.85
PVT	Lights	7/10/03	Clifton et al.	1	46.40	1.02	1.45	45.43	59.60	1.28
PVT	Lights	7/10/03	Clifton et al.	2	40.00	0.98	1.64	41.03	70.20	1.76
PVT	Lights	7/10/03	Clifton et al.	3	22.40	1.29	2.95	17.33	49.90	2.23

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Bankfull Depth	Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
PVT	Lights	6/24/99	Brian & Ryan	1	40.5	2.2		18.70	49.8	1.23
PVT	Lights	6/24/99	Brian & Ryan	2	64.3	1.7		37.48	69.8	1.09
PVT	Lights	6/24/99	Brian & Ryan	3	46.5	1.9		25.02	57.1	1.23
PVT	Lights	6/24/99	Brian & Ryan	4	40.9	1.7		23.96	46.0	1.12
PVT	Lights	6/24/99	Brian & Ryan	5	42.8	1.3		31.73	60.5	1.42
PVT	Lights	6/14/01	Clifton et al.	1	36.75	1.11		33.1	45.75	1.24
PVT	Lights	6/14/01	Clifton et al.	2	22.6	1.76		12.84	51	2.25
PVT	Lights	6/14/01	Clifton et al.	3	22.55	1.28		17.61	80	3.54
PVT	Lights	6/14/01	Clifton et al.	4	33.6	2.06		16.31	51	1.51
PVT	Lights	6/14/01	Clifton et al.	5	43.1	1.75		24.62	49	1.13
PVT	Lights	7/10/03	Clifton et al.	1	13.9	1.42	3.02	9.78	72.7	5.23
PVT	Lights	7/10/03	Clifton et al.	2	27.8	1.38	2.43	20.16	60	2.16
PVT	Lights	7/10/03	Clifton et al.	3	33	1.26	2.55	26.14	58.3	1.77
PVT	Lights	7/10/03	Clifton et al.	4	45.9	1.52	2.17	30.11	58	1.26
PVT	Lights	7/10/03	Clifton et al.	5	37.9	1.63	2.52	23.27	54.5	1.44

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces Large Wood	Pebble Count D50
				Habitat Lengths		Habitat Length		Residual	% Fines		
				Fast	Slow	Fast	Slow	Pool Depth*	in Pooftails		
PVT	Lights	6/24/99	Brian & Ryan	448	974	32%	68%	3.5	62.7		
PVT	Lights	6/14/01	Clifton et al	189	1358	12.2	87.8	2.5	14.6	n/a	18
PVT	Lights	7/10/03	Clifton et al	228	1064	17.6	82.4	3.99	37.89		16

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating				Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90	
NS	Lights	6/23/99	Clifton et al	4		10	80	1.6	85	2.2	4	80
PVT	Lights	6/18/01	Clifton et al	n/a	n/a	n/a	n/a	n/a	78	1.4	0	79
PVT	Lights	7/11/03	Clifton et al	n/a	n/a	n/a	n/a	n/a	70	0.756	0	70

Biota Observations: none

Definitions:

Width:Depth - field-id'ed bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (I.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of poottail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per poottail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

* '99 to '03 changes in residual pool depth could be due to observer error.

SCI Summary for Wolf Cr (near park at downstream end of town)

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean	Max	Bankfull Width:Depth	Floodprone width	Entrenchment Ratio
						Bankfull Depth	Bankfull Depth			
PVT	Wolf	6/22/99	Clifton et al.	1	19.60	1.57	3.05	12.48	61.78	3.15
PVT	Wolf	6/22/99	Clifton et al.	2	27.30	1.52	2.00	17.94	33.09	1.21
PVT	Wolf	6/22/99	Clifton et al.	3	23.50	1.45	1.95	16.18	41.35	1.76
PVT	Wolf	7/3/01	Clifton et al.	1	21.00	2.44	3.50	9.41	195.20	9.29
PVT	Wolf	7/3/01	Clifton et al.	2	28.80	1.74	3.30	16.50	79.50	2.76
PVT	Wolf	7/3/01	Clifton et al.	3	20.05	1.58	2.47	12.68	60.80	3.03
PVT	Wolf	6/26/03	Clifton et al.	1	17.55	1.47	2.94	11.93	58.20	3.32
PVT	Wolf	6/26/03	Clifton et al.	2	25.80	1.99	3.93	12.97	63.50	2.46
PVT	Wolf	6/26/03	Clifton et al.	3	24.80	1.25	1.97	19.89	45.90	1.85

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Bankfull Depth	Bankfull Width:Depth	Floodprone width	Entrenchment Ratio	
PVT	Wolf	6/22/99	Lindsey & Brian	1	26.5	1.3	20.78	63.0	2.38	
PVT	Wolf	6/22/99	Lindsey & Brian	2	22.3	2.0	11.24	73.5	3.30	
PVT	Wolf	6/22/99	Lindsey & Brian	3	26.7	1.7	16.12	37.6	1.41	
PVT	Wolf	6/22/99	Lindsey & Brian	4	28.0	1.7	16.44	36.8	1.31	
PVT	Wolf	6/22/99	Lindsey & Brian	5	31.5	1.2	26.31	37.7	1.20	
PVT	Wolf	7/3/01	Clifton et al.	1	33.9	1.2	28.13	65.9	1.94	
PVT	Wolf	7/3/01	Clifton et al.	2	44.6	1.26	35.28	51.6	1.15	
PVT	Wolf	7/3/01	Clifton et al.	3	31.6	1.53	20.65	38.6	1.22	
PVT	Wolf	7/3/01	Clifton et al.	4	41	1.44	28.47	45	1.09	
PVT	Wolf	7/3/01	Clifton et al.	5	32.9	1.32	24.92	41.1	1.25	
PVT	Wolf	6/25/03	Clifton et al.	1	33	1.09	1.69	30.18	45.9	1.39
PVT	Wolf	6/25/03	Clifton et al.	2	14.8	1.24	2.2	11.97	55.3	3.74
PVT	Wolf	6/25/03	Clifton et al.	3	19.9	1.44	2.73	13.81	55.6	2.79
PVT	Wolf	6/26/03	Clifton et al.	4	28.7	1.30	1.81	22.06	34.6	1.21
PVT	Wolf	6/26/03	Clifton et al.	5	28	1.25	2.14	22.40	40.5	1.45

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces Large Wood	Pebble Count D50
				Habitat Lengths		Habitat Length		Residual	% Fines		
				Fast	Slow	Fast	Slow	Pool Depth* in Pooftails			
PVT	Wolf	6/22/99	Clifton et al	604	668	47%	53%	2.5	64.5		
PVT	Wolf	7/4/01	Clifton et al	445	781	36.3	63.7	1.9	21.7	n/a	15.5
PVT	Wolf	6/26/03	Clifton et al	369	629	37.0	63.0	2.6	26.4		18.5

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating				Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90	
PVT	Wolf	6/21/99	NS	0	16	84	46.78	92	0.86	3	92	
PVT	Wolf	7/3/01	Clifton et al	n/a	n/a	n/a	n/a	93	0.85	0	94	
PVT	Wolf	6/27/03	Clifton et al					81	0.78	0	79	

FLOW MEASUREMENT (feet & se

Owner	Stream	Date	Crew	width	area	velocity	discharge
PVT	Wolf	7/3/01	Clifton et al	13	5.54	0.58	3.2
PVT	Wolf	6/25/03	Clifton et al	16.6	8.67	1.33	11.5

Biota Observations: none

Definitions:

Width:Depth - field-ided bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (i.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooltail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooltail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

* '99 to '03 residual pool depth changes could be due to observer error.

SCI Summary for Indian above Spanish (at Dawn Institute)

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean	Max	Width:Depth	Floodprone width	Entrenchment Ratio
						Bankfull Depth	Bankfull Depth			
PVT	Indian above Spanish	7/15/99	Clifton	1	76.70	2.82	5.30	27.21	129.16	1.68
PVT	Indian above Spanish	7/15/99	Clifton	2	182.00	1.93	3.46	94.37	264.05	1.45
PVT	Indian above Spanish	7/15/99	Clifton	3	86.00	2.66	3.74	32.38	109.14	1.27
PVT	Indian above Spanish	6/19/01	Clifton et al.	1	74.90	2.58	4.99	29.03	80.40	1.07
PVT	Indian above Spanish	6/19/01	Clifton et al.	2	193.95	2.30	4.16	84.30	284.55	1.47
PVT	Indian above Spanish	6/19/01	Clifton et al.	3	83.10	2.52	3.75	32.97	104.30	1.25
PVT	Indian above Spanish	7/2/03	Clifton et al.	1	74.00	2.32	4.51	31.90	103.40	1.40
PVT	Indian above Spanish	7/2/03	Clifton et al.	2	178.70	2.00	3.76	89.49	270.20	1.51
PVT	Indian above Spanish	7/2/03	Clifton et al.	3	86.00	2.15	3.75	39.96	108.00	1.26

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Bankfull Depth	Bankfull Depth	Width:Depth	Floodprone width	Entrenchment Ratio
PVT	Indian above Spanish	7/15/99	Hodge/Martir	2	159.5	1.7		91.67		
PVT	Indian above Spanish	7/15/99	Hodge/Martir	3	122.0	2.5		48.22		
PVT	Indian above Spanish	7/15/99	Hodge/Martir	4	86.8	2.0		42.76	104.5	1.20
PVT	Indian above Spanish	7/15/99	Hodge/Martir	5	84.6	1.8		48.07	108.0	1.28
PVT	Indian above Spanish	6/20/01	Clifton et al.	1	85.2	2.7		30.46	147.45	1.73
PVT	Indian above Spanish	6/20/01	Clifton et al.	2	73.65	2.35		31.34	126.8	1.72
PVT	Indian above Spanish	6/20/01	Clifton et al.	3	160.7	2.56		62.77	277	1.72
PVT	Indian above Spanish	6/20/01	Clifton et al.	4	125	2.23		56.05	198.7	1.58
PVT	Indian above Spanish	6/20/01	Clifton et al.	5	77.3	1.93		40.05	121	1.58
PVT	Indian above Spanish	7/2/03	Clifton et al.	1	155.6	1.99	3.63	78.02	269	1.73
PVT	Indian above Spanish	7/2/03	Clifton et al.	2	156.5	2.72	5.88	57.45	290.5	1.86
PVT	Indian above Spanish	7/2/03	Clifton et al.	3	86.9	2.36	3.55	36.87	117	1.35
PVT	Indian above Spanish	7/2/03	Clifton et al.	4	90.8	2.20	3.32	41.35	112	1.23
PVT	Indian above Spanish	7/2/03	Clifton et al.	5	91.3	2.06	3.16	44.32	122.4	1.34

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces	Pebble Count
				Habitat Lengths		Habitat Length		Residual	% Fines		
				Fast	Slow	Fast	Slow	Pool Depth*	in Pooftails		
PVT	Indian above Spanish	7/14/99	Clifton	360	751	32%	68%	4.0	13.3		
PVT	Indian above Spanish	6/20/01	Clifton et al.	585	638	47.8	52.2	3.9	7	n/a	102
PVT	Indian above Spanish	7/2/03	Clifton et al.	390	681	36.41	63.59	4.12	21.11	0	104

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
PVT	Indian above Spanish	7/14/99	NS	55	45	0	9.28	n/a	n/a	n/a	n/a

FLOW MEASUREMENT (feet & seconds)

Owner	Stream	Date	Crew	width	area	velocity	discharge
PVT	Indian above Spanish	6/20/01	Clifton et al	48	68	0.41	27.7
PVT	Indian above Spanish	7/1/03	Clifton et al	51	57.4	1.31	75.18

Biota Observations: none

Definitions:

Width:Depth - field-id'ed bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (I.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooltail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooltail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

* '99 to '03 changes in residual pool depth could be due to observer error.

SCI Summary for Greenhorn Cr above confluence with Spanish Cr

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean	Max	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
						Bankfull Depth	Bankfull Depth			
PVT	Greenhorn	6/14/99	Lindsey Kelly	1	43.90	1.44	3.51	30.39	57.72	1.31
PVT	Greenhorn	6/15/99	Lindsey Kelly	2	40.00	2.05	3.74	19.49	60.79	1.52
PVT	Greenhorn	6/15/99	Lindsey Kelly	3	46.80	0.99	1.71	47.10	55.85	1.19
PVT	Greenhorn	6/11/01	Clifton et al.	1	40.30	1.00	1.66	40.50	48.80	1.21
PVT	Greenhorn	6/11/01	Clifton et al.	2	35.40	1.30	1.38	27.20	46.20	1.30
PVT	Greenhorn	6/11/01	Clifton et al.	3	44.10	1.15	1.99	38.30	65.00	1.47
PVT	Greenhorn	6/16/03	Clifton et al.	1	39.10	0.75	1.82	52.13	50.70	1.30
PVT	Greenhorn	6/16/03	Clifton et al.	2	38.90	2.10	3.26	18.52	55.80	1.43
PVT	Greenhorn	6/16/03	Clifton et al.	3	45.90	1.41	2.37	32.55	60.70	1.32

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Bankfull Depth	Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
PVT	Greenhorn	6/15/99	Lindsey Kelly	1	21.0	1.6		12.79	55.0	2.62
PVT	Greenhorn	6/15/99	Lindsey Kelly	2	37.3	2.2		17.23	45.1	1.21
PVT	Greenhorn	6/15/99	Lindsey Kelly	3	37.5	1.3		28.28	52.4	1.40
PVT	Greenhorn	6/15/99	Lindsey Kelly	4	32.2	1.4		23.57	44.2	1.37
PVT	Greenhorn	6/15/99	Lindsey Kelly	5	36.5	2.2		16.68	49.8	1.36
PVT	Greenhorn	6/11/01	Clifton et al.	1	49.9	1.7		29.4	64.9	1.3
PVT	Greenhorn	6/11/01	Clifton et al.	2	38.4	1.4		27.4	55.1	1.4
PVT	Greenhorn	6/11/01	Clifton et al.	3	32.8	0.9		36.4	45.1	1.4
PVT	Greenhorn	6/11/01	Clifton et al.	4	36.8	1.5		24.5	55.2	1.5
PVT	Greenhorn	6/11/01	Clifton et al.	5	29.2	2.1		13.9	53.95	1.8
PVT	Greenhorn	6/16/03	Clifton et al.	1	34.2	1.17	1.55	29.23	44.05	1.29
PVT	Greenhorn	6/16/03	Clifton et al.	2	30	1.25	2.1	24.00	44.1	1.47
PVT	Greenhorn	6/16/03	Clifton et al.	3	31.3	1.21	1.82	25.87	53	1.69
PVT	Greenhorn	6/16/03	Clifton et al.	4	43.5	1.63	2.46	26.69	57.6	1.32
PVT	Greenhorn	6/16/03	Clifton et al.	5	51	1.6	2.53	31.88	69.5	1.36

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces	Pebble
				Habitat Lengths		Habitat Length		Residual	% Fines		
				Fast	Slow	Fast	Slow	Pool Depth*	in Pooftails	Large Wood	Count D50
PVT	Greenhorn	6/14/99	Lindsey Buis-	312	420	43%	57%	1.04	30.7		
PVT	Greenhorn	6/12/01	Clifton et. Al	240	558	30	70	2.20	33		22
PVT	Greenhorn	6/17/03	Clifton et al.	192	594	24	76	3.23	6		18

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating				Average		ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90		
				PVT	Greenhorn	6/15/99	Lindsey Buis-	46	31	23	16.31	66	
PVT	Greenhorn	6/12/01	Clifton et. Al	n/a	n/a	n/a	n/a	85		14	86		
PVT	Greenhorn	6/17/03	Clifton et. Al	n/a	n/a	n/a	n/a	70	0.78	0	70		

FLOW MEASUREMENT (feet & seconds)

Owner	Stream	Date	Crew	width	area	velocity	discharge
PVT	Greenhorn	6/11/01	Clifton et al	12.8	6.79	1.61	11
PVT	Greenhorn	6/16/03	Clifton et al	27.6	21.63	1.35	29.2

Biota Observations: none

Definitions:

Width:Depth - field-measured bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (i.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooltail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooltail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

* '99 to '03 changes in residual pool depth could be due to observer error.

SCI Summary for Spanish Cr above Greenhorn Cr (above confluence with)

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean	Max	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
						Bankfull Depth	Bankfull Depth			
PVT	Spanish Above Greenhorn	6/29/99	Clifton et al.	1	80.60	1.47	1.93	54.78	92.22	1.14
PVT	Spanish Above Greenhorn	6/28/99	Clifton et al.	2	57.30	1.85	2.71	31.06	69.87	1.22
PVT	Spanish Above Greenhorn	6/28/99	Clifton et al.	3	59.30	1.66	2.78	35.63	87.14	1.47
PVT	Spanish Above Greenhorn	6/28/01	Clifton et al.	1	83.00	2.02	3.38	41.08	104.30	1.25
PVT	Spanish Above Greenhorn	6/28/01	Clifton et al.	2	55.30	1.99	3.68	27.78	83.70	1.51
PVT	Spanish Above Greenhorn	6/28/01	Clifton et al.	3	100.40	2.75	4.66	36.50	114.40	1.14
PVT	Spanish Above Greenhorn	6/18/03	Clifton et al.	1	81.10	2.28	4.13	35.57	119.20	1.47
PVT	Spanish Above Greenhorn	6/18/03	Clifton et al.	2	62.30	2.34	3.65	26.62	96.30	1.55
PVT	Spanish Above Greenhorn	6/18/03	Clifton et al.	3	75.00	2.40	5.15	31.25	94.20	1.26

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Bankfull Depth	Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
PVT	Spanish Above Greenhorn	6/28/99	Martin & Hodge	2	49.8	1.5	33.36	76.5	1.54	
PVT	Spanish Above Greenhorn	6/28/99	Martin & Hodge	3	41.5	1.9	21.80	92.2	2.22	
PVT	Spanish Above Greenhorn	6/28/99	Martin & Hodge	4	44.4	2.1	21.33	90.8	2.05	
PVT	Spanish Above Greenhorn	6/28/99	Martin & Hodge	5	70.7	1.7	40.71	108.8	1.54	
PVT	Spanish Above Greenhorn	6/28/01	Clifton et al.	1	52.9	3.06	17.28	119.9	2.26	
PVT	Spanish Above Greenhorn	6/28/01	Clifton et al.	2	81.5	2.13	38.26	97.5	1.19	
PVT	Spanish Above Greenhorn	6/28/01	Clifton et al.	3	62.9	1.97	31.9	84.4	1.34	
PVT	Spanish Above Greenhorn	6/28/01	Clifton et al.	4	65.2	2.22	29.36	113.6	1.74	
PVT	Spanish Above Greenhorn	6/28/01	Clifton et al.	5	65.25	1.92	33.98	107	1.64	
PVT	Spanish Above Greenhorn	6/18/03	Clifton et al.	1	86	2.18	31.9	101.1	1.18	
PVT	Spanish Above Greenhorn	6/18/03	Clifton et al.	2	79.6	2.23	4.15	35.70	120.3	1.51
PVT	Spanish Above Greenhorn	6/18/03	Clifton et al.	3	82.4	2.49	4.37	33.09	99.1	1.20
PVT	Spanish Above Greenhorn	6/18/03	Clifton et al.	4	58	2.56	4.14	22.66	98.6	1.70
PVT	Spanish Above Greenhorn	6/18/03	Clifton et al.	5	82	2.12	3.51	38.68	112	1.37

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces Large Wood	Pebble Count D50
				Habitat Lengths		Habitat Length		Residual	% Fines		
				Fast	Slow	Fast	Slow	Pool Depth*	in Pooftails		
PVT	Spanish Above Greenhorn	6/28/99	Clifton et al	483	935	34%	66%	5.1	19.7		
PVT	Spanish Above Greenhorn	6/28/01	Clifton et al	323	1165	21.7	78.3	4.01	16.8	n/a	11
PVT	Spanish Above Greenhorn	6/19/03	Clifton et al	356	1146	23.7	76.3	5.9	14.53		17

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
PVT	Spanish Above Greenhorn	6/28/99	Clifton et al	5	6	89	5.9	95	1.3	1	93
PVT	Spanish Above Greenhorn	7/2/01	Clifton et al	n/a	n/a	n/a	n/a	74	1.8	0	75
PVT	Spanish Above Greenhorn	6/19/03	Clifton et al					79	2.16	0	78

FLOW MEASUREMENT (feet & seconds)

Owner	Stream	Date	Crew	width	area	velocity	discharge
PVT	Spanish Above Greenhorn	7/2/01	Clifton et al	21.4	8.22	2.38	19.6
PVT	Spanish Above Greenhorn	6/18/03	Clifton et al	40	52.8	1.61	85.2

Biota Observations: none

Definitions:

Width:Depth - field-id'ed bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (i.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooltail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooltail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

* '99 to '03 changes in residual pool depth could be due to observer error.

SCI Summary for Spanish_campwallace

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean Bankfull Depth	Max Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
PNF	Spanish-CampWallace	7/13/99	Clifton et al.	1	76.40	2.03	3.28	37.65	110.10	1.44
PNF	Spanish-CampWallace	7/13/99	Clifton et al.	2	105.70	2.58	4.68	40.95	136.48	1.29
PNF	Spanish-CampWallace	7/13/99	Clifton et al.	3	91.00	2.13	3.75	42.66	141.00	1.55
PNF	Spanish Above Indian	6/18/01	Clifton et al.	1	101.80	2.90	4.66	35.10	151.80	1.49
PNF	Spanish Above Indian	6/18/01	Clifton et al.	2	109.00	3.05	5.15	35.70	135.60	1.24
PNF	Spanish Above Indian	6/18/01	Clifton et al.	3	83.00	2.80	5.60	29.28	137.50	1.67
PNF	Spanish Above Indian	6/30/03	Clifton et al.	1	97.30	2.49	4.23	39.05	147.30	1.51
PNF	Spanish Above Indian	6/30/03	Clifton et al.	2	111.00	2.93	4.19	37.86	136.50	1.23
PNF	Spanish Above Indian	6/30/03	Clifton et al.	3	80.90	3.08	5.22	26.29	131.50	1.63

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Mean Bankfull Depth	Max Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
PNF	Spanish-CampWallace	7/13/99	Clifton et al.	1	80.5	2.2	36.48	36.48	97.0	1.20
PNF	Spanish-CampWallace	7/13/99	Clifton et al.	2	71.9	2.1	34.30	34.30		
PNF	Spanish-CampWallace	7/13/99	Clifton et al.	3	76.5	2.0	37.86	37.86	129.0	1.69
PNF	Spanish-CampWallace	7/13/99	Clifton et al.	4	50.5	2.1	24.21	24.21	80.0	1.58
PNF	Spanish-CampWallace	7/13/99	Clifton et al.	5	51.2	2.1	24.67	24.67		
PNF	Spanish above Indian	6/18/01	Clifton et al.	1	95.8	2.37	40.42	40.42	124.8	1.3
PNF	Spanish above Indian	6/18/01	Clifton et al.	2	85.8	2.5	34.32	34.32	125.6	1.46
PNF	Spanish above Indian	6/18/01	Clifton et al.	3	111.5	1.72	64.8	64.8	145.65	1.3
PNF	Spanish above Indian	6/18/01	Clifton et al.	4	69.3	2.8	24.75	24.75	128.8	1.85
PNF	Spanish above Indian	6/18/01	Clifton et al.	5	97.1	2.4	40.45	40.45	150.5	1.54
PNF	Spanish above Indian	6/30/03	Clifton et al.	1	89.5	3.00824	4.42	29.75	149.5	1.67
PNF	Spanish above Indian	6/30/03	Clifton et al.	2	90.6	3.45667	5.01	26.21	137	1.51
PNF	Spanish above Indian	6/30/03	Clifton et al.	3	84	2.94333	4.67	28.54	127.3	1.52
PNF	Spanish above Indian	6/30/03	Clifton et al.	4	77.5	2.668	5.18	29.05	123	1.59
PNF	Spanish above Indian	6/30/03	Clifton et al.	5	78.5	2.81063	4.19	27.93	123	1.57

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces Large Wood	Pebble Count D50
				Habitat Lengths		Habitat Length		Residual	% Fines		
				Fast	Slow	Fast	Slow	Pool Depth*	in Pooftails		
PNF	Spanish above Indian		Clifton et. al	423	1127	27%	73%	5.1	36.8	n/a	
PNF	Spanish above Indian		Clifton et. al	452	1232	26.8	73.2	3.2	10.3	n/a	29.5
PNF	Spanish above Indian	7/1/03	Clifton et. al	398	1018	28.1	71.9	3.9	12.4	n/a	28.5

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
PNF	Spanish above Indian	7/14/99	Clifton et. al	49	42	9	28.75	n/a	n/a	n/a	n/a
n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a

FLOW MEASUREMENT (feet & seconds)

Owner	Stream	Date	Crew	width	area	velocity	discharge
PNF	Spanish above Indian	6/19/01	Clifton et al	32.1	32.18	0.8	25.6
PNF	Spanish above Indian	7/1/03	Clifton et al	105	123.35	0.7	86.1

Biota Observations: none

Definitions:

Width:Depth - field-id'ed bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (I.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooftail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooftail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

* '99 to '03 changes in residual pool depth could be due to observer error.

SCI Summary for Rock Cr (near mouth, above confluence with Spanish Cr)

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean	Max	Bankfull Width:Depth Ratio	Floodprone width	Entrenchment Ratio
						Bankfull Depth	Bankfull Depth			
PNF	Rock	6/17/99	Clifton et al.	1	52.80	1.40	1.80	37.74	62.31	1.18
PNF	Rock	6/17/99	Clifton et al.	2	45.00	1.29	2.21	34.82	56.97	1.27
PNF	Rock	6/17/99	Clifton et al.	3	49.35	1.66	2.62	29.70	60.51	1.23
PNF	Rock	6/12/01	Clifton et al.	1	52.10	1.71	2.36	30.46	67.80	1.30
PNF	Rock	6/12/01	Clifton et al.	2	49.55	2.43	4.04	20.39	75.40	1.52
PNF	Rock	6/12/01	Clifton et al.	3	50.60	1.90	3.16	26.60	65.80	1.30
PNF	Rock	6/23/03	Clifton et al.	1	54.00	1.79	2.40	30.21	66.60	1.23
PNF	Rock	6/23/03	Clifton et al.	2	51.10	2.10	3.17	24.38	74.00	1.45
PNF	Rock	6/23/03	Clifton et al.	3	52.50	2.08	3.33	25.28	66.80	1.27

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Bankfull Depth	Bankfull Depth	Bankfull Width:Depth Ratio	Floodprone width	Entrenchment Ratio
PNF	Rock	6/17/99	Brian Hodge	1	49.5	1.7		28.95	67.9	1.37
PNF	Rock	6/17/99	Brian Hodge	2	39.0	1.4		27.51	46.5	1.19
PNF	Rock	6/17/99	Brian Hodge	3	49.5	1.7		29.88	60.3	1.22
PNF	Rock	6/17/99	Brian Hodge	4	43.9	1.4		31.84	54.0	1.23
PNF	Rock	6/17/99	Brian Hodge	5	37.5	1.5		25.00	54.6	1.46
PNF	Rock	6/12/01	Clifton et al.	1	48.25	1.7		28.4	89.25	1.8
PNF	Rock	6/12/01	Clifton et al.	2	39.4	2.5		15.76	66.6	1.7
PNF	Rock	6/12/01	Clifton et al.	3	57.65	1.66		34.7	96.05	1.66
PNF	Rock	6/12/01	Clifton et al.	4	62.4	1.68		37.1	115.4	1.84
PNF	Rock	6/12/01	Clifton et al.	5	44.2	2.33		18.9	67.2	1.52
PNF	Rock	6/23/03	Clifton et al.	1	47	1.97	2.57	23.90	76.5	1.63
PNF	Rock	6/23/03	Clifton et al.	2	63	2.50	3.52	25.23	118.7	1.88
PNF	Rock	6/23/03	Clifton et al.	3	51	2.63	4.01	19.37	116.5	2.28
PNF	Rock	6/23/03	Clifton et al.	4	44	2.22	3.24	19.84	87.5	1.99
PNF	Rock	6/23/03	Clifton et al.	5	46.3	2.1	3.1	21.67	92.20	1.99

PASS#3 Pool Data

	Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces
					Habitat Lengths		Habitat Length		Residual	% Fines	
					Fast	Slow	Fast	Slow	Pool Depth	in Pooftails	
PNF	Rock	6/17/99	Brian Hodge	1233	680	64%	36%	0.8	23.8	n/a	
PNF	Rock	6/13/01	Clifton et al	1118	724	60.7	39.3	1.3	4.7	n/a	
PNF	Rock	6/25/03	Clifton et al	1085	689	61.2	38.8	2.1	9.5	n/a	

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating				Average		ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90		
PNF	Rock	6/17/99	Brian Hodge	27	31	42	41.58	n/a	n/a	n/a	n/a		
n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a	n/a		
PNF	Rock		Clifton et al										

FLOW MEASUREMENT (feet & width area velocity discharge)

Owner	Stream	Date	Crew	width	area	velocity	discharge
PNF	Rock	6/13/01	Clifton et al	13	10.38	0.71	7.4
PNF	Rock	6/23/03	Clifton et al	35	28.48	1.24	35.2

Biota Observations: none

Definitions:

Width:Depth - field-measured bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (i.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of poottail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per poottail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

SCI Summary for East Branch North Fork Feather River above NFFR

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean	Max	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
						Bankfull Depth	Bankfull Depth			
PNF	EBNFFR above NFFR	8/9/99	Clifton et. al	1	98.60	2.26	3.53	43.63	141.95	1.44
PNF	EBNFFR above NFFR	8/9/99	Clifton et. al	2	115.30	2.47	4.39	46.73	294.80	2.56
PNF	EBNFFR above NFFR	8/9/99	Clifton et. al	3	150.60	3.17	4.78	47.45	214.30	1.42
PVT	EBNFFR above NFFR	7/16/01	Clifton et al.	1	124.20	2.49	3.86	49.87	169.00	1.36
PVT	EBNFFR above NFFR	7/16/01	Clifton et al.	2	129.30	2.41	4.49	53.65	342.00	2.64
PVT	EBNFFR above NFFR	7/16/01	Clifton et al.	3	167.60	2.20	3.98	76.18	211.40	1.26
	EBNFFR above NFFR	7/14/03	Clifton et al.	1	122.40	3.81	5.03	32.11	160.30	1.31
	EBNFFR above NFFR	7/14/03	Clifton et al.	2	130.50	3.48	4.69	37.54	327.40	2.51
	EBNFFR above NFFR	7/15/03	Clifton et al.	3	152.10	2.58	4.06	59.00	207.20	1.36

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Bankfull Depth	Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
PNF	EBNFFR above NFFR	8/9/99	Clifton	2	101	2.7	37.03	159.6	1.58	
PNF	EBNFFR above NFFR	8/9/99	Clifton	3	146	4.3	34.35	240.0	1.64	
PNF	EBNFFR above NFFR	8/9/99	Clifton	4	84.9	2.8	30.82	153.0	1.80	
PNF	EBNFFR above NFFR	8/9/99	Clifton	5	147.8	2.0	75.44	200.0	1.35	
PNF	EBNFFR above NFFR	7/16/01	Clifton et al.	1	145.8	2.81	51.88	229.8	1.57	
PNF	EBNFFR above NFFR	7/16/01	Clifton et al.	2	131	2.94	44.55	181.9	1.38	
PNF	EBNFFR above NFFR	7/16/01	Clifton et al.	3	72.3	3.06	23.62	126.3	1.74	
PNF	EBNFFR above NFFR	7/16/01	Clifton et al.	4	110.2	2.42	45.5	162.6	1.47	
PNF	EBNFFR above NFFR	7/16/01	Clifton et al.	5	98.3	2.66	36.95	185	1.88	
PNF	EBNFFR above NFFR	7/14/03	Clifton et al.	1	119.4	2.98	4.85	40.06	153.40	1.28
PNF	EBNFFR above NFFR	7/14/03	Clifton et al.	2	151	3.05	4.27	49.53	185.80	1.23
PNF	EBNFFR above NFFR	7/14/03	Clifton et al.	3	143	4.22	6.12	33.88	341.00	2.38
PNF	EBNFFR above NFFR	7/15/03	Clifton et al.	4	117.3	3.35	5.01	35.07	158.90	1.35
PNF	EBNFFR above NFFR	7/15/03	Clifton et al.	5	128.5	3.29	5.21	39.09	183.60	1.43

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces Large Wood	Pebble Count D50
				Habitat Lengths		Habitat Length		Residual	% Fines		
				Fast	Slow	Fast	Slow	Pool Depth*	in Pooftails		
PNF	EBNFFR above NFFR	8/4/99	Clifton	725	1804	29%	71%	7.0	10.3	0	
PNF	EBNFFR above NFFR	7/17/01	Clifton et al	705	1332	34.6	65.4	6.5	11.75	n/a	102
PNF	EBNFFR above NFFR	7/15/03	Clifton et al	818.0	1759	31.74	68.26	6.84	12.17		95

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
PNF	EBNFFR above NFFR	8/4/99	Clifton	37	10	53	18.4	n/a	n/a	n/a	n/a

FLOW MEASUREMENT (feet & seconds width area velocity discharge)

PNF	EBNFFR above NFFR	7/17/01	Clifton et al	81.7	122.9	0.46	56.6
PNF	EBNFFR above NFFR	7/15/03	Clifton et al	104	130.6	1.14	149.5

Biota Observations: none

Definitions:

Width:Depth - field-id'ed bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (I.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooftail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooftail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

* '99 to '03 changes in residual pool depth could be due to observer error.

SCI Summary for MFFR-Beckworth

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean	Max	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
						Bankfull Depth	Bankfull Depth			
PNF	MFFR-Beckworth	8/18/99	Clifton et al	1	32.70	0.92	1.20	35.72	46.55	1.42
PNF	MFFR-Beckworth	8/18/99	Clifton et al	2	31.50	1.58	2.58	19.99	108.24	3.44
PNF	MFFR-Beckworth	8/18/99	Clifton et al	3	38.20	1.24	1.64	30.85	102.59	2.69
PNF	MFFR-Beckworth	7/11/01	Clifton et al.	1	85.90	1.50	2.27	57.26	124.60	1.45
PNF	MFFR-Beckworth	7/11/01	Clifton et al.	2	31.70	1.30	2.39	24.38	66.90	2.11
PNF	MFFR-Beckworth	7/11/01	Clifton et al.	3	39.80	1.14	1.90	34.91	139.50	3.57
PNF	MFFR-Beckworth	7/31/03	Clifton et al.	1	47.70	1.64	2.53	29.04	138.70	2.91
PNF	MFFR-Beckworth	7/31/03	Clifton et al.	2	32.30	1.37	2.05	23.64	54.10	1.67
PNF	MFFR-Beckworth	7/31/03	Clifton et al.	3	85.40	1.71	2.76	50.01	189.50	2.22

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Bankfull Depth	Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
PNF	MFFR-Beckworth	8/18/99	Clifton	2	20.7	1.8	11.69	102.5	4.95	
PNF	MFFR-Beckworth	8/18/99	Clifton	3	35.7	1.3	27.05	84.0	2.35	
PNF	MFFR-Beckworth	8/18/99	Clifton	4	27.7	1.3	21.90	64.3	2.32	
PNF	MFFR-Beckworth	8/18/99	Clifton	5	29.7	1.2	25.17	49.3	1.66	
PNF	MFFR-Beckworth	7/10/01	Clifton et al.	1	30.2	1.49	20.26	108.2	3.58	
PNF	MFFR-Beckworth	7/10/01	Clifton et al.	2	69.7	1.53	45.5	104	1.49	
PNF	MFFR-Beckworth	7/10/01	Clifton et al.	3	23.8	1.75	13.6	98.3	4.13	
PNF	MFFR-Beckworth	7/10/01	Clifton et al.	4	31.5	1.32	23.86	59	1.87	
PNF	MFFR-Beckworth	7/10/01	Clifton et al.	5	35.6	1.24	28.7	55.6	1.56	
PNF	MFFR-Beckworth	7/31/03	Clifton et al.	1	42.4	1.51	2.55	28.14	135.9	3.21
PNF	MFFR-Beckworth	7/31/03	Clifton et al.	2	73.7	1.75	2.94	42.22	111.4	1.51
PNF	MFFR-Beckworth	7/31/03	Clifton et al.	3	37.6	1.43	2.7	26.21	110	2.93
PNF	MFFR-Beckworth	7/31/03	Clifton et al.	4	37.7	1.95	2.86	19.33	78.7	2.09
PNF	MFFR-Beckworth	7/31/03	Clifton et al.	5	35.9	1.81	2.8	19.89	72.7	2.03

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces Large Wood	Pebble Count D50
				Habitat Lengths		Habitat Length		Residual	% Fines		
				Fast	Slow	Fast	Slow	Pool Depth*	in Pootails		
PNF	MFFR-Beckworth	8/19/99	Clifton	127	1514	8%	92%	4.3	81.6	n/a	4.9
PNF	MFFR-Beckworth	7/12/01	Clifton et al	112	1539	6.8	93.2	3.5	35	n/a	4.9
PNF	MFFR-Beckworth	9/3/03	Clifton et al	178	1575	10.2	89.8	4.12	58.33	0	15

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
PNF	MFFR-Beckworth	8/19/99	Clifton et al	34	22	44	1.71	95	0.95	0	96
PNF	MFFR-Beckworth	7/12/01	Clifton et al	n/a	n/a	n/a	n/a	91	0.71	0	91
PNF	MFFR-Beckworth	8/4/03	Clifton et al	n/a	n/a	n/a	n/a	39.22	0.54	0	60

FLOW MEASUREMENT (feet & seconds)

Owner	Stream	Date	Crew	width	area	velocity	discharge
PNF	MFFR-Beckworth	7/12/01	Clifton et al	0	0	0	0 dry
PNF	MFFR-Beckworth	8/4/03	Clifton et al	0	0	0	0 discontinuous pools

Biota Observations: none

Definitions:

Width:Depth - field-id'ed bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (i.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooltail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooltail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

* '99 to '03 changes in residual pool depth could be due to observer error.

SCI Summary for Sulphur Creek

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean	Max	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
						Bankfull Depth	Bankfull Depth			
PVT	Sulphur	8/16/99	Clifton et al	1	49.3	1.2	1.88	41.23	82.92	1.68
PVT	Sulphur	8/16/99	Clifton et al	2	33.4	1.04	1.6	32.11	92.22	1.14
PVT	Sulphur	8/16/99	Clifton et al	3	53.8	1.31	1.89	41.07	202.76	3.77
PVT	Sulphur	7/9/01	Clifton et al	1	45.40	0.88	1.67	51.60	84.40	1.86
PVT	Sulphur	7/9/01	Clifton et al	2	35.10	1.00	1.67	35.10	59.90	1.70
PVT	Sulphur	7/10/01	Clifton et al	3	52.10	1.30	1.98	40.00	80.90	1.55
PVT	Sulphur	7/30/03	Clifton et al	1	46.10	1.01	1.83	45.52	88.10	1.91
PVT	Sulphur	7/30/03	Clifton et al	2	37.20	1.04	1.75	35.77	64.50	1.73
PVT	Sulphur	7/30/03	Clifton et al	3	55.20	1.37	2.13	40.44	218.60	3.96

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Bankfull Depth	Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
PVT	Sulphur	8/16/99	Clifton et al	2	41.0	1.3		32.69	86.5	2.11
PVT	Sulphur	8/16/99	Clifton et al	3	38.7	1.4		27.89	133.0	3.44
PVT	Sulphur	8/16/99	Clifton et al	4	37.5	1.3		28.69	72.0	1.92
PVT	Sulphur	8/16/99	Clifton et al	5	34.6	1.4		24.86	86.4	2.50
PVT	Sulphur	7/9/01	Clifton et al	1	40	1.26		31.75	81.4	2.04
PVT	Sulphur	7/9/01	Clifton et al	2	35	1.65		21.21	48.2	1.37
PVT	Sulphur	7/9/01	Clifton et al	3	37.5	1		37.5	93	2.48
PVT	Sulphur	7/9/01	Clifton et al	4	33.65	1.43		23.53	301.65	8.9
PVT	Sulphur	7/9/01	Clifton et al	5	35.1	1.05		33.42	98.6	2.8
PVT	Sulphur	7/30/03	Clifton et al	1	46.00	1.37	2.07	33.60	74.10	1.61
PVT	Sulphur	7/30/03	Clifton et al	2	39.80	1.33	1.67	30.04	89.40	2.25
PVT	Sulphur	7/30/03	Clifton et al	3	38.50	1.37	1.84	28.14	121.50	3.16
PVT	Sulphur	7/30/03	Clifton et al	4	37.6	1.70429	2.76	22.06	155.8	4.14
PVT	Sulphur	7/30/03	Clifton et al	5	43	1.44	2.13	29.86	248.6	5.78

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces Large Wood	Pebble Count D50
				Habitat Lengths		Habitat Length		Residual Pool Depth*	% Fines in Pooftails		
				Fast	Slow	Fast	Slow				
PVT	Sulphur	8/17/99	Clifton et. al	752	724	51%	49%	1.5	40.1	0.0	
PVT	Sulphur	7/10/01	Clifton et. al	760	708	51.8	48.2	1.3	10.0	n/a	31
PVT	Sulphur	9/3/03	Clifton et. al	705	802	46.8	53.2	1.84	18.83	1	39

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
PVT	Sulphur	8/17/99	Clifton et. al	3	6	91	18.86	87	0.8	8	87
PVT	Sulphur	7/10/01	Clifton et. al	n/a	n/a	n/a	n/a	88	0.5	1	89
PVT	Sulphur	7/30/03	Clifton et. al	n/a	n/a	n/a	n/a	86	0.86	4	84

FLOW MEASUREMENT (feet & seco

Owner	Stream	Date	Crew	width	area	velocity	discharge
PVT	Sulphur	7/10/01	Clifton et al	21.2	10.62	0.64	6.8
PVT	Sulphur	7/30/03	Clifton et al	33	14.14	0.81	11.5

Biota Observations: none

Definitions:

Width:Depth - field-id'ed bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (I.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooltail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooltail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodible cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

* '99 to '03 residual pool depth changes could be due to observer error.

SCI Summary for Jamison Cr

NOTE: all units are in feet and tenths

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull Width	Mean	Max	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
						Bankfull Depth	Bankfull Depth			
PNF	Jamison	7/12/99	Clifton et al.	1	37.90	2.42	3.24	15.68	55.49	1.46
PNF	Jamison	7/12/99	Clifton et al.	2	48.30	1.77	2.71	27.25	55.08	1.14
PNF	Jamison	7/12/99	Clifton et al.	3	41.10	1.69	2.39	24.29	47.60	1.16
PNF	Jamison	7/9/01	Clifton et al.	1	39.80	1.97	3.21	20.20	52.40	1.31
PNF	Jamison	7/9/01	Clifton et al.	2	49.70	1.75	3.02	28.40	54.85	1.10
PNF	Jamison	7/9/01	Clifton et al.	3	41.70	1.59	2.48	26.22	48.30	1.15
PNF	Jamison	7/29/03	Clifton et al.	1	37.90	1.43	2.90	26.50	50.80	1.34
PNF	Jamison	7/29/03	Clifton et al.	2	49.10	1.61	2.79	30.44	54.00	1.10
PNF	Jamison	7/29/03	Clifton et al.	3	42.30	1.39	2.21	30.40	47.90	1.13

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Bankfull Width	Bankfull Depth	Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
PNF	Jamison	7/12/99	Clifton	2	33.7	1.5		22.41	89.6	2.66
PNF	Jamison	7/12/99	Clifton	3	41.5	1.5		27.47	48.2	1.16
PNF	Jamison	7/12/99	Clifton	4	36.8	1.7		22.25	42.0	1.14
PNF	Jamison	7/12/99	Clifton	5	39.0	1.5		25.79	52.7	1.35
PNF	Jamison	7/4/01	Clifton et al.	1	44	1.51		29.14	50.5	1.15
PNF	Jamison	7/4/01	Clifton et al.	2	37.4	1.54		24.28	50	1.33
PNF	Jamison	7/4/01	Clifton et al.	3	37.2	1.57		23.69	48.8	1.31
PNF	Jamison	7/4/01	Clifton et al.	4	41	1.74		23.56	54.1	1.31
PNF	Jamison	7/4/01	Clifton et al.	5	36.4	1.62		22.46	48.95	1.34
PNF	Jamison	7/29/03	Clifton et al.	1	39.7	1.66	2.48	23.87	45	1.13
PNF	Jamison	7/29/03	Clifton et al.	2	40	1.58545	2.29	25.23	48	1.20
PNF	Jamison	7/29/03	Clifton et al.	3	46	1.2975	1.77	35.45	53.2	1.16
PNF	Jamison	7/29/03	Clifton et al.	4	38.8	1.585	2.46	24.48	52.8	1.36
PNF	Jamison	7/29/03	Clifton et al.	5	39.3	1.50583	2.56	26.10	48.9	1.24

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces Large Wood	Pebble Count D50
				Habitat Lengths		Habitat Length		Residual	% Fines		
				Fast	Slow	Fast	Slow	Pool Depth*	in Pooltails		
PNF	Jamison	7/26/99	Clifton	912	197	82%	18%	1.3	8.5	0.0	
PNF	Jamison	7/9/01	Clifton et. al	885	225	79.7	20.3	1.0	2.6	n/a	34
PNF	Jamison	7/28/03	Clifton et. al	920	171	84.3	15.7	1.7	11.5		32

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
PNF	Jamison	6/8/99	Clifton et. al	64	5	31	27.382	n/a	n/a	n/a	n/a

FLOW MEASUREMENT (feet & secor width area velocity discharge)

PNF	Jamison	7/9/01	Clifton et al		11.51	1.25	14.4
PNF	Jamison	7/28/03	Clifton et al	29.6	15.57	1.66	25.8

Biota Observations: none

Definitions:

Width:Depth - field-id'ed bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (I.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooltail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooltail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

* '99 to '03 changes in residual pool depth could be due to observer error.

SCI Summary for Middle Fork Feather River @ Nelson PT

NOTE: all units are in feet and tenths

Pass 1 SUMMARY

Owner	Stream	Date	Crew	D50
PNF	MFFR-Nelson	7/11/01	Clifton/et. al	93
PNF	MFFR-Nelson	7/24/03	Clifton/et. al	74

PASS #2 CROSS-SECTION SUMMARY

Owner	Stream	Date	Crew	Cross-section	Bankfull	Mean	Max	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
					Width	Bankfull Depth	Bankfull Depth			
PNF	MFFR-Nelson	7/22/99	Clifton/et. al	1	77.50	2.74	4.46	28.26	110.03	1.42
PNF	MFFR-Nelson	7/22/99	Clifton	2	127.90	2.28	4.01	55.99	138.02	1.08
PNF	MFFR-Nelson	7/21/99	Clifton - et. al	3	103.50	1.95	2.87	53.05	189.01	1.83
PNF	MFFR-Nelson	7/15/01	Clifton et. Al	1	77.20	2.44	4.65	31.63	108.00	1.40
PNF	MFFR-Nelson	7/15/01	Clifton et. Al	2	126.80	2.55	3.96	49.70	145.00	1.14
PNF	MFFR-Nelson	7/11/01	Clifton et. Al	3	107.75	2.10	3.40	51.30	197.90	1.83
PNF	MFFR-Nelson	7/24/03	Clifton et. Al	1	77.00	2.81	4.58	27.40	113.70	1.48
PNF	MFFR-Nelson	7/24/03	Clifton et. Al	2	124.40	2.30	3.96	54.06	138.60	1.11
PNF	MFFR-Nelson	7/24/03	Clifton et. Al	3	71.20	2.06	3.22	34.64	185.10	2.60

PASS #2 TRANSECT SUMMARY

Owner	Stream	Date	Crew	Transect	Width	Depth	Bankfull Depth	Width:Depth Ratio	Floodprone width	Entrenchment Ratio
PNF	MFFR-Nelson	7/21/99	Clifton	2	113.0	1.9		59.38	179.4	1.59
PNF	MFFR-Nelson	7/21/99	Clifton	3	86.2	3.1		27.48	118.8	1.38
PNF	MFFR-Nelson	7/21/99	Clifton	4	82.0	2.1		38.95	96.2	1.17
PNF	MFFR-Nelson	7/21/99	Clifton	5	82.1	2.8		29.24	116.7	1.42
PNF	MFFR-Nelson	7/12/01	Clifton	1	76.7	2.23		34.39	197.7	2.57
PNF	MFFR-Nelson	7/12/01	Clifton	2	102	2.04		50	135.8	1.33
PNF	MFFR-Nelson	7/12/01	Clifton	3	114.5	1.58		72.46	134.5	1.17
PNF	MFFR-Nelson	7/12/01	Clifton	4	80	2.2		36.6	112.5	1.39
PNF	MFFR-Nelson	7/12/01	Clifton	5	87.4	2.03		43.05	107.4	1.22
PNF	MFFR-Nelson	7/24/03	Clifton	1	72.7	2.31	5.49	31.43	194.3	2.67
PNF	MFFR-Nelson	7/24/03	Clifton	2	102.4	2.42	4.44	42.37	137.4	1.34
PNF	MFFR-Nelson	7/24/03	Clifton	3	114.2	2.27	4.09	50.28	139.8	1.22
PNF	MFFR-Nelson	7/24/03	Clifton	4	94.5	2.87	5.2	32.94	118	1.25
PNF	MFFR-Nelson	7/24/03	Clifton	5	81.9	2.93	5.2	27.92	101	1.23

PASS#3 Pool Data

Owner	Stream	Date	Crew	Total		Percent		Average	Average	# Pieces Large Wood	Pebble Count D50
				Habitat Lengths		Habitat Length		Residual	% Fines		
				Fast	Slow	Fast	Slow	Pool Depth*	in Pooftails		
PNF	MFFR-Nelson	7/26/99	Clifton et. al	823	983	46%	54%	5.6	15.3	0.0	
PNF	MFFR-Nelson	7/15/01	Clifton et. al	920	988	48.2	51.8	5.1	8.7	n/a	92
PNF	MFFR-Nelson	7/24/03	Clifton et. al	965	1165	45.3	54.7	5.6	7.0	n/a	73

PASS#4 (measurements on two banks at each of 50 transects)

Owner	Stream	Date	Crew	Bank Stability Rating			Average	ShoreDepth		BankAngle	
				# Stable	# Vulnerable	# Unstable	% shade	% = 0	Avg of rest	% < 90	% > 90
PNF	MFFR-Nelson	8/17/99	Clifton et. al	51	35	14	15.64	n/a	n/a	n/a	n/a

FLOW MEASUREMENT (feet & seconds)

Owner	Stream	Date	Crew	width	area	velocity	discharge
PNF	MFFR-Nelson	7/15/01	Clifton et al	57.7	57.05	0.82	46.8
PNF	MFFR-Nelson	7/28/03	Clifton et al	67.5	55.8	1.47	82.3

Biota Observations: none

Definitions:

Width:Depth - field-id'ed bankfull width / mean bankfull depth

Floodprone width - width at 2x max bankfull depth

Entrenchment ratio (I.e. channel confinement in valley) = Floodplain width / bankfull width

Residual pool depth = max pool depth minus max depth of pooftail crest

% fines - count substrate @ 49 string intersections in a one ft square grid and then add one corner for 50. Multiply by 2. (randomly tossed 3x's per pooftail)

Bank stability measured at a one foot wide plot, going from bankfull upslope to break

Stable - 75% veg, or other non-erodable cover, no sign of instability

Vulnerable - same as stable, but with sign of instability

Unstable - less than 75% cover, may have other instability indicators

% shade - only one measurement per transect with a solar pathfinder

Shore depth - measured @ the current water's edge

Bank angle - dominant angle of streambank between the base of the bank and bankfull elevation

* '99 to '03 changes in residual pool depth could be due to observer error.

APPENDIX C – CROSS-SECTIONS
Stream Condition Inventory-
Cross-section Discussion
12/22/03

Background:

The Feather River Coordinated Resource Management (FRCRM) group, under a variety of funding programs, has been conducting watershed trend monitoring since 1999. This monitoring has utilized a variety of metrics at multiple spatial and temporal scales. The purpose of this monitoring is to ascertain trends in watershed function. Utilization of multiple metrics over a range of time and space scales allows for analyses that incorporate both qualitative and quantitative data and observations. The following is a discussion of quantified cross-section data buttressed with qualitative observation of sediment related inputs (discharge and sediment supply) at the watershed scale over the previous decade.

Flow Regime/Sediment Input Discussion:

The Feather River watershed has experienced two (2) distinct climatic regimes over the last decade. Water year (WY) 1992-3 was the first year of a six-year period (WY92-WY98) of much above normal precipitation. WY93-4 was the only dry year in the period. This period was characterized by frequent moderate to large flood events which culminated in the 1997 flood of record. WY1999-0 ushered in a four-year period (WY99-0 to present) of below normal precipitation with no flood events*. WY 2002-3 was the only year with normal precipitation, largely due to a very wet spring, which maintained an extended period of elevated in-channel flows.

Significant Flood Dates: Jan. '93, Jan. '95, Mar. '95, May '95, Jan. '97

Table #1- Total Annual Precipitation (inches of water); (Wilcox data, 1995-03, Genesee, Ca).

WY 95-96	WY 96-97	WY 97-98	WY 98-99	WY 99-00	WY 00-01	WY 01-02	WY 02-03	WY Ave.
54.55	58.90	60.70	47.80	43.65	23.60	33.60	49.60	46.55

Typically, large floods deliver significant sediment and debris inputs to the channel system throughout the watershed. Depending on magnitude and frequency these inputs result in a dynamic channel response of interrelated processes. The 1997 flood of record (~48,000 cfs./Indian Cr. @ Crescent Mills) affected each subwatershed differently. However, the net result was locally catastrophic delivery of sediments and debris from tributaries to the mainstem channels (Indian Creek, Spanish Creek, NFFR and MFFR). The more frequent, longer duration low flows begin a process of re-working the deposited materials concurrent with ongoing vegetation recovery.

*"No flood events" as used in this context means no flows exceeding a 2-year event at the watershed scale.

Sampling Methodologies:

The FRCRM established three (3) permanent cross-sections at each of the eighteen (18) monitoring reaches. An additional five (5) cross-sections are randomly selected and surveyed during each sampling period. These 5 cross-sections are not monumented and the location varies from period to period. The permanent cross-sections are intended to accurately represent changes in channel form

over time. The random cross-sections are intended to generally characterize overall channel condition. This discussion is focused on the permanent cross-sections, the data presented and observations on the efficacy of the survey methodology.

Results/Methodology Discussion:

Cross-section analyses typically use metrics that represent the bankfull channel form: bankfull width, bankfull mean depth, cross-sectional area and W/D ratio. Bankfull channel morphology is an inter-relational state of dynamic response to both the flow regime and the sediment supply. These responses are also a function of the structural attributes that evolve along the channel as part of the dynamism. As noted above, these cross-sections have all been surveyed in a period of drier years, which followed an abnormally wet five-year period. Typically, multi-year dry periods result in the establishment and hardening of the vegetative structure of the channel system. Un-interrupted, this vegetative response can set the stage for significant channel response/improvement when high flows and the attendant sediment supply resume.

The three biennial data sets represented here offer an excellent baseline for determining change when high flows/sediment supply resumes. The data has been summarized in the attached sheets with two (2) stratifications. Reach and year stratify the first data set. The second data set is stratified by cross-section. There were no discernible trend changes at either the reach or watershed scale.

The data does show significant variability from sample period to sample period regardless of stratification. This can generally be attributed to the subjective determination of the bankfull elevation. It is likely that the dry period vegetative response influenced some of the bankfull determinations leading to considerable 'noise' in data sets that generally did not, and would not be expected to, change significantly over the five year sampling period.

Bankfull determination has always been the controversial linchpin in geomorphic channel investigations. Generally, determinations that use a congruence of physical and biological indices are the most reliable. An excellent reference for survey crews to use would be, *Stream Channel Reference Sites, USDA-FS General Technical Report, RM-245; Harrelson, Rawlins and Potyondy*. Further, a semi-permanent stake (e.g. 12" length, 3/8" rebar) driven in to ground level at the bankfull elevation may help reduce the subjective noise. These stakes could be lost in high flow events, however, it may be worth the risk to 'tighten' the data sets on this critical parameter..

STREAM CONDITION INVENTORY- CROSS-SECTION ANALYSIS (page 2 of 6)

Comparison of Selected Geomorphic Values(derived from 6 of 20 data sets):

Stratified by Reach--

<u>Reach/YR/X-s#</u>	<u>A_{bkf} (ft²)</u>	<u>A_{flp}(ft²)</u>	<u>W_{bkf} (ft)</u>	<u>D_{mean}(ft)W/D ratio</u>	
Lights Cr./ '99/ #1	87.5	137.5	47.2	1.85	25.46
Lights Cr./ '99/ #2	85	130	48.8	1.74	28.02
Lights Cr./ '99/ #3	<u>85</u>	<u>260</u>	<u>53.7</u>	<u>1.58</u>	<u>33.93</u>
Average	85.83	175.83	49.90	1.73	29.13
Lights Cr./ '01/ #1	55	82.5	49.95	1.10	45.36
Lights Cr./ '01/ #2	30	52.5	33.5	0.90	37.41
Lights Cr./ '01/ #3	<u>37.5</u>	<u>145</u>	<u>20.1</u>	<u>1.87</u>	<u>10.77</u>
Average	40.83	93.33	34.52	1.29	31.18
Lights Cr./ '03/ #1	42.5	82.5	46.4	0.92	50.66
Lights Cr./ '03/ #2	42.5	87.5	40	1.06	37.65
Lights Cr./ '03/ #3	<u>35</u>	<u>132.5</u>	<u>22.4</u>	<u>1.56</u>	<u>14.34</u>
Average	40.00	100.83	36.27	1.18	34.21

Stratified by Cross-section--

<u>Reach/X-s#/ YR</u>	<u>A_{bkf} (ft²)</u>	<u>A_{flp}(ft²)</u>	<u>W_{bkf} (ft)</u>	<u>D_{mean}(ft)W/D ratio</u>	
Lights Cr./ #1/ '99	87.5	137.5	47.2	1.85	25.46
Lights Cr./ #1/ '01	55	82.5	49.95	1.10	45.36
Lights Cr./ #1/ '03	<u>42.5</u>	<u>82.5</u>	<u>46.4</u>	<u>0.92</u>	<u>50.66</u>
Average	61.67	100.83	47.85	1.29	40.49
Lights Cr./ #2/ '99	85	130	48.8	1.74	28.02
Lights Cr./ #2/ '01	30	52.5	33.5	0.90	37.41
Lights Cr./ #2/ '03	<u>42.5</u>	<u>87.5</u>	<u>40</u>	<u>1.06</u>	<u>37.65</u>
Average	52.50	90.00	40.77	1.23	34.36
Lights Cr./ #3/ '99	85	260	53.7	1.58	33.93
Lights Cr./ #3/ '01	37.5	145	20.1	1.87	10.77
Lights Cr./ #3/ '03	<u>35</u>	<u>132.5</u>	<u>22.4</u>	<u>1.56</u>	<u>14.34</u>
Average	52.50	179.17	32.07	1.67	19.68

STREAM CONDITION INVENTORY- CROSS-SECTION ANALYSIS (page 3 of 6)

Comparison of Selected Geomorphic Values(derived from 6 of 20 data sets):

Stratified by Reach--

<u>Reach/YR/X-s#</u>	<u>A_{bkf} (ft²)</u>	<u>A_{flp}(ft²)</u>	<u>W_{bkf} (ft)</u>	<u>D_{mean}(ft)W/D ratio</u>	
Greenhorn/ '99/ #1	57.5	180	43.9	1.31	33.52
Greenhorn/ '99/ #2	90	200	40	2.25	17.78
Greenhorn/ '99/ #3	<u>50</u>	<u>107.5</u>	<u>46.8</u>	<u>1.07</u>	<u>43.80</u>
Average	65.83	162.50	43.57	1.54	31.70
Greenhorn/ '01/ #1	32.5	72.5	40.3	0.81	49.97
Greenhorn/ '01/ #2	52.5	57.5	35.4	1.48	23.87
Greenhorn/ '01/ #3	<u>57.5</u>	<u>115</u>	<u>44.1</u>	<u>1.30</u>	<u>33.82</u>
Average	47.50	81.67	39.93	1.20	35.89
Greenhorn/ '03/ #1	22.5	87.5	39.1	0.58	67.95
Greenhorn/ '03/ #2	90	162.5	38.9	2.31	16.81
Greenhorn/ '03/ #3	<u>57.5</u>	<u>142.5</u>	<u>45.9</u>	<u>1.25</u>	<u>36.64</u>
Average	56.67	130.83	41.30	1.38	40.47

Stratified by Cross-section--

<u>Reach/X-s#/ YR</u>	<u>A_{bkf} (ft²)</u>	<u>A_{flp}(ft²)</u>	<u>W_{bkf} (ft)</u>	<u>D_{mean}(ft)W/D ratio</u>	
Greenhorn/ #1/ '99	57.5	180	43.9	1.31	33.52
Greenhorn/ #1/ '01	32.5	72.5	40.3	0.81	49.97
Greenhorn/ #1/ '03	<u>22.5</u>	<u>87.5</u>	<u>39.1</u>	<u>0.58</u>	<u>67.95</u>
Average	37.50	113.33	41.10	0.90	50.48
Greenhorn/ #2/ '99	90	200	40	2.25	17.78
Greenhorn/ #2/ '01	52.5	57.5	35.4	1.48	23.87
Greenhorn/ #2/ '03	<u>90</u>	<u>162.5</u>	<u>38.9</u>	<u>2.31</u>	<u>16.81</u>
Average	60.00	123.61	38.83	1.54	30.71
Greenhorn/ #3/ '99	50	107.5	46.8	1.07	43.80
Greenhorn/ #3/ '01	57.5	115	44.1	1.30	33.82
Greenhorn/ #3/ '03	<u>57.5</u>	<u>142.5</u>	<u>45.9</u>	<u>1.25</u>	<u>36.64</u>
Average	55.00	121.67	45.60	1.21	38.09

STREAM CONDITION INVENTORY- CROSS-SECTION ANALYSIS (page 4 of 6)

Comparison of Selected Geomorphic Values(derived from 6 of 20 data sets):

Stratified by Reach--

<u>Reach/YR/X-s#</u>	<u>A_{bkf} (ft²)</u>	<u>A_{flp}(ft²)</u>	<u>W_{bkf} (ft)</u>	<u>D_{mean}(ft)W/D ratio</u>	
Sulphur Cr./ '99/ #1	60	142.5	49.3	1.22	40.51
Sulphur Cr./ '99/ #2	32.5	80	33.4	0.97	34.32
Sulphur Cr./ '99/ #3	<u>62.5</u>	<u>165</u>	<u>53.8</u>	<u>1.16</u>	<u>46.31</u>
Average	51.67	129.17	45.50	1.12	40.38
Sulphur Cr./ '01/ #1	40	117.5	45.4	0.88	51.53
Sulphur Cr./ '01/ #2	42.5	90	35.1	1.21	28.99
Sulphur Cr./ '01/ #3	<u>62.5</u>	<u>205</u>	<u>52.1</u>	<u>1.20</u>	<u>43.43</u>
Average	48.33	137.50	44.20	1.10	41.32
Sulphur Cr./ '03/ #1	47.5	135	46.1	1.03	44.74
Sulphur Cr./ '03/ #2	42.5	97.5	37.2	1.14	32.56
Sulphur Cr./ '03/ #3	<u>72.5</u>	<u>190</u>	<u>55.2</u>	<u>1.31</u>	<u>42.03</u>
Average	54.17	140.83	46.17	1.16	39.78

Stratified by Cross-section--

<u>Reach/X-s#/ YR</u>	<u>A_{bkf} (ft²)</u>	<u>A_{flp}(ft²)</u>	<u>W_{bkf} (ft)</u>	<u>D_{mean}(ft)W/D ratio</u>	
Sulphur Cr./ #1/ '99	60	142.5	49.3	1.22	40.51
Sulphur Cr./ #1/ '01	40	117.5	45.4	0.88	51.53
Sulphur Cr./ #1/ '03	<u>47.5</u>	<u>135</u>	<u>46.1</u>	<u>1.03</u>	<u>44.74</u>
Average	49.17	131.67	46.93	1.04	45.59
Sulphur Cr./ #2/ '99	32.5	80	33.4	0.97	34.32
Sulphur Cr./ #2/ '01	42.5	90	35.1	1.21	28.99
Sulphur Cr./ #2/ '03	<u>42.5</u>	<u>97.5</u>	<u>37.2</u>	<u>1.14</u>	<u>32.56</u>
Average	39.17	89.17	35.23	1.11	31.96
Sulphur Cr./ #3/ '99	62.5	165	53.8	1.16	46.31
Sulphur Cr./ #3/ '01	62.5	205	52.1	1.20	43.43
Sulphur Cr./ #3/ '03	<u>72.5</u>	<u>190</u>	<u>55.2</u>	<u>1.31</u>	<u>42.03</u>
Average	65.83	186.67	53.70	1.22	43.92

STREAM CONDITION INVENTORY- CROSS-SECTION ANALYSIS (page 5 of 6)

Comparison of Selected Geomorphic Values(derived from 6 of 20 data sets):

Stratified by Reach--

<u>Reach/YR/X-s#</u>	<u>A_{bkf} (ft²)</u>	<u>A_{flp}(ft²)</u>	<u>W_{bkf} (ft)</u>	<u>D_{mean}(ft)W/D ratio</u>	
EBNFFR@NF/ '99/ #1	200	360	98.6	2.03	48.61
EBNFFR@NF/ '99/ #2	320	1137.5	115.3	2.78	41.54
EBNFFR@NF/ '99/ #3	<u>440</u>	<u>872.5</u>	<u>140.6</u>	<u>3.13</u>	<u>44.93</u>
Average	320.00	790.00	118.17	2.64	45.03
EBNFFR@NF/ '01/ #1	335	552.5	124.2	2.70	46.05
EBNFFR@NF/ '01/ #2	415	1232.5	129.3	3.21	40.29
EBNFFR@NF/ '01/ #3	<u>380</u>	<u>782.5</u>	<u>167.6</u>	<u>2.27</u>	<u>73.92</u>
Average	376.67	855.83	140.37	2.72	53.42
EBNFFR@NF/ '03/ #1	417.5	677.5	122.4	3.41	35.88
EBNFFR@NF/ '03/ #2	425	1275	130.5	3.26	40.07
EBNFFR@NF/ '03/ #3	<u>385</u>	<u>790</u>	<u>152.1</u>	<u>2.53</u>	<u>60.09</u>
Average	409.17	914.17	135.00	3.07	45.35

Stratified by Cross-section--

<u>Reach/X-s#/ YR</u>	<u>A_{bkf} (ft²)</u>	<u>A_{flp}(ft²)</u>	<u>W_{bkf} (ft)</u>	<u>D_{mean}(ft)W/D ratio</u>	
EBNFFR@NF/ #1/ '99	200	360	98.6	2.03	48.61
EBNFFR@NF/ #1/ '01	335	552.5	124.2	2.70	46.05
EBNFFR@NF/ #1/ '03	<u>417.5</u>	<u>677.5</u>	<u>122.4</u>	<u>3.41</u>	<u>35.88</u>
Average	317.50	530.00	115.07	2.71	43.51
EBNFFR@NF/ #2/ '99	320	1137.5	115.3	2.78	41.54
EBNFFR@NF/ #2/ '01	415	1232.5	129.3	3.21	40.29
EBNFFR@NF/ #2/ '03	<u>425</u>	<u>1275</u>	<u>130.5</u>	<u>3.26</u>	<u>40.07</u>
Average	386.67	1215.00	125.03	3.08	40.63
EBNFFR@NF/ #3/ '99	440	872.5	140.6	3.13	44.93
EBNFFR@NF/ #3/ '01	380	782.5	167.6	2.27	73.92
EBNFFR@NF/ #3/ '03	<u>385</u>	<u>790</u>	<u>152.1</u>	<u>2.53</u>	<u>60.09</u>
Average	401.67	815.00	153.43	2.64	59.65

STREAM CONDITION INVENTORY- CROSS-SECTION ANALYSIS (page 6 of 6)

Comparison of Selected Geomorphic Values(derived from 6 of 20 data sets):

Stratified by Reach--


<u>Reach/YR/X-s#</u>	<u>A_{bkf} (ft²)</u>	<u>A_{flp}(ft²)</u>	<u>W_{bkf} (ft)</u>	<u>D_{mean}(ft)</u>	<u>W/D ratio</u>
MFFR@Nelson/ '99/ #1	202.5	422.5	77.5	2.61	29.66
MFFR@Nelson/ '99/ #2	320	552.5	127.9	2.50	51.12
MFFR@Nelson/ '99/ #3	<u>150</u>	<u>425</u>	<u>103.5</u>	<u>1.45</u>	<u>71.42</u>
Average	224.17	466.67	102.97	2.19	50.73
MFFR@Nelson/ '01/ #1	207.5	427.5	77.2	2.69	28.72
MFFR@Nelson/ '01/ #2	325	547.5	126.8	2.56	49.47
MFFR@Nelson/ '01/ #3	<u>202.5</u>	<u>552.5</u>	<u>107.75</u>	<u>1.88</u>	<u>57.33</u>
Average	245.00	509.17	103.92	2.38	45.18
MFFR@Nelson/ '03/ #1	210	415	77	2.73	28.23
MFFR@Nelson/ '03/ #2	297.5	922.5	124.4	2.39	52.02
MFFR@Nelson/ '03/ #3	<u>135</u>	<u>422.5</u>	<u>71.2</u>	<u>1.90</u>	<u>37.55</u>
Average	214.17	586.67	90.87	2.34	39.27

Stratified by Cross-section--


<u>Reach/X-s#/ YR</u>	<u>A_{bkf} (ft²)</u>	<u>A_{flp}(ft²)</u>	<u>W_{bkf} (ft)</u>	<u>D_{mean}(ft)</u>	<u>W/D ratio</u>
MFFR@Nelson/ #1/ '99	202.5	422.5	77.5	2.61	29.66
MFFR@Nelson/ #1/ '01	207.5	427.5	77.2	2.69	28.72
MFFR@Nelson/ #1/ '03	<u>210</u>	<u>415</u>	<u>77</u>	<u>2.73</u>	<u>28.23</u>
Average	206.67	421.67	77.23	2.68	28.87
MFFR@Nelson/ #2/ '99	320	552.5	127.9	2.50	51.12
MFFR@Nelson/ #2/ '01	325	547.5	126.8	2.56	49.47
MFFR@Nelson/ #2/ '03	<u>297.5</u>	<u>922.5</u>	<u>124.4</u>	<u>2.39</u>	<u>52.02</u>
Average	314.17	674.17	126.37	2.49	50.87
MFFR@Nelson/ #3/ '99	150	425	103.5	1.45	71.42
MFFR@Nelson/ #3/ '01	202.5	552.5	107.75	1.88	57.33
MFFR@Nelson/ #3/ '03	<u>135</u>	<u>422.5</u>	<u>71.2</u>	<u>1.90</u>	<u>37.55</u>
Average	162.50	466.67	94.15	1.74	55.43

UTM X-coord = 652357.9
 UTM Y coord = 4451554.5

all measurements in feet TBM on ponderosa tree on left bank with orange diamond tag
 compass bearing LBTBM to RB tree (3rd from left) = S13degreesW

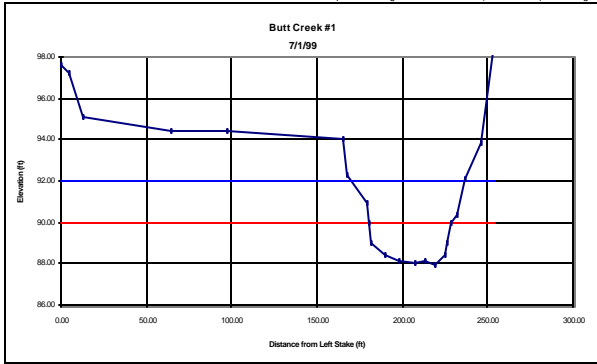


Dark Blue Line w/Markers=Basic Cross Section

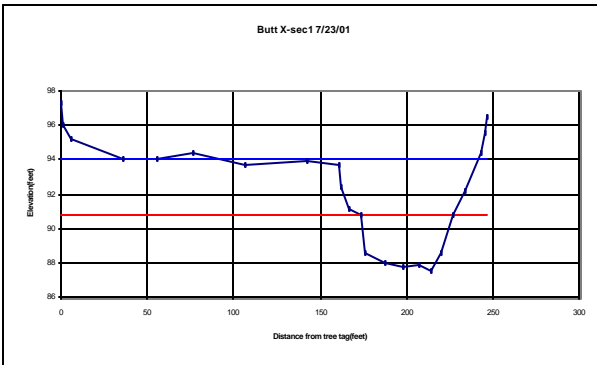

Butt Cr: 7/23/01

Dist from left stake	Total depth	Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	2.68	97.32	90.8	94.06	TBM-LB
1.3	3.95	96.05	90.8	94.06	
6	4.8	95.2	90.8	94.06	
36	5.98	94.02	90.8	94.06	
56.1	5.97	94.03	90.8	94.06	
76.6	5.66	94.34	90.8	94.06	
107	6.27	93.73	90.8	94.06	
143	6.09	93.91	90.8	94.06	
161	6.33	93.67	90.8	94.06	TOBL
162.7	7.61	92.39	90.8	94.06	
167	8.84	91.16	90.8	94.06	
174	9.2	90.8	90.8	94.06	BFL
175.8	11.42	88.58	90.8	94.06	LEW
188	12.06	87.94	90.8	94.06	
198.5	12.2	87.8	90.8	94.06	
207	12.18	87.82	90.8	94.06	
214	12.46	87.54	90.8	94.06	T
220.1	11.45	88.55	90.8	94.06	REW
227.3	9.2	90.8	90.8	94.06	BFR
234	7.87	92.13	90.8	94.06	
242.85	5.64	94.36	90.8	94.06	TOBR
245.5	4.43	95.57	90.8	94.06	
246.8	3.46	96.54	90.8	94.06	TBM-RB

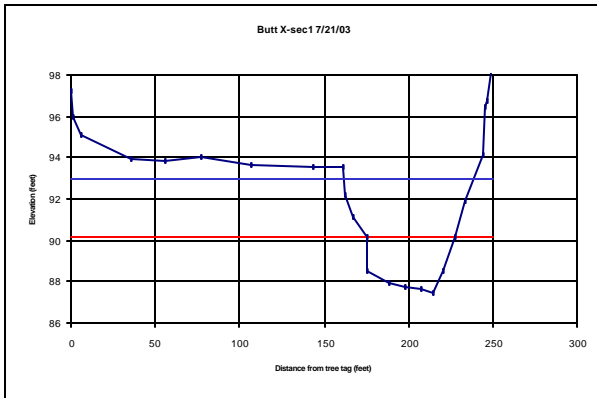


butt crossection-1
7/21/03

Dist from left	Total Depth	Elevation	2x			Notes
			Bankfull depth	Bankfull elevation	Bankfull depth	
0	2.8	97.2		90.19	92.96	tbnl
1.3	4	96		90.19	92.96	
6	4.86	95.14		90.19	92.96	
36	6.09	93.91		90.19	92.96	
56.1	6.12	93.88		90.19	92.96	
76.6	5.97	94.03		90.19	92.96	
107	6.39	93.61		90.19	92.96	
143	6.49	93.51		90.19	92.96	
161	6.41	93.59		90.19	92.96	toBl
162.7	7.82	92.18		90.19	92.96	
167	8.84	91.16		90.19	92.96	
175	9.81	90.19	0	90.19	92.96	bf
175.8	11.45	88.55	1.64	90.19	92.96	wel
188	12.11	87.89	2.3	90.19	92.96	
198.5	12.23	87.77	2.42	90.19	92.96	
207	12.37	87.63	2.56	90.19	92.96	
214.6	12.58	87.42	2.77	90.19	92.96	t
220.5	11.51	88.49	1.7	90.19	92.96	wer
227.2	9.81	90.19	0	90.19	92.96	blr
234	8.11	91.89		90.19	92.96	
243.8	5.89	94.11		90.19	92.96	toBr
245.5	3.51	96.49		90.19	92.96	
246.8	3.3	96.7		90.19	92.96	
250.5	1.19	98.81		90.19	92.96	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg


Three Year SUMMARY		Mean	Max	Width:	Flood-	Entrench	
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth Ratio	prone width	ment Ratio	
1999	1	48.5	1.6	2.03	30.3	70.16	1.45
2001	1	53.30	2.36	3.26	22.58	186.65	3.50
2003	1	52.20	1.91	2.77	27.29	76.90	1.47

UTM X-coord = 652225.9 TBM on ponderosa pine on LB w/ orange diamond tag 1-Jul-99 all measurements in feet
 UTM Y-coord = 4451548 compass bearing TOBL to RB tree = S6degreesW

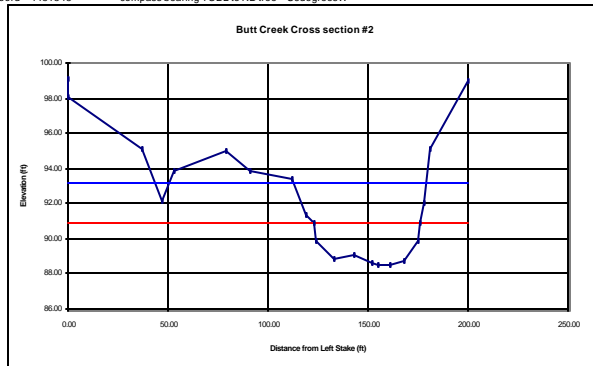


Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	99.14	90.84	93.15
0.01	98.10	90.84	93.15
36.60	95.15	90.84	93.15
46.90	92.20	90.84	93.15
52.60	93.88	90.84	93.15
79.00	94.99	90.84	93.15
91.20	93.91	90.84	93.15
112.20	93.40	90.84	93.15
118.70	91.36	90.84	93.15
123.40	90.84	90.84	93.15
124.20	89.84	90.84	93.15
132.80	88.82	90.84	93.15
143.00	89.07	90.84	93.15
152.20	88.60	90.84	93.15
154.90	88.53	90.84	93.15
161.10	88.56	90.84	93.15
167.70	88.76	90.84	93.15
175.40	89.84	90.84	93.15
175.80	90.84	90.84	93.15
177.80	92.00	90.84	93.15
181.30	95.06	90.84	93.15
200.00	98.98	90.84	93.15

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

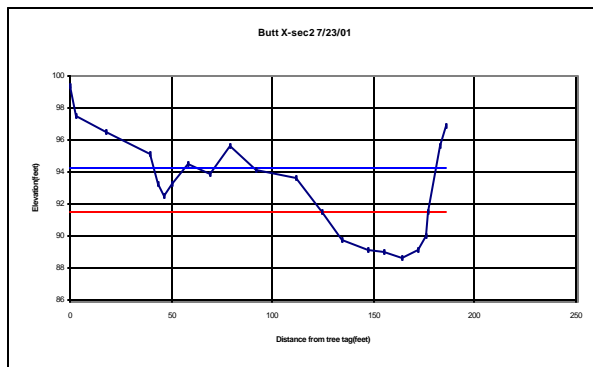

Butt Cr. 7/23/01

Dist from left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	0.57	99.43	91.45	94.2	TBM-LB
3	2.51	97.49	91.45	94.2	
18	3.56	96.44	91.45	94.2	
40	4.92	95.08	91.45	94.2	
43.6	6.75	93.25	91.45	94.2	
46.3	7.56	92.44	91.45	94.2	
50.1	6.8	93.2	91.45	94.2	
58.3	5.49	94.51	91.45	94.2	
69.2	6.15	93.85	91.45	94.2	
79.3	4.43	95.57	91.45	94.2	
91.9	5.9	94.1	91.45	94.2	
112	6.41	93.59	91.45	94.2	TOBL
124.6	8.55	91.45	91.45	94.2	BFL
134	10.31	89.69	91.45	94.2	LEW
147	10.9	89.1	91.45	94.2	
155.6	10.97	89.03	91.45	94.2	
164	11.34	88.66	91.45	94.2	T
171.8	10.85	89.15	91.45	94.2	
176	10.04	89.96	91.45	94.2	REW
177.3	8.55	91.45	91.45	94.2	BFR
182.5	4.37	95.63	91.45	94.2	TOBR
185.6	3.16	96.84	91.45	94.2	TBM-RB

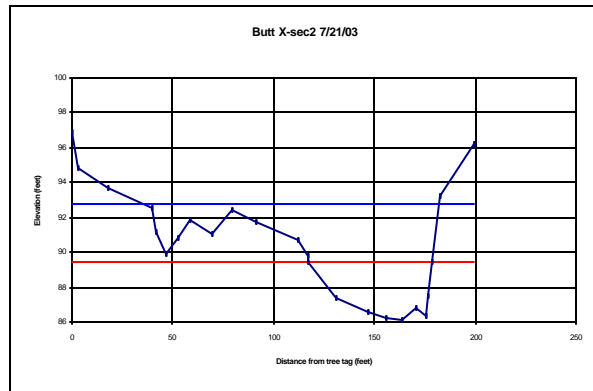


butt creek cross section-2
7/21/03

Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	bankfull elevation	Notes
0	3.15		96.85	89.4	92.73	tbrl
3	5.12		94.88	89.4	92.73	
18	6.29		93.71	89.4	92.73	
40	7.41		92.59	89.4	92.73	
41.5	8.86		91.14	89.4	92.73	
46.7	10.12		89.88	89.4	92.73	trib
53	9.13		90.87	89.4	92.73	
58.3	8.13		91.87	89.4	92.73	
69.2	8.95		91.05	89.4	92.73	
79.3	7.54		92.46	89.4	92.73	
91.5	8.22		91.78	89.4	92.73	
112	9.28		90.72	89.4	92.73	tobl
117	10.24		89.76	89.4	92.73	
117.5	10.6	0	89.4	89.4	92.73	blf
131.3	12.68	2.08	87.32	89.4	92.73	we1
147	13.47	2.87	86.53	89.4	92.73	
155.6	13.81	3.21	86.19	89.4	92.73	
163.5	13.93	3.33	86.07	89.4	92.73	t
170.4	13.2	2.6	86.8	89.4	92.73	
175.4	13.71	3.11	86.29	89.4	92.73	
176.7	12.46	1.86	87.54	89.4	92.73	we2
178.5	10.6	0	89.4	89.4	92.73	bl2
182.5	6.75		93.25	89.4	92.73	
199	3.78		96.22	89.4	92.73	

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BFL=Bankfull
 T=Thalweg

Three Year SUMMARY		Mean	Max	Width:	Flood:	Entrenchment
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Ratio	prone ment
1999	2	52.4	1.84	2.31	28.5	66.94 1.28
2001	2	52.70	1.87	2.79	28.18	144.00 2.73
2003	2	61.00	2.38	3.33	25.60	142.20 2.33


UTM X-coord = 6520722 all measurements in feet
 UTM Y-coord = 4451608.4

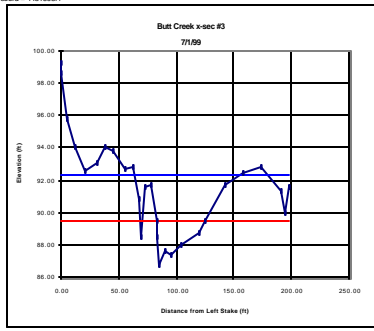

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/markers=Basic Cross Section


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	99.25	89.5	92.26
0.01	98.68	89.5	92.26
5.00	95.83	89.5	92.26
13.00	94.01	89.5	92.26
20.00	92.55	89.5	92.26
31.00	93.06	89.5	92.26
38.00	94.02	89.5	92.26
45.50	93.75	89.5	92.26
55.30	92.74	89.5	92.26
61.90	92.82	89.5	92.26
67.50	90.77	89.5	92.26
69.70	88.52	89.5	92.26
73.50	91.52	89.5	92.26
78.50	91.71	89.5	92.26
83.30	89.50	89.5	92.26
83.90	88.49	89.5	92.26
84.50	86.74	89.5	92.26
90.00	87.61	89.5	92.26
95.90	87.34	89.50	92.26
104.30	88.00	89.5	92.26
119.10	88.67	89.5	92.26
124.90	89.50	89.5	92.26
143.00	91.70	89.5	92.26
158.00	92.44	89.5	92.26
173.00	92.81	89.5	92.26
190.90	91.30	89.5	92.26
195.20	89.94	89.5	92.26
198.00	91.53	89.5	92.26

TBM on ponderosa tree LB. LB=TBM to RB bearing = S198degreesN
 NAD 27 UTM zone 10

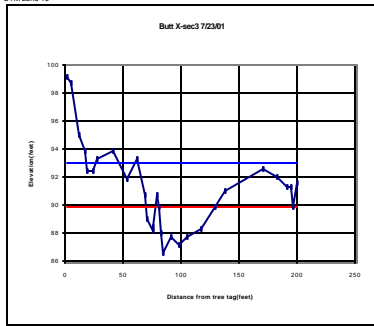

Butt Cr: 7/23/01

Dist from left stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
1	0.86	99.14	89.82	93.03 TBM-LB
6	1.29	98.71	89.82	93.03
12	5.04	94.96	89.82	93.03
17.2	6.1	93.9	89.82	93.03
18.4	7.54	92.46	89.82	93.03
24.7	7.63	92.37	89.82	93.03
27.4	6.67	93.33	89.82	93.03
40.9	6.17	93.83	89.82	93.03
52.8	8.2	91.8	89.82	93.03
62.5	6.76	93.24	89.82	93.03
69.8	9.23	90.77	89.82	93.03
70.1	11.06	88.94	89.82	93.03
75.5	11.83	88.17	89.82	93.03
75.7	11.62	88.38	89.82	93.03
79.7	9.27	90.73	89.82	93.03 TOBL
80.9	10.18	89.82	89.82	93.03 BFL
82	11.97	88.03	89.82	93.03 LEW
85.2	13.39	86.61	89.82	93.03 T
92.2	12.34	87.66	89.82	93.03
98	12.81	87.19	89.82	93.03
105.4	12.3	87.7	89.82	93.03
117.5	11.78	88.22	89.82	93.03
129	10.18	89.82	89.82	93.03 BFR
138.6	8.98	91.02	89.82	93.03
171.2	7.37	92.63	89.82	93.03
182.5	7.99	92.01	89.82	93.03
191	8.66	91.34	89.82	93.03
194.3	8.68	91.32	89.82	93.03
196.3	10.11	89.89	89.82	93.03
199.8	8.46	91.54	89.82	93.03 TBM-RB

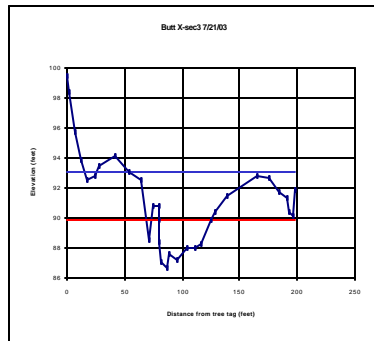

butt cross-section-3
 7/21/03


Dist from left stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	0.6	99.4	89.86	93.11 bml
1	1.55	98.45	89.86	93.11
7	4.3	95.7	89.86	93.11
13	6.18	93.82	89.86	93.11
18.2	7.4	92.6	89.86	93.11
24	7.19	92.81	89.86	93.11
28.4	6.54	93.46	89.86	93.11
41.9	5.93	94.07	89.86	93.11
53.8	6.97	93.03	89.86	93.11
63.5	7.43	92.57	89.86	93.11
71	11.5	88.5	89.86	93.11 mb
74	9.21	90.79	89.86	93.11
79.9	9.17	90.83	89.86	93.11 tml
80.5	10.14	0	89.86	93.11 bfl
80.5	11.61	1.47	88.39	89.86 93.11 wel
81.5	12.93	2.79	87.07	89.86 93.11
86	13.39	3.25	86.61	89.86 93.11 t
89	12.4	2.26	87.6	89.86 93.11
95.7	12.78	2.64	87.22	89.86 93.11
104.5	12.03	1.89	87.97	89.86 93.11
111.5	12	1.86	88	89.86 93.11
116.5	11.79	1.65	88.21	89.86 93.11 wer
125.3	10.14	0	89.86	89.86 93.11 bfl
138	9.62	90.38	89.86	93.11
139	8.53	91.47	89.86	93.11
165.4	7.22	92.78	89.86	93.11
175	7.32	92.68	89.86	93.11
184.5	8.32	91.68	89.86	93.11
190.6	8.68	91.32	89.86	93.11
193	9.55	90.45	89.86	93.11
195.7	9.9	90.1	89.86	93.11
198	8.11	91.89	89.86	93.11 endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Maxdepth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Year	section	Width	Depth	Depth Ratio	Width Ratio	Flood-prone	intrenchment
1999	3	41.6	1.69	2.76	24.6	90.99	2.19
2001	3	47.10	1.93	3.21	24.40	104.40	2.21
2003	3	44.80	1.98	3.25	22.64	213.70	4.77


UTM X-COORD = 639652
 UTM Y-coord = 4468159

North Fork Feather River ABV Lake Almanor Xsec 1

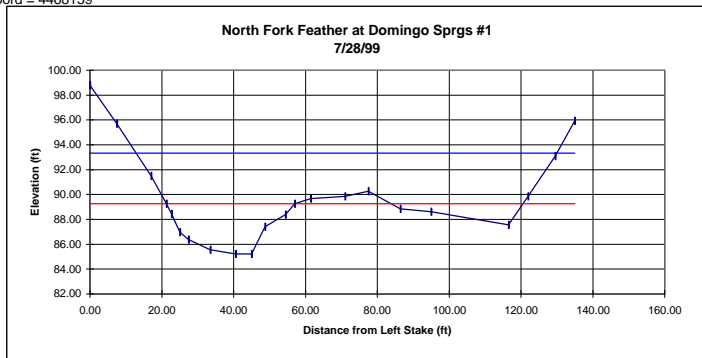


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	98.80	89.27	93.33
7.50	95.70	89.27	93.33
17.00	91.50	89.27	93.33
21.30	89.27	89.27	93.33
22.70	88.45	89.27	93.33
25.00	86.97	89.27	93.33
27.40	86.38	89.27	93.33
33.50	85.56	89.27	93.33
40.50	85.21	89.27	93.33
45.00	85.21	89.27	93.33
48.70	87.40	89.27	93.33
54.40	88.39	89.27	93.33
57.00	89.27	89.27	93.33
61.50	89.68	89.27	93.33
71.00	89.86	89.27	93.33
77.50	90.26	89.27	93.33
86.40	88.84	89.27	93.33
95.00	88.61	89.27	93.33
116.50	87.57	89.27	93.33
122.00	89.85	89.27	93.33
129.50	93.10	89.27	93.33
135.00	95.92	89.27	93.33

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

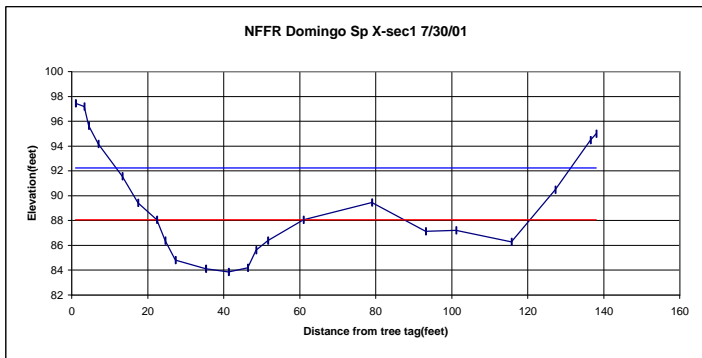

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
1	2.55	97.45	88.05	92.24	TBM-LB
3.3	2.81	97.19	88.05	92.24	
4.5	4.36	95.64	88.05	92.24	
7	5.84	94.16	88.05	92.24	
13.3	8.44	91.56	88.05	92.24	
17.4	10.58	89.42	88.05	92.24	
22.4	11.95	88.05	88.05	92.24	BFL
24.6	13.61	86.39	88.05	92.24	LEW
27.3	15.2	84.8	88.05	92.24	
35.3	15.89	84.11	88.05	92.24	
41.3	16.14	83.86	88.05	92.24	T
46.3	15.82	84.18	88.05	92.24	
48.5	14.4	85.6	88.05	92.24	
51.6	13.62	86.38	88.05	92.24	REW
61	11.95	88.05	88.05	92.24	BFR
79	10.55	89.45	88.05	92.24	
93.1	12.87	87.13	88.05	92.24	
101.1	12.79	87.21	88.05	92.24	
115.7	13.73	86.27	88.05	92.24	
127.2	9.51	90.49	88.05	92.24	
136.5	5.52	94.48	88.05	92.24	
138	5.01	94.99	88.05	92.24	

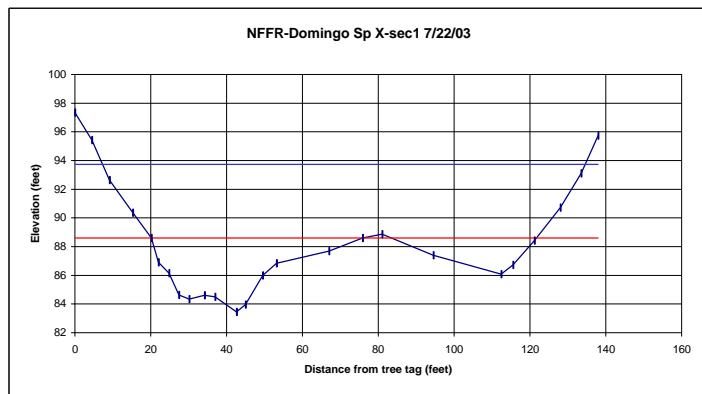


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x bankfull elevation	Notes
0	2.66		97.34	88.6	93.74	tbml
4.5	4.58		95.42	88.6	93.74	
9.1	7.36		92.64	88.6	93.74	
15.3	9.64		90.36	88.6	93.74	
20.2	11.4	0	88.6	88.6	93.74	bfl
22	13.09	1.69	86.91	88.6	93.74	wel
24.8	13.86	2.46	86.14	88.6	93.74	
27.4	15.36	3.96	84.64	88.6	93.74	
30.1	15.65	4.25	84.35	88.6	93.74	
34.2	15.39	3.99	84.61	88.6	93.74	
37	15.51	4.11	84.49	88.6	93.74	
42.6	16.54	5.14	83.46	88.6	93.74	t
45	16.03	4.63	83.97	88.6	93.74	
49.5	14.01	2.61	85.99	88.6	93.74	
53.2	13.17	1.77	86.83	88.6	93.74	wer
67	12.31	0.91	87.69	88.6	93.74	
75.9	11.4	0	88.6	88.6	93.74	bfr
81	11.14		88.86	88.6	93.74	
94.5	12.61		87.39	88.6	93.74	
112.4	13.91		86.09	88.6	93.74	
115.5	13.28		86.72	88.6	93.74	
121.2	11.58		88.42	88.6	93.74	
128	9.28		90.72	88.6	93.74	
133.5	6.9		93.1	88.6	93.74	
138	4.27		95.73	88.6	93.74	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg
 all measurements in feet

Three Year SUMMARY							
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Width: Depth Ratio	Flood-prone width	Entrenchment Ratio
1999	1	35.70	2.57	4.06	13.87	117.09	3.28
2001	1	38.60	2.62	4.19	14.73	116.80	3.03
2003	1	55.70	2.96	5.14	18.82	126.30	2.27


UTM X-coord = 639621
 UTM Y-coord = 4468182

North Fork Feather River abv Lake Almanor X-sec 2

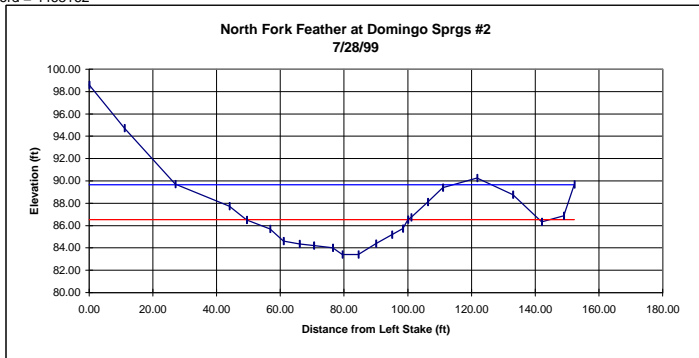


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	98.59	86.525	89.65
11.00	94.72	86.525	89.65
27.00	89.70	86.525	89.65
44.00	87.74	86.525	89.65
49.40	86.51	86.525	89.65
56.80	85.69	86.525	89.65
61.00	84.62	86.525	89.65
66.00	84.35	86.525	89.65
70.50	84.20	86.525	89.65
76.40	84.01	86.525	89.65
79.50	83.40	86.525	89.65
84.50	83.42	86.525	89.65
90.00	84.38	86.525	89.65
95.00	85.20	86.525	89.65
98.40	85.72	86.525	89.65
100.00	86.54	86.525	89.65
101.00	86.74	86.525	89.65
106.30	88.10	86.525	89.65
111.00	89.39	86.53	89.65
121.70	90.25	86.525	89.65
133.00	88.78	86.525	89.65
142.00	86.32	86.525	89.65
149.00	86.88	86.525	89.65
152.30	89.68	86.525	89.65

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

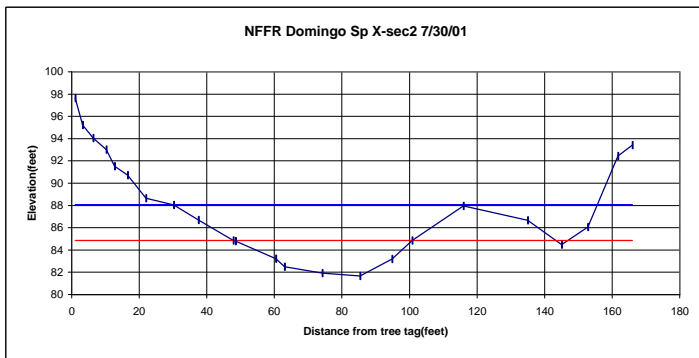

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
1	2.36	97.64	84.87	88.08	TBM-LB
3.2	4.78	95.22	84.87	88.08	
6.3	5.95	94.05	84.87	88.08	
10.2	6.97	93.03	84.87	88.08	
12.7	8.49	91.51	84.87	88.08	
16.6	9.28	90.72	84.87	88.08	
22	11.36	88.64	84.87	88.08	
30.2	11.94	88.06	84.87	88.08	
37.5	13.31	86.69	84.87	88.08	
47.8	15.13	84.87	84.87	88.08	BFL
48.5	15.2	84.8	84.87	88.08	
60.4	16.78	83.22	84.87	88.08	LEW
63	17.51	82.49	84.87	88.08	
74.2	18.07	81.93	84.87	88.08	
85.4	18.34	81.66	84.87	88.08	T
94.8	16.8	83.2	84.87	88.08	REW
100.8	15.13	84.87	84.87	88.08	BFR
116	12.03	87.97	84.87	88.08	
135	13.33	86.67	84.87	88.08	
145	15.52	84.48	84.87	88.08	
152.8	13.94	86.06	84.87	88.08	
161.7	7.55	92.45	84.87	88.08	
166	6.58	93.42	84.87	88.08	End

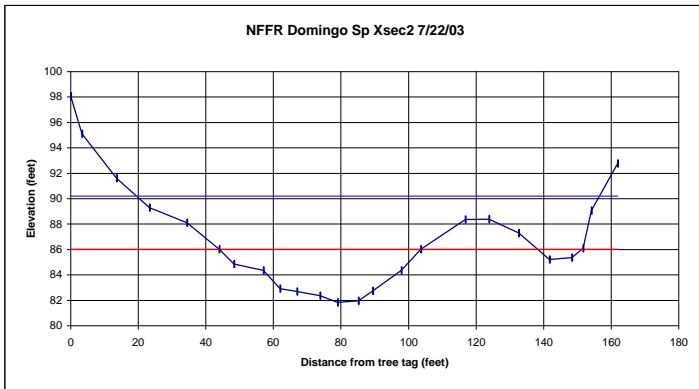


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x bankfull elevation	Notes
0	1.93		98.07	86.01	90.19	tbml
3.3	4.88		95.12	86.01	90.19	
13.5	8.4		91.6	86.01	90.19	
23.3	10.71		89.29	86.01	90.19	
34.4	11.9		88.1	86.01	90.19	
44	13.99	0	86.01	86.01	90.19	bfl
48.3	15.15	1.16	84.85	86.01	90.19	
57	15.65	1.66	84.35	86.01	90.19	wel
62	17.09	3.1	82.91	86.01	90.19	
67	17.3	3.31	82.7	86.01	90.19	
73.8	17.62	3.63	82.38	86.01	90.19	
79	18.17	4.18	81.83	86.01	90.19	t
85.2	18.04	4.05	81.96	86.01	90.19	
89.4	17.25	3.26	82.75	86.01	90.19	
97.9	15.64	1.65	84.36	86.01	90.19	wer
103.6	13.99	0	86.01	86.01	90.19	bfr
116.8	11.64		88.36	86.01	90.19	
123.8	11.61		88.39	86.01	90.19	
132.6	12.7		87.3	86.01	90.19	
141.7	14.78		85.22	86.01	90.19	
148.4	14.63		85.37	86.01	90.19	
151.7	13.91		86.09	86.01	90.19	
154.1	10.92		89.08	86.01	90.19	
161.9	7.24		92.76	86.01	90.19	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg
 all measurements in feet

Three Year SUMMARY							
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Width: Depth Ratio	Flood-prone width	Entrenchment Ratio
1999	2	50.60	2.01	3.11	25.20	124.83	2.47
2001	2	53.00	1.70	3.21	31.17	122.40	2.30
2003	2	59.60	2.60	4.18	22.92	134.60	2.26


UTM X-coord = 639513
 UTM Y-coord = 4468159

North Fork Feather River abv Lake Almanor X-sec 3

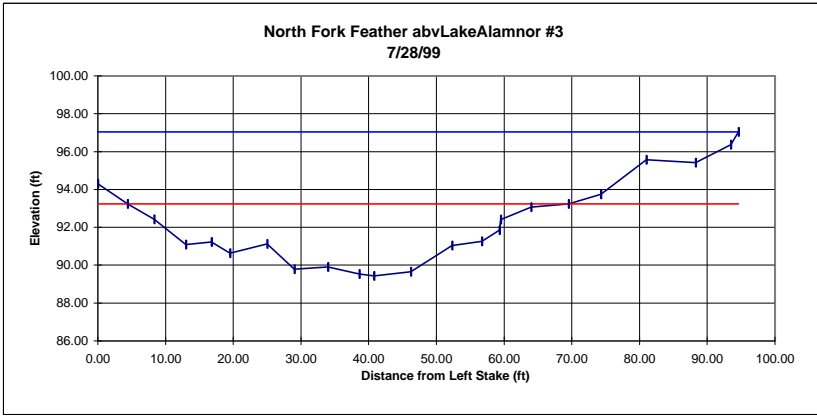


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	94.30	93.24	97.04
4.40	93.24	93.24	97.04
8.30	92.42	93.24	97.04
13.00	91.09	93.24	97.04
16.80	91.22	93.24	97.04
19.50	90.63	93.24	97.04
25.00	91.12	93.24	97.04
29.00	89.78	93.24	97.04
34.00	89.90	93.24	97.04
38.60	89.54	93.24	97.04
40.80	89.44	93.24	97.04
46.20	89.66	93.24	97.04
52.30	91.04	93.24	97.04
56.70	91.26	93.24	97.04
59.30	91.85	93.24	97.04
59.50	92.40	93.24	97.04
64.00	93.07	93.24	97.04
69.50	93.24	93.24	97.04
74.30	93.75	93.24	97.04
81.00	95.57	93.24	97.04
88.30	95.41	93.24	97.04
93.50	96.36	93.24	97.04
94.60	97.04	93.24	97.04

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

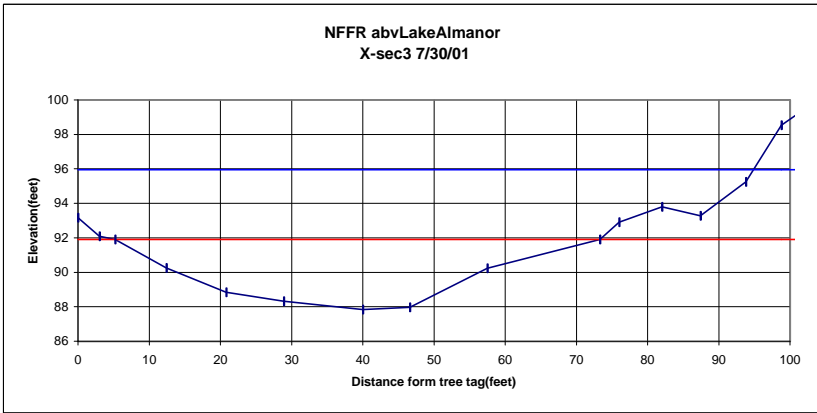

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	6.83	93.17	91.9	95.96	TBM-LB
3	7.91	92.09	91.9	95.96	
5.2	8.1	91.9	91.9	95.96	BFL
12.4	9.75	90.25	91.9	95.96	LEW
20.8	11.15	88.85	91.9	95.96	
28.9	11.67	88.33	91.9	95.96	
40	12.16	87.84	91.9	95.96	T
46.6	12.03	87.97	91.9	95.96	
57.5	9.77	90.23	91.9	95.96	REW
73.3	8.1	91.9	91.9	95.96	BFR
76	7.1	92.9	91.9	95.96	
82	6.2	93.8	91.9	95.96	
87.4	6.72	93.28	91.9	95.96	
93.8	4.75	95.25	91.9	95.96	
98.8	1.46	98.54	91.9	95.96	
101	0.84	99.16	91.9	95.96	

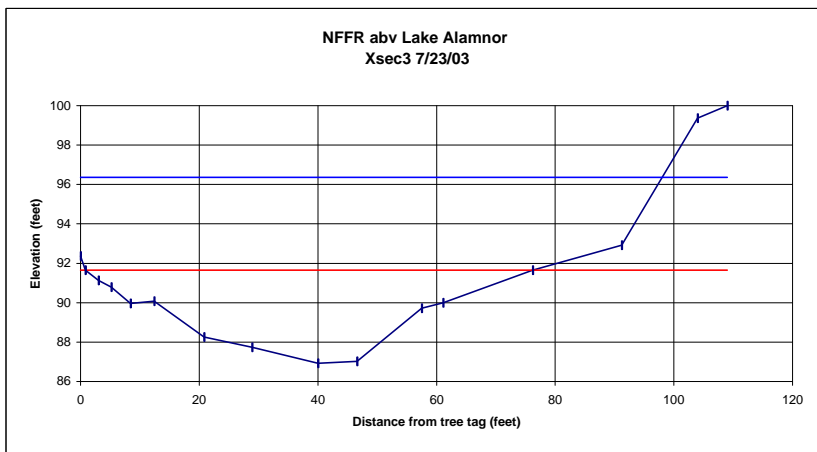


Dist from left stake	Total Depth	Bankfull depth	Total elevation	bankfull elevation	2x bankfull elevation	Notes
0	7.64		92.36	91.65	96.37	tbrml
0.8	8.35	0	91.65	91.65	96.37	bfl
3	8.86	0.51	91.14	91.65	96.37	
5.2	9.21	0.86	90.79	91.65	96.37	
8.4	10.04	1.69	89.96	91.65	96.37	wel
12.4	9.92	1.57	90.08	91.65	96.37	
20.8	11.75	3.4	88.25	91.65	96.37	
28.9	12.26	3.91	87.74	91.65	96.37	
40	13.07	4.72	86.93	91.65	96.37	t
46.6	12.97	4.62	87.03	91.65	96.37	
57.5	10.28	1.93	89.72	91.65	96.37	
61.1	10	1.65	90	91.65	96.37	wer
76.2	8.35	0	91.65	91.65	96.37	bfr
91.2	7.08		92.92	91.65	96.37	
104	0.63		99.37	91.65	96.37	
109	0		100	91.65	96.37	end

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg
 all measurements in feet


Three Year SUMMARY							
Year	Cross-section	Bankfull Width	Bankfull Depth	Max Bankfull Depth	Width: Depth Ratio	Flood-prone width	Entrenchment Ratio
1999	3	65.10	2.28	3.80	28.57	94.60	1.45
2001	3	68.10	2.56	4.06	26.60	105.00	1.54
2003	3	75.40	2.26	4.72	33.36	112.30	1.49

All measurement in feet

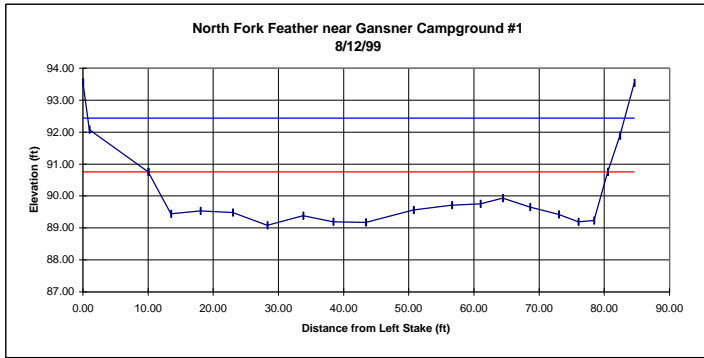


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	93.56	90.76	92.44
1.00	92.08	90.76	92.44
10.00	90.76	90.76	92.44
10.00	90.76	90.76	92.44
13.50	89.44	90.76	92.44
18.00	89.53	90.76	92.44
23.00	89.48	90.76	92.44
28.30	89.08	90.76	92.44
33.80	89.38	90.76	92.44
38.40	89.19	90.76	92.44
43.40	89.17	90.76	92.44
50.70	89.56	90.76	92.44
56.60	89.71	90.76	92.44
61.00	89.75	90.76	92.44
64.40	89.93	90.76	92.44
68.60	89.65	90.76	92.44
73.00	89.42	90.76	92.44
76.00	89.19	90.76	92.44
78.40	89.23	90.76	92.44
80.50	90.76	90.76	92.44
80.50	90.76	90.76	92.44
82.40	91.89	90.76	92.44
84.60	93.54	90.76	92.44

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

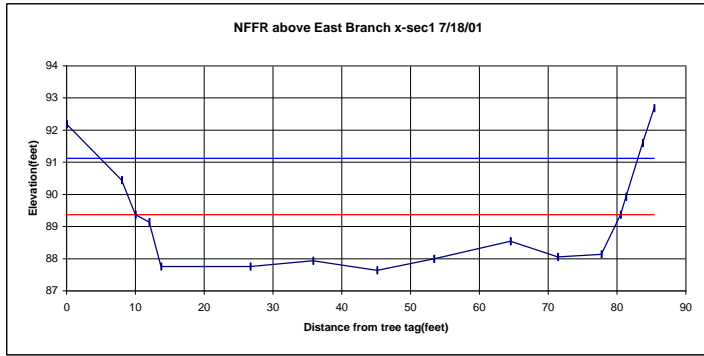

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	7.81	92.19	89.37	91.12	TBM-LB
8	9.55	90.45	89.37	91.12	
10	10.63	89.37	89.37	91.12	BFL/LEW
12	10.86	89.14	89.37	91.12	
13.7	12.24	87.76	89.37	91.12	
26.7	12.24	87.76	89.37	91.12	
35.8	12.06	87.94	89.37	91.12	
45.1	12.36	87.64	89.37	91.12	T
53.4	12	88	89.37	91.12	
64.5	11.46	88.54	89.37	91.12	
71.4	11.94	88.06	89.37	91.12	
77.7	11.86	88.14	89.37	91.12	
80.5	10.63	89.37	89.37	91.12	BFR/REW
81.3	10.07	89.93	89.37	91.12	
83.7	8.4	91.6	89.37	91.12	
85.4	7.31	92.69	89.37	91.12	TBM-RB

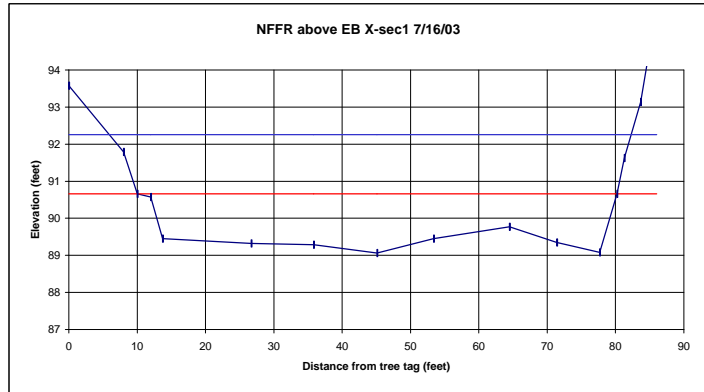


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	6.42		93.58	90.66	92.26	tbrml
8	8.21		91.79	90.66	92.26	toBl
10	9.34	0	90.66	90.66	92.26	bfl,wel
12	9.43	0.09	90.57	90.66	92.26	
13.7	10.55	1.21	89.45	90.66	92.26	
26.7	10.68	1.34	89.32	90.66	92.26	
35.8	10.71	1.37	89.29	90.66	92.26	
45.1	10.94	1.6	89.06	90.66	92.26	t
53.4	10.55	1.21	89.45	90.66	92.26	
64.5	10.23	0.89	89.77	90.66	92.26	
71.4	10.65	1.31	89.35	90.66	92.26	
77.7	10.92	1.58	89.08	90.66	92.26	
80.2	9.34	0	90.66	90.66	92.26	bfr,wel
81.3	8.37		91.63	90.66	92.26	
83.7	6.86		93.14	90.66	92.26	
86	4.29		95.71	90.66	92.26	toBr,endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thatweg


Three Year SUMMARY							
Year	Cross-section	Bankfull Width	Bankfull Depth	Max Bankfull Depth	Width: Depth Ratio	Flood-prone width	Entrenchment Ratio
1999	1	70.50	1.16	1.68	60.87	82.38	1.17
2001	1	70.50	1.13	1.73	62.38	82.97	1.17
2003	1	70.20	1.06	1.60	66.23	93.50	1.33

all measurements in feet

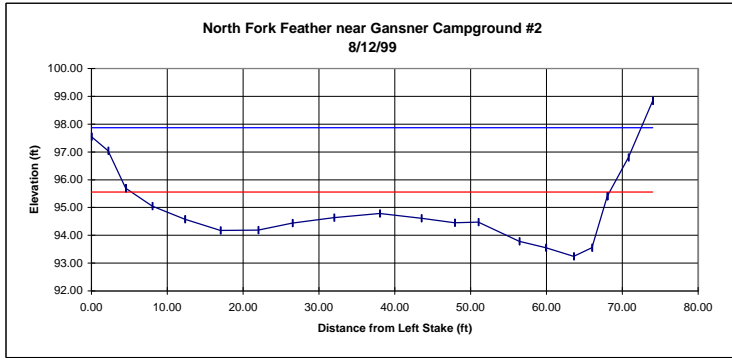


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	97.55	95.555	97.87
2.20	97.04	95.555	97.87
4.50	95.70	95.555	97.87
4.50	95.70	95.555	97.87
8.00	95.05	95.555	97.87
12.30	94.58	95.555	97.87
17.00	94.18	95.555	97.87
22.00	94.19	95.555	97.87
26.50	94.44	95.555	97.87
32.00	94.64	95.555	97.87
38.00	94.78	95.555	97.87
43.50	94.61	95.555	97.87
47.90	94.45	95.555	97.87
51.00	94.47	95.555	97.87
56.40	93.78	95.555	97.87
59.90	93.55	95.555	97.87
63.60	93.24	95.555	97.87
66.00	93.55	95.555	97.87
68.00	95.41	95.555	97.87
68.00	95.41	95.555	97.87
70.80	96.80	95.555	97.87
74.00	98.84	95.555	97.87

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

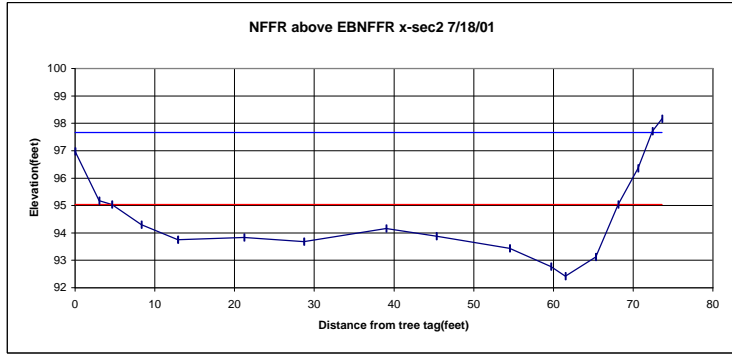

Dist from Left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	3.02	96.98	95.04	97.66	TBM-LB
3	4.82	95.18	95.04	97.66	
4.6	4.96	95.04	95.04	97.66	BFL/LEW
8.3	5.7	94.3	95.04	97.66	
12.9	6.25	93.75	95.04	97.66	
21.2	6.17	93.83	95.04	97.66	
28.7	6.32	93.68	95.04	97.66	
39	5.84	94.16	95.04	97.66	
45.3	6.12	93.88	95.04	97.66	
54.5	6.56	93.44	95.04	97.66	
59.7	7.23	92.77	95.04	97.66	
61.5	7.58	92.42	95.04	97.66	T
65.3	6.88	93.12	95.04	97.66	
68.1	4.96	95.04	95.04	97.66	BFR/REW
70.6	3.64	96.36	95.04	97.66	
72.4	2.29	97.71	95.04	97.66	
73.6	1.83	98.17	95.04	97.66	TBM-RB

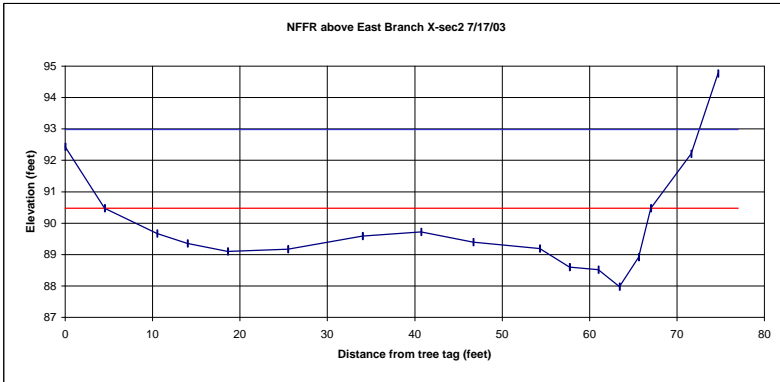


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	7.57		92.43	90.48	92.98	tbl
4.5	9.52	0	90.48	90.48	92.98	bfl,wel
10.5	10.33	0.81	89.67	90.48	92.98	
14	10.65	1.13	89.35	90.48	92.98	
18.6	10.9	1.38	89.1	90.48	92.98	
25.5	10.83	1.31	89.17	90.48	92.98	
34	10.41	0.89	89.59	90.48	92.98	
40.7	10.28	0.76	89.72	90.48	92.98	
46.7	10.61	1.09	89.39	90.48	92.98	
54.3	10.81	1.29	89.19	90.48	92.98	
57.7	11.4	1.88	88.6	90.48	92.98	
61	11.48	1.96	88.52	90.48	92.98	
63.4	12.02	2.5	87.98	90.48	92.98	t
65.6	11.08	1.56	88.92	90.48	92.98	
67	9.52	0	90.48	90.48	92.98	bfr,wel
71.6	7.79		92.21	90.48	92.98	
74.7	5.23		94.77	90.48	92.98	
77	3.19		96.81	90.48	92.98	to br, endr

TOP=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg


Three Year SUMMARY							
Year	Cross-section	Bankfull Width	Mean Bankfull Depth	Max Bankfull Depth	Width: Depth Ratio	Flood-prone width	Entrenchment Ratio
1999	2	63.50	1.30	2.46	48.68	72.48	1.14
2001	2	63.50	1.36	2.62	46.69	76.40	1.20
2003	2	62.50	1.27	2.50	49.06	76.50	1.22

all measurements in feet

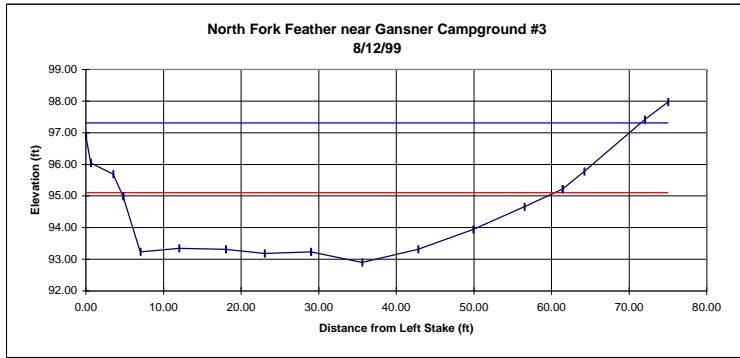


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	96.90	95.105	97.31
0.60	96.05	95.105	97.31
3.50	95.69	95.105	97.31
4.80	94.99	95.105	97.31
4.80	94.99	95.105	97.31
7.00	93.23	95.105	97.31
12.00	93.35	95.105	97.31
18.00	93.31	95.105	97.31
23.00	93.18	95.105	97.31
29.00	93.23	95.105	97.31
35.60	92.90	95.105	97.31
42.80	93.32	95.105	97.31
49.90	93.94	95.105	97.31
56.50	94.66	95.105	97.31
61.40	95.22	95.105	97.31
61.40	95.22	95.105	97.31
64.20	95.77	95.105	97.31
72.00	97.41	95.105	97.31
75.00	97.97	95.11	97.31

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

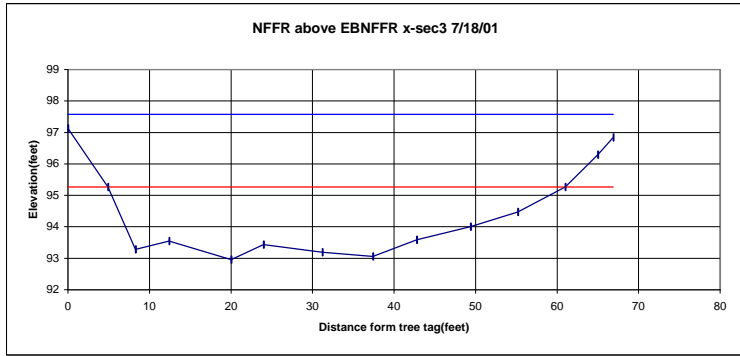

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	2.87	97.13	95.27	97.58	TBM-LB
4.9	4.73	95.27	95.27	97.58	BFL/LEW
8.3	6.72	93.28	95.27	97.58	
12.4	6.45	93.55	95.27	97.58	
20	7.04	92.96	95.27	97.58	T
24	6.57	93.43	95.27	97.58	
31.2	6.81	93.19	95.27	97.58	
37.4	6.94	93.06	95.27	97.58	
42.8	6.41	93.59	95.27	97.58	
49.4	6	94	95.27	97.58	
55.2	5.53	94.47	95.27	97.58	
61	4.73	95.27	95.27	97.58	BFR/REW
65	3.71	96.29	95.27	97.58	
66.9	3.16	96.84	95.27	97.58	TBM-RB

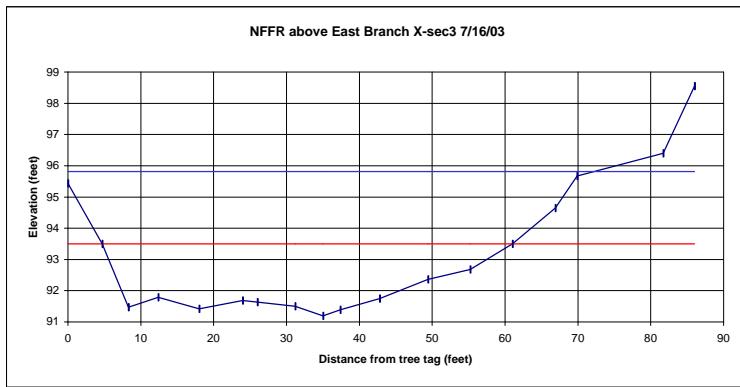

Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	4.56		95.44	93.5	95.81	ttml
4.7	6.5	0	93.5	93.5	95.81	bfl,wel
8.3	8.53	2.03	91.47	93.5	95.81	
12.4	8.21	1.71	91.79	93.5	95.81	
18	8.58	2.08	91.42	93.5	95.81	
24	8.31	1.81	91.69	93.5	95.81	
26	8.36	1.86	91.64	93.5	95.81	
31.2	8.5	2	91.5	93.5	95.81	
35	8.81	2.31	91.19	93.5	95.81	t
37.4	8.61	2.11	91.39	93.5	95.81	
42.8	8.25	1.75	91.75	93.5	95.81	
49.4	7.64	1.14	92.36	93.5	95.81	
55.2	7.32	0.82	92.68	93.5	95.81	
61	6.5	0	93.5	93.5	95.81	bfr,wer
66.9	5.35		94.65	93.5	95.81	
69.9	4.33		95.67	93.5	95.81	
81.7	3.6		96.4	93.5	95.81	
86	1.45		98.55	93.5	95.81	

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Three Year SUMMARY							
Year	Cross-section	Bankfull Width	Mean Bankfull Depth	Max Bankfull Depth	Width: Depth Ratio	Flood-prone width	Entrenchment Ratio
1999	3	56.60	1.21	2.09	46.71	71.52	1.26
2001	3	56.10	1.60	2.31	35.06	81.05	1.44
2003	3	56.30	1.64	2.31	34.43	83.00	1.47


UTM X-coord = 708793
 UTM Y-coord = 4438877

Last Chance Cr below Murdock X-ing x-sec 1




Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	96.45	88.52	91.23
18.90	95.60	88.52	91.23
21.30	90.60	88.52	91.23
45.00	89.43	88.52	91.23
47.00	88.52	88.52	91.23
47.50	87.70	88.52	91.23
48.00	86.45	88.52	91.23
53.00	85.81	88.52	91.23
59.00	86.33	88.52	91.23
66.00	87.57	88.52	91.23
72.50	88.52	88.52	91.23
102.30	89.78	88.52	91.23
107.50	90.82	88.52	91.23
111.00	92.78	88.52	91.23
140.30	95.52	88.52	91.23
224.00	95.25	88.52	91.23

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

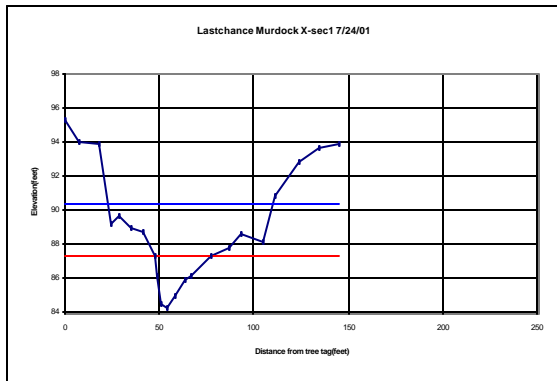

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	4.67	95.33	87.32	90.39	TBM-LB
7	5.98	94.02	87.32	90.39	
18	6.07	93.93	87.32	90.39	TOBL
24	10.77	89.23	87.32	90.39	
28.8	10.37	89.63	87.32	90.39	
34.5	11.11	88.89	87.32	90.39	
41	11.32	88.68	87.32	90.39	
47.6	12.68	87.32	87.32	90.39	BFL
48.9	13.89	86.11	87.32	90.39	LEW
50.8	15.49	84.51	87.32	90.39	
54.4	15.75	84.25	87.32	90.39	T
58.4	15.01	84.99	87.32	90.39	
64	14.12	85.88	87.32	90.39	
66.6	13.86	86.14	87.32	90.39	REW
77.7	12.68	87.32	87.32	90.39	BFR
86.4	12.25	87.75	87.32	90.39	
92.7	11.42	88.58	87.32	90.39	
104.5	11.84	88.16	87.32	90.39	
110.7	9.16	90.84	87.32	90.39	
123.7	7.22	92.78	87.32	90.39	
134.1	6.34	93.66	87.32	90.39	
145.6	6.15	93.85	87.32	90.39	TBM-RB

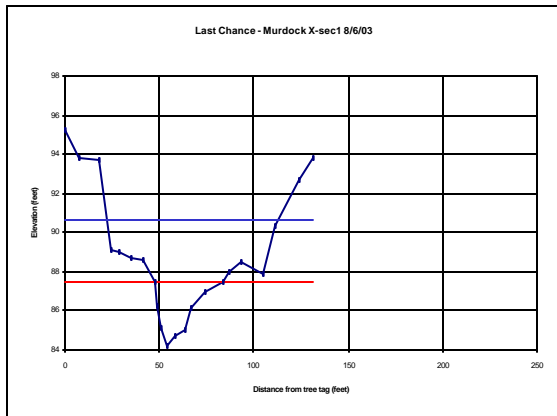


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	Bankfull elevation	Notes
0	4.76		95.24	87.44	90.67	tbrl
7	6.16		93.84	87.44	90.67	
18	6.26		93.74	87.44	90.67	tobl
24	10.9		89.1	87.44	90.67	
28.8	10.96		89.04	87.44	90.67	
34.5	11.29		88.71	87.44	90.67	
41	11.44		88.56	87.44	90.67	
47.6	12.56	0	87.44	87.44	90.67	bfl
49	13.79	1.23	86.21	87.44	90.67	wel
50.4	14.85	2.29	85.15	87.44	90.67	
54	15.79	3.23	84.21	87.44	90.67	t
58.4	15.26	2.7	84.74	87.44	90.67	
64	14.93	2.37	85.07	87.44	90.67	
66.8	13.87	1.31	86.13	87.44	90.67	wer
73.8	13.02	0.46	86.98	87.44	90.67	
84	12.56	0	87.44	87.44	90.67	bfr
86.4	12.02		87.98	87.44	90.67	
92.7	11.49		88.51	87.44	90.67	
104.5	12.13		87.87	87.44	90.67	
110.7	9.63		90.37	87.44	90.67	tobr
123.7	7.35		92.65	87.44	90.67	
131	6.24		93.76	87.44	90.67	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Three Year SUMMARY						
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Flood-prone width Ratio	Entrenchment Ratio
1999	1	25.50	1.75	2.71	14.59	3.42
2001	1	30.10	1.72	3.07	17.50	2.89
2003	1	36.40	1.70	3.23	21.42	2.47


UTM X-coord = 70890
 UTM Y-coord = 4428145

Last Chance Cr below Murdock X-ing x-sec 2

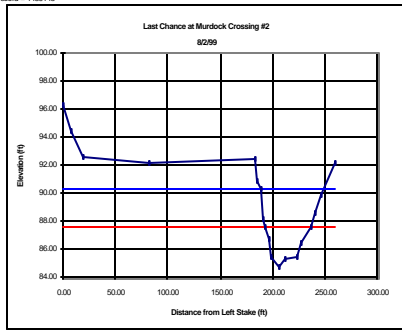


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2x Bankfull Elevation
0.00	96.25	87.52	90.34
7.70	94.41	87.52	90.34
18.30	92.55	87.52	90.34
62.00	92.20	87.52	90.34
84.00	92.49	87.52	90.34
184.00	90.89	87.52	90.34
188.50	90.30	87.52	90.34
190.50	88.15	87.52	90.34
193.00	87.52	87.52	90.34
193.00	87.52	87.52	90.34
197.00	86.70	87.52	90.34
199.40	85.49	87.52	90.34
205.50	84.70	87.52	90.34
212.70	85.24	87.52	90.34
222.90	85.43	87.52	90.34
227.20	86.38	87.52	90.34
236.50	87.52	87.52	90.34
241.30	88.61	87.52	90.34
247.30	89.86	87.52	90.34
258.40	92.08	87.52	90.34

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

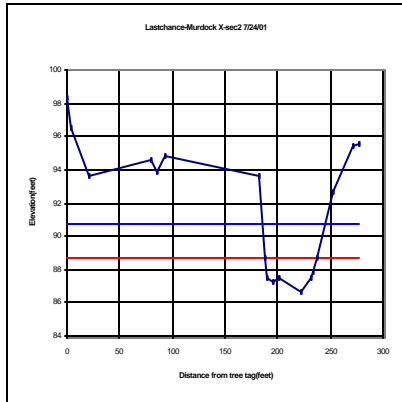

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2X Bankfull Elevation	Notes
0	1.74	88.26	88.69	80.74 TBM-LB
3.2	3.62	96.48	88.69	80.74
21.7	6.34	93.96	88.69	80.74
80.6	5.43	94.57	88.69	80.74
86.2	6.13	93.87	88.69	80.74
93	5.23	94.77	88.69	80.74
102.5	6.4	93.6	88.69	80.74 TOBL
188	11.31	88.69	88.69	80.74 BFL
189.6	12.62	87.48	88.69	80.74 LEW
195.7	12.81	87.19	88.69	80.74
200.7	12.57	87.43	88.69	80.74
222	13.38	86.84	88.69	80.74 T
231.6	12.55	87.45	88.69	80.74 REW
233.7	12.12	87.88	88.69	80.74
236.4	11.31	88.69	88.69	80.74 BFR
252.6	7.32	92.08	88.69	80.74 TOBR
271.1	4.55	95.45	88.69	80.74
276.9	4.42	95.58	88.69	80.74 TBM-RB

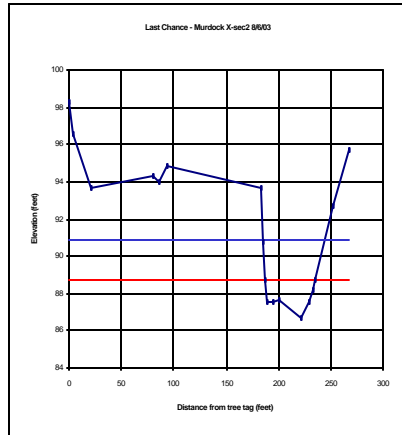


Dist from Left Stake	Total Elevation	Bankfull Elevation	2x Bankfull Elevation	Notes
0	1.74	88.26	88.77	80.84
3.2	3.44	96.56	88.77	80.84
21.7	6.33	93.87	88.77	80.84
80.6	5.64	94.36	88.77	80.84
86.2	6.05	93.85	88.77	80.84
93	5.2	94.8	88.77	80.84
102.5	6.35	93.65	88.77	80.84
194.5	9.19	90.61	88.77	80.84
197.7	11.23	0	88.77	80.84 bf
198.3	12.46	1.23	87.54	88.77 80.84 wet
195.7	12.5	1.27	87.5	88.77 80.84
200.7	12.37	1.14	87.63	88.77 80.84
222	13.3	2.07	86.7	88.77 80.84 t
229.8	12.45	1.22	87.55	88.77 80.84 wer
233.7	11.78	0.55	88.22	88.77 80.84
235.9	11.23	0	88.77	88.77 80.84 bf
252.6	7.25	92.75	88.77	80.84
267.6	4.28	95.72	88.77	80.84 endrabr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment tenser
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg
 all measurements in feet

Three Year SUMMAR1		Mean	Max	Width:	Flood-Entrenchment
Year	sector	Cross-Width	Bankfull Depth	Bankfull Ratio	prone width Ratio
1999	2	43.50	1.86	2.82	23.35 61.62 1.42
2001	2	48.40	1.15	2.05	42.08 58.00 1.19
2003	2	48.20	1.07	2.07	45.11 58.70 1.22


UTM X-coord = 70954
 UTM Y-coord = 4439348

Last Chance Cr below Murdock X-ing xsec 3

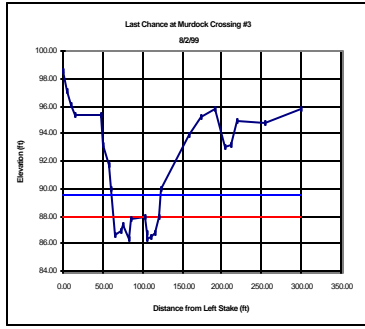


Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2x Bankfull Elevation
0.00	98.58	87.9	88.47
4.00	97.15	87.9	88.47
8.00	96.09	87.9	88.47
16.00	95.28	87.9	88.47
47.00	95.28	87.9	88.47
51.00	93.15	87.9	88.47
57.50	91.72	87.9	88.47
59.30	89.96	87.9	88.47
66.40	86.06	87.9	88.47
73.00	86.97	87.9	88.47
74.50	87.38	87.9	88.47
82.80	86.33	87.9	88.47
85.40	87.83	87.9	88.47
102.50	87.90	87.9	88.47
105.00	86.78	87.9	88.47
105.01	86.35	87.9	88.47
110.00	86.50	87.9	88.47
115.40	86.72	87.9	88.47
121.60	87.90	87.90	88.47
123.00	89.95	87.9	88.47
150.00	93.84	87.9	88.47
173.00	95.23	87.9	88.47
190.00	95.78	87.9	88.47
204.00	93.03	87.9	88.47
212.50	93.23	87.9	88.47
220.00	94.88	87.9	88.47
254.00	94.73	87.9	88.47
300.00	95.92	87.9	88.47

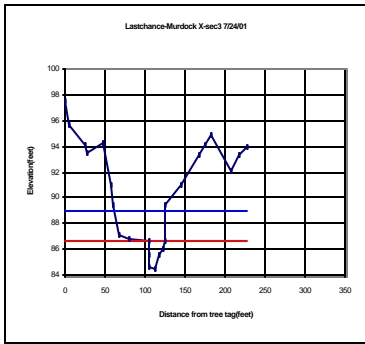

LastChance-Murdock 72401

Dist. From left stake	Total Elevation	Bankfull Elevation	2x Bankfull Elevation	Notes
0	2.45	97.55	80.7	88.93
6	4.41	95.59	80.7	88.93
24.4	5.85	94.15	80.7	88.93
27.5	6.5	93.5	80.7	88.93
48	5.8	94.2	80.7	88.93 TOBL
58.1	9.02	93.98	80.7	88.93
59.9	10.52	89.48	80.7	88.93
66.4	12.83	87.17	80.7	88.93
79	13.18	86.82	80.7	88.93
103.8	13.3	86.7	80.7	88.93 BFL
105	14.46	85.54	80.7	88.93 LEW
108	15.31	84.69	80.7	88.93
112.3	15.53	84.47	80.7	88.93 T
118	14.52	85.48	80.7	88.93 REW
121.5	13.82	86.08	80.7	88.93
124	13.3	86.7	80.7	88.93 BFR
128	10.59	89.41	80.7	88.93 TOBL
144.5	8.95	91.05	80.7	88.93
168	6.75	93.25	80.7	88.93
174	5.9	94.1	80.7	88.93
183.5	5.07	94.93	80.7	88.93
207.3	7.94	92.06	80.7	88.93
218.7	6.69	93.31	80.7	88.93
226.5	6.11	93.89	80.7	88.93

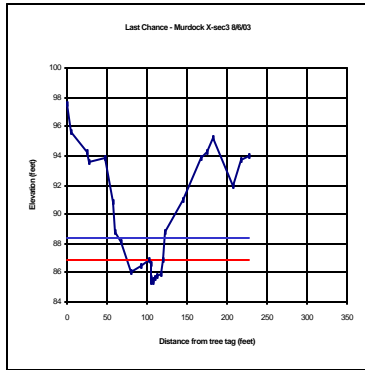

8603 last chance cross-section-3

Dist from left stake	Depth	Bankfull elevation	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	2.4	97.6	80.84	80.84	88.35	stn1
5	4.39	95.61	80.84	80.84	88.35	
24.4	5.72	94.28	80.84	80.84	88.35	
27.5	6.4	93.6	80.84	80.84	88.35	
48	6.18	93.92	80.84	80.84	88.35	tbl
57.3	9.2	90.8	80.84	80.84	88.35	
59.9	11.22	88.78	80.84	80.84	88.35	
66.4	11.83	88.17	80.84	80.84	88.35	
79	14.01	85.99	80.84	80.84	88.35	
83.3	13.59	86.41	80.84	80.84	88.35	
101.9	13.16	0	80.84	80.84	88.35	bfl
103.9	13.34	0.18	80.84	80.84	88.35	
104.6	14.33	1.17	80.67	80.84	88.35	wel
105.3	14.62	1.46	80.38	80.84	88.35	t
107	14.67	1.51	80.33	80.84	88.35	
108.6	14.55	1.39	80.45	80.84	88.35	
109.9	14.38	1.22	80.62	80.84	88.35	
111.7	14.29	1.13	80.71	80.84	88.35	war
117.1	14.07	0.91	80.93	80.84	88.35	
120.2	13.16	0	80.84	80.84	88.35	br
123.1	11.25	88.75	80.84	80.84	88.35	tblr
145.5	9.09	90.91	80.84	80.84	88.35	
168	6.15	93.85	80.84	80.84	88.35	
174	5.7	94.3	80.84	80.84	88.35	
183.5	4.86	95.15	80.84	80.84	88.35	
207.3	8.12	91.88	80.84	80.84	88.35	
218.3	6.31	93.69	80.84	80.84	88.35	
226.5	6	94	80.84	80.84	88.35	endr

TOPipe=Top of pipe/bench mark

LEW=Left edge of water

REW=Right edge of water

MPD=Maximum pool depth

TBM=Temporary bench mark

PCT=Pool tail crest

TP=Turning point

TOPool=Top of pool

S-MAX=Max depth sediment lens

LB=Left bank

RB=Right bank


TOB=Top of bank

BF=Bankfull

T=Thweg

Three Year SUMMAR1		Mean	Max	Width: Flood-Entren			
Year	section	Cross- Bankfu	Bankful	Bankful	Depth	prone	ment
1999	3	19.10	1.31	1.55	14.55	62.32	3.26
2001	3	20.20	1.20	2.23	16.83	65.30	3.23
2003	3	18.30	1.00	1.51	18.36	60.20	3.29

Red Clover Cr Below Chase Bridge X-sec 1

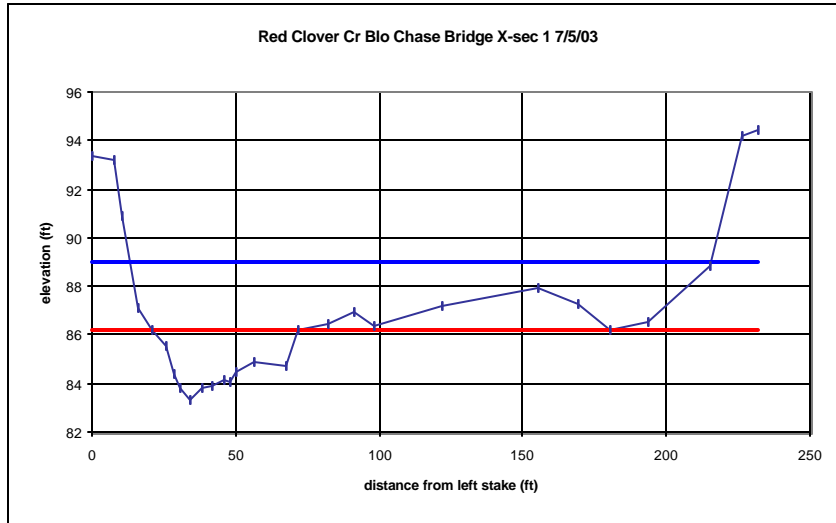


7/5/03 red clover below chase crosection-1

Dist from Total left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x bankfull elevation	Notes
0	6.67		93.33	86.17	89.03	tbml
8	6.77		93.23	86.17	89.03	toBl
10.3	9.12		90.88	86.17	89.03	
16.2	12.88		87.12	86.17	89.03	
20.9	13.83	0	86.17	86.17	89.03	bfl
26	14.43	0.6	85.57	86.17	89.03	
28.7	15.58	1.75	84.42	86.17	89.03	wel
30.8	16.18	2.35	83.82	86.17	89.03	
34	16.69	2.86	83.31	86.17	89.03	t
38	16.19	2.36	83.81	86.17	89.03	
42.1	16.09	2.26	83.91	86.17	89.03	
46.2	15.84	2.01	84.16	86.17	89.03	
47.8	15.91	2.08	84.09	86.17	89.03	
50.4	15.53	1.7	84.47	86.17	89.03	wer
56.5	15.11	1.28	84.89	86.17	89.03	
67.3	15.26	1.43	84.74	86.17	89.03	
71.5	13.83	0	86.17	86.17	89.03	bfr
82.4	13.59		86.41	86.17	89.03	
91.4	13.06		86.94	86.17	89.03	
98	13.6		86.4	86.17	89.03	
122	12.82		87.18	86.17	89.03	
155	12.07		87.93	86.17	89.03	
169.3	12.77		87.23	86.17	89.03	
180.2	13.8		86.2	86.17	89.03	
193.8	13.43		86.57	86.17	89.03	
215	11.15		88.85	86.17	89.03	
226.5	5.78		94.22	86.17	89.03	tobr
231.9	5.55		94.45	86.17	89.03	endr

- BFL=Bankfull Left
- BFR=Bankfull Right
- WE=Waters edge
- T=Thalweg
- TOB=Top of Bank
- TUC=Top of undercut
- Buc=Bottom of undercut
- UCW=Undercutwidth

Two Year SUMMARY		Mean	Max	Width:	Flood-	Entrench-	
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Ratio	ment Ratio	
1995	1	55.1	1.47	2.27	37.5	60.61	1.1
2003	1	50.60	1.72	2.86	29.42	202.30	4.00

Red Clover Cr below Chase Bridge X-sec 2

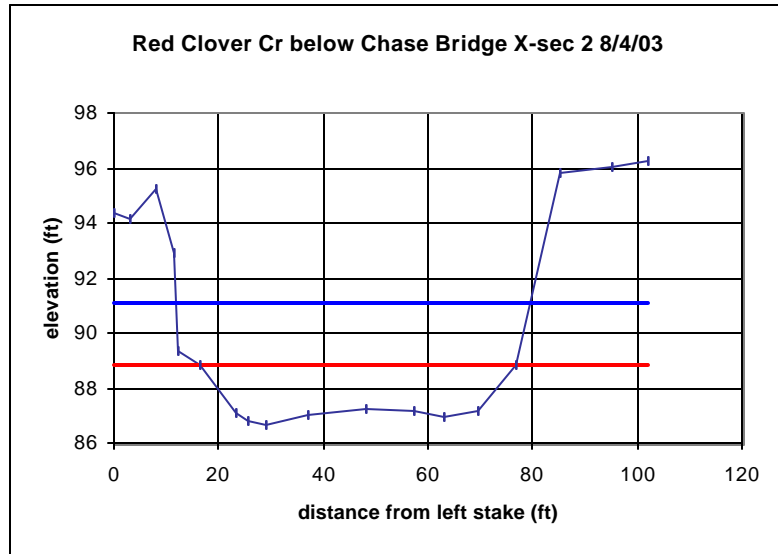


rd clover below chase crosection-2 8/4/03						
Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x bankfull elevation	Notes
0	5.64		94.36	88.84	91.06	tbml
3	5.89		94.11	88.84	91.06	
8	4.8		95.2	88.84	91.06	tobl
11.5	7.07		92.93	88.84	91.06	
12.2	10.64		89.36	88.84	91.06	
16.4	11.16	0	88.84	88.84	91.06	bfl
23.5	12.91	1.75	87.09	88.84	91.06	wel
25.6	13.22	2.06	86.78	88.84	91.06	
29	13.38	2.22	86.62	88.84	91.06	t
37	12.95	1.79	87.05	88.84	91.06	
48	12.76	1.6	87.24	88.84	91.06	
57.5	12.81	1.65	87.19	88.84	91.06	
63	13.07	1.91	86.93	88.84	91.06	
69.7	12.87	1.71	87.13	88.84	91.06	wer
77	11.16	0	88.84	88.84	91.06	bfr
85.4	4.19		95.81	88.84	91.06	tobr
95.3	3.97		96.03	88.84	91.06	
102	3.71		96.29	88.84	91.06	endr

BFL=Bankfull Left
 BFR=Bankfull Right
 WE=Waters edge
 T=Thalweg
 TOB=Top of Bank
 TUC=Top of undercut
 Buc=Bottom of undercut
 UCW=Undercutwidth
 all measurements in feet

Two Year SUMMARY		Mean	Max	Width:	Flood-	Entrench-	
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Ratio	ment Ratio	
1995	2	64.4	1.39	2.48	46	180.32	2.8
2003	2	60.60	1.63	2.22	37.18	65.60	1.08

Red Clover Cr below Chase Bridge X-sec 3

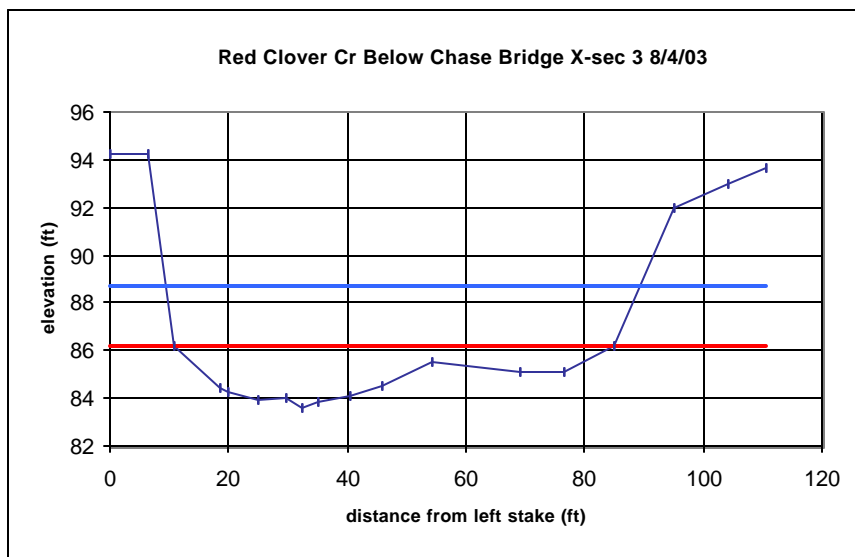

8/4/03 red clover crosection-3


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x bankfull elevation	Notes
0	5.74		94.26	86.16	88.71	tbml
6.5	5.79		94.21	86.16	88.71	tobl
10.9	13.84	0	86.16	86.16	88.71	bfl
18.4	15.59	1.75	84.41	86.16	88.71	wel
20	15.74	1.9	84.26	86.16	88.71	
25	16.08	2.24	83.92	86.16	88.71	
29.5	15.99	2.15	84.01	86.16	88.71	
32.3	16.39	2.55	83.61	86.16	88.71	t
35	16.12	2.28	83.88	86.16	88.71	
40.4	15.91	2.07	84.09	86.16	88.71	
46	15.52	1.68	84.48	86.16	88.71	wer
54.4	14.51	0.67	85.49	86.16	88.71	
69	14.89	1.05	85.11	86.16	88.71	
76.4	14.93	1.09	85.07	86.16	88.71	
85	13.84	0	86.16	86.16	88.71	bfr
95	8		92	86.16	88.71	tobr
104	6.98		93.02	86.16	88.71	
110.4	6.35		93.65	86.16	88.71	endr

BFL=Bankfull Left
 BFR=Bankfull Right
 WE=Waters edge
 T=Thalweg
 TOB=Top of Bank
 TUC=Top of undercut
 Buc=Bottom of undercut
 UCW=Undercutwidth
 all measurements in feet

Two Year SUMMARY			Mean	Max	Width:	Flood-	Entrench-
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Depth Ratio	prone width	ment Ratio
1995	3	36.6	1.4	2.66	26.1	71.00	1.94
2003	3	74.10	1.62	2.55	45.74	79.60	1.07


UTM X-coord = 700048
 UTM Y-coord = 4434962

Red Clover Cr below Drum Bridge X-sec 1

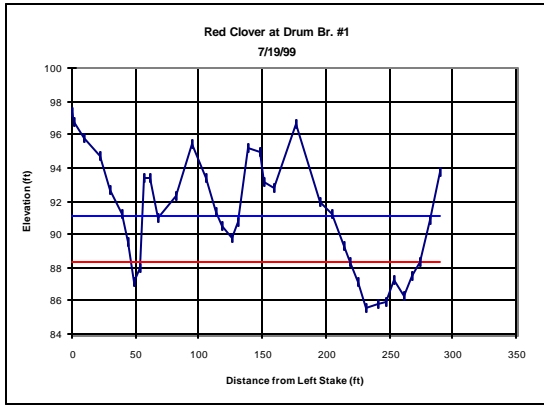

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	97.30	88.37	91.14
1.00	96.78	88.37	91.14
10.00	95.84	88.37	91.14
21.40	94.65	88.37	91.14
29.50	92.65	88.37	91.14
39.50	91.22	88.37	91.14
43.70	89.51	88.37	91.14
48.30	87.16	88.37	91.14
54.00	87.94	88.37	91.14
56.60	93.38	88.37	91.14
60.70	93.37	88.37	91.14
68.00	91.01	88.37	91.14
81.70	92.35	88.37	91.14
95.00	95.40	88.37	91.14
105.70	93.34	88.37	91.14
114.00	91.34	88.37	91.14
118.00	90.48	88.37	91.14
126.00	89.81	88.37	91.14
130.30	90.68	88.37	91.14
139.00	95.20	88.37	91.14
147.70	94.99	88.37	91.14
152.00	93.19	88.37	91.14
158.50	92.77	88.37	91.14
176.00	96.69	88.37	91.14
195.00	91.94	88.37	91.14
205.00	91.16	88.37	91.14
215.00	89.28	88.37	91.14
219.90	88.37	88.37	91.14
225.50	87.12	88.37	91.14
231.70	85.60	88.37	91.14
240.50	85.78	88.37	91.14
247.20	85.91	88.37	91.14
253.70	87.22	88.37	91.14
262.00	86.31	88.37	91.14
268.50	87.48	88.37	91.14
274.70	88.37	88.37	91.14
282	90.86	88.37	91.14
290	93.71	88.37	91.14

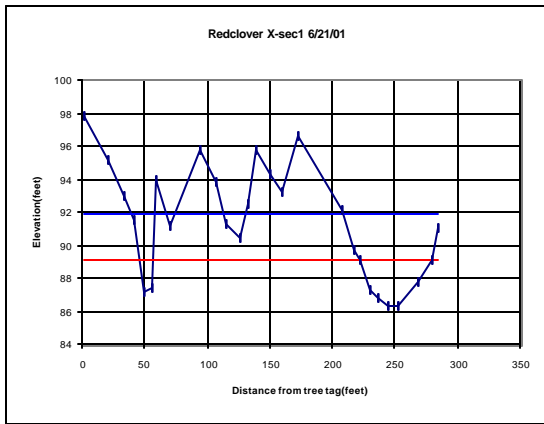


RedClover Dist. From left stake	6/21/01 depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
2	2.21	97.79	89.08	91.85	TBM-LB
21	4.85	95.15	89.08	91.85	
33.55	6.97	93.03	89.08	91.85	
42.3	8.52	91.48	89.08	91.85	
49	12.9	87.1	89.08	91.85	
55.5	12.6	87.4	89.08	91.85	
59.7	6.1	93.9	89.08	91.85	
70	8.8	91.2	89.08	91.85	
95	4.23	95.77	89.08	91.85	
106.4	6.18	93.82	89.08	91.85	
115	8.7	91.3	89.08	91.85	
126	9.62	90.38	89.08	91.85	
133	7.55	92.45	89.08	91.85	
139.5	4.24	95.76	89.08	91.85	
150.9	5.7	94.3	89.08	91.85	
159.1	6.77	93.23	89.08	91.85	
173	3.36	96.64	89.08	91.85	TOBL
207.5	7.91	92.09	89.08	91.85	
218.15	10.3	89.7	89.08	91.85	
222.5	10.92	89.08	89.08	91.85	BFL
229.7	12.67	87.33	89.08	91.85	LEW
237	13.24	86.76	89.08	91.85	
245.1	13.69	86.31	89.08	91.85	T
253.2	13.65	86.35	89.08	91.85	
269	12.3	87.7	89.08	91.85	
279	10.92	89.08	89.08	91.85	BFR
284.4	9	91	89.08	91.85	TOBR

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Two Year SUMMARY		Mean	Max	Width:	Flood- prone	Entrench- ment
Year	section	Width	Depth	Depth	Ratio	Ratio
1999	1	55.50	2.20	2.77	25.28	312.62
2001	1	54.50	1.83	2.77	29.78	427.90

UTM X-coord = 700191
 UTM Y-coord = 4434936

Red Clover Cr below Drum Bridge X-sec 2

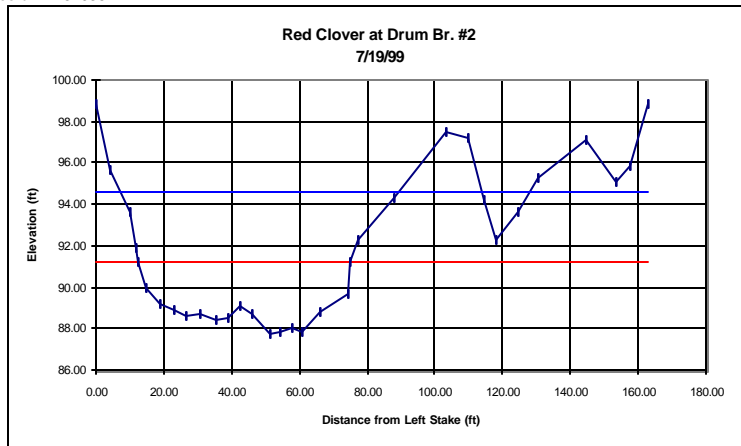

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Total	Bankfull	2xBankfull	
Left Stake	Elevation	Elevation	
0.00	98.80	91.19	94.62
4.00	95.63	91.19	94.62
9.80	93.61	91.19	94.62
11.70	91.91	91.19	94.62
12.60	91.19	91.19	94.62
14.90	89.94	91.19	94.62
18.60	89.16	91.19	94.62
23.20	88.85	91.19	94.62
26.70	88.62	91.19	94.62
30.90	88.75	91.19	94.62
35.50	88.38	91.19	94.62
39.00	88.49	91.19	94.62
42.30	89.11	91.19	94.62
46.20	88.75	91.19	94.62
51.50	87.76	91.19	94.62
54.50	87.88	91.19	94.62
57.80	88.06	91.19	94.62
61.00	87.84	91.19	94.62
66.00	88.80	91.19	94.62
74.30	89.68	91.19	94.62
74.90	91.19	91.19	94.62
77.60	92.31	91.19	94.62
88.00	94.28	91.19	94.62
103.00	97.45	91.19	94.62
110.00	97.18	91.19	94.62
114.70	94.19	91.19	94.62
118.20	92.26	91.19	94.62
124.40	93.59	91.19	94.62
130.50	95.31	91.19	94.62
144.60	97.06	91.19	94.62
153.50	95.07	91.19	94.62
157.50	95.85	91.19	94.62
162.70	98.83	91.19	94.62



RedClover 6/21/01


Dist. From Total	Total	Bankfull	2XBankfull	Notes
left stake	depth	Elevation	Elevation	Elevation
2	2.57	97.43	90.55	94.86 TBM-LB
11.8	7.37	92.63	90.55	94.86 TOBL
16	9.45	90.55	90.55	94.86 BFL
17.7	11.62	88.38	90.55	94.86 LEW
28	12.81	87.19	90.55	94.86
37.9	13.11	86.89	90.55	94.86
49.5	13.11	86.89	90.55	94.86
58	12.9	87.1	90.55	94.86
62.8	13.76	86.24	90.55	94.86 T
67.6	12.56	87.44	90.55	94.86
73.4	11.9	88.1	90.55	94.86 REW
77.9	10.49	89.51	90.55	94.86
79.9	9.45	90.55	90.55	94.86 BFR
88.45	7.37	92.63	90.55	94.86
99.6	4.67	95.33	90.55	94.86
113.2	1.9	98.1	90.55	94.86
133.7	7.21	92.79	90.55	94.86
144.3	4.32	95.68	90.55	94.86
157.4	5.63	94.37	90.55	94.86
166	2.7	97.3	90.55	94.86

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Two Year SUMMARY		Mean	Max	Width:	Flood-	Entrench-
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Ratio	ment Ratio
1999	2	62.30	2.52	3.43	24.74	121.15
2001	2	61.90	2.72	4.31	22.75	111.50


UTM X-coord = 697855
UTM Y-coord = 4437269

Indian Cr below Red Clover X-sec 1

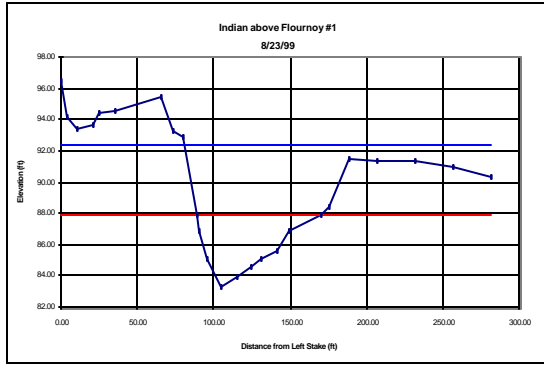


Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	96.45	87.86	92.38
4.00	94.12	87.86	92.38
11.00	93.34	87.86	92.38
20.50	93.62	87.86	92.38
25.00	94.46	87.86	92.38
36.00	94.53	87.86	92.38
65.00	95.42	87.86	92.38
73.00	93.20	87.86	92.38
80.00	92.93	87.86	92.38
89.50	87.86	87.86	92.38
91.00	86.85	87.86	92.38
95.00	85.05	87.86	92.38
105.00	83.34	87.86	92.38
115.00	83.94	87.86	92.38
124.00	84.62	87.86	92.38
131.50	85.09	87.86	92.38
141.70	85.55	87.86	92.38
149.50	86.83	87.86	92.38
170.50	87.86	87.86	92.38
175.00	88.36	87.86	92.38
189.00	91.47	87.86	92.38
207.00	91.37	87.86	92.38
232.00	91.32	87.86	92.38
257.00	90.93	87.86	92.38
282.00	90.26	87.86	92.38

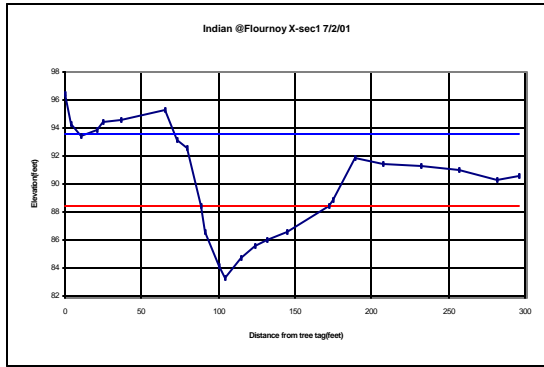

Indian above Flournoy 7/2/01

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
0	3.53	96.47	88.48	93.64	TBM-LB
4	5.72	94.28	88.48	93.64	
11	6.64	93.36	88.48	93.64	
20.5	6.15	93.85	88.48	93.64	
25	5.54	94.46	88.48	93.64	
36	5.43	94.57	88.48	93.64	
65	4.7	95.3	88.48	93.64	TCBL
73	6.86	93.14	88.48	93.64	
80	7.39	92.61	88.48	93.64	
88.5	11.52	88.48	88.48	93.64	BFL
91.9	13.49	86.51	88.48	93.64	LEW
100	15.85	84.15	88.48	93.64	
104.65	16.68	83.32	88.48	93.64	T
115	15.31	84.69	88.48	93.64	
124	14.38	85.62	88.48	93.64	
131.5	14.06	85.94	88.48	93.64	
145.3	13.42	86.58	88.48	93.64	REW
172.5	11.52	88.48	88.48	93.64	BFR
175	11.2	88.8	88.48	93.64	
189	8.15	91.85	88.48	93.64	TCBR
207	8.55	91.45	88.48	93.64	
232	8.78	91.22	88.48	93.64	
257	9.02	90.98	88.48	93.64	
282	9.65	90.35	88.48	93.64	
296	9.42	90.58	88.48	93.64	

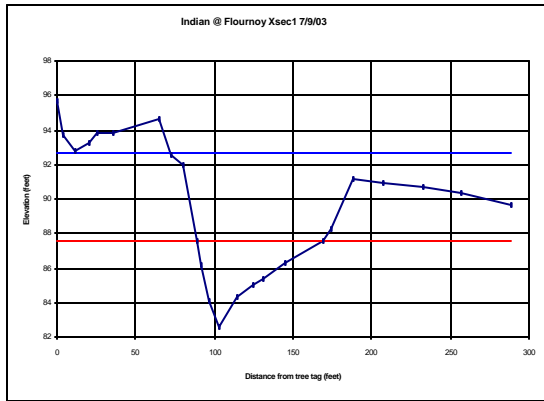

7/9/03 indian at rc crosscut-1


Dist from left stake	Total Depth	Bankfull depth	Total elevation	bankfull elevation	2x bankfull elevation	Notes
0	4.29		95.71	87.61	92.61	tbrml
4	6.3		93.7	87.61	92.61	
11	7.17		92.83	87.61	92.61	
20.5	6.7		93.3	87.61	92.61	
25	6.15		93.85	87.61	92.61	
36	6.13		93.87	87.61	92.61	
65	5.35		94.65	87.61	92.61	tobl
73	7.45		92.55	87.61	92.61	
80	8.04		91.96	87.61	92.61	
88.5	12.39	0	87.61	87.61	92.61	bfl
91.7	13.8	1.41	86.2	87.61	92.61	wel
96	15.93	3.54	84.07	87.61	92.61	
103.5	17.39	5	82.61	87.61	92.61	t
115	15.69	3.3	84.31	87.61	92.61	
124	15.01	2.62	84.99	87.61	92.61	
131.5	14.65	2.26	85.35	87.61	92.61	
144.5	13.74	1.35	86.26	87.61	92.61	wer
169.5	12.39	0	87.61	87.61	92.61	bfr
174.7	11.74		88.26	87.61	92.61	
188	8.89		91.11	87.61	92.61	tobr
207	9.09		90.91	87.61	92.61	
232	9.29		90.71	87.61	92.61	
257	9.64		90.36	87.61	92.61	
288	10.37		89.63	87.61	92.61	endr

TOPipe=Top of pipe/bench mark
LEW=Left edge of water
REW=Right edge of water
MPD=Maximum pool depth
TBM=Temporary bench mark
PCT=Pool tail crest
TP=Turning point
TOPool=Top of pool
S-MAX=Max depth sediment lens
LB=Left bank
RB=Right bank
TOB=Top of bank
BF=Bankfull
T=Thalweg

Three Year SUMMARY						
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Flood-prone width	Entrenchment Ratio
1999	1	81.0	2.70	4.52	30.0	201.0
2001	1	84.0	2.81	5.16	29.8	212.0
2003	1	81.0	2.44	5.00	33.3	224.0


UTM X-coord = 697979
UTM Y-coord = 4437312

Indian Cr below Red Clover X-sec 2

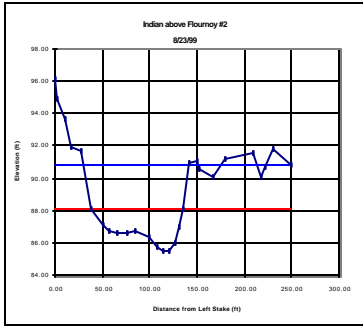


Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2x Bankfull Elevation
0.00	96.18	88.11	90.77
2.00	94.93	88.11	90.77
9.00	93.64	88.11	90.77
16.50	91.93	88.11	90.77
26.50	91.63	88.11	90.77
37.50	88.11	88.11	90.77
51.50	87.10	88.11	90.77
57.70	86.78	88.11	90.77
64.50	86.59	88.11	90.77
76.70	86.62	88.11	90.77
85.50	86.70	88.11	90.77
96.50	86.40	88.11	90.77
108.00	85.72	88.11	90.77
114.50	85.45	88.11	90.77
119.80	85.49	88.11	90.77
126.00	86.02	88.11	90.77
131.50	86.95	88.11	90.77
135.00	88.11	88.11	90.77
141.00	90.95	88.11	90.77
150.00	91.08	88.11	90.77
153.00	90.55	88.11	90.77
167.00	90.10	88.11	90.77
180.00	91.15	88.11	90.77
208.00	91.55	88.11	90.77
217.00	90.11	88.11	90.77
222.00	90.71	88.11	90.77
230.00	91.85	88.11	90.77
250.00	90.86	88.11	90.77

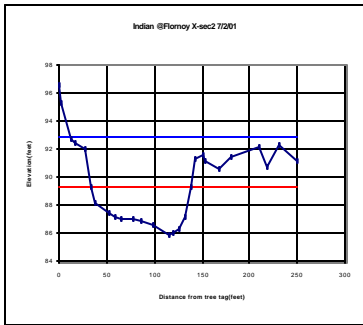

Dist. From left stake	depth	Total Elevation	Bankfull Elevation	2x Bankfull Elevation	Notes
0	3.44	96.56	89.35	92.81	TOP=Top of pipe/bench mark
2	4.73	95.27	89.35	92.81	LEW=Left edge of water
13.5	7.22	92.78	89.35	92.81	REW=Right edge of water
16.5	7.56	92.44	89.35	92.81	MPD=Maximum pool depth
26.5	8.05	91.95	89.35	92.81	TBM=Temporary bench mark
34.6	10.65	89.35	89.35	92.81	TP=Turning point
38	11.91	88.09	89.35	92.81	TP=Turning point
52.5	12.56	87.44	89.35	92.81	TOBL=Top of bank
57.7	12.97	87.13	89.35	92.81	PCT=Pool tail crest
64.9	13.07	86.93	89.35	92.81	TOB=Top of bank
76.7	13.01	86.99	89.35	92.81	BF=Bankfull
85.3	13.11	86.89	89.35	92.81	T=Thalweg
96.5	13.45	86.55	89.35	92.81	
115.6	14.11	85.99	89.35	92.81	T
119.8	14.02	85.98	89.35	92.81	
126	13.73	86.27	89.35	92.81	
131.9	12.82	87.18	89.35	92.81	REW
136.2	10.65	89.35	89.35	92.81	BFR
142.8	8.71	91.29	89.35	92.81	TOER
150	8.45	91.55	89.35	92.81	
153	8.82	91.08	89.35	92.81	
167	9.46	90.52	89.35	92.81	
180	8.58	91.44	89.35	92.81	
209	7.52	92.08	89.35	92.81	
218	9.34	90.66	89.35	92.81	
230	7.78	92.22	89.35	92.81	
250	8.8	91.2	89.35	92.81	

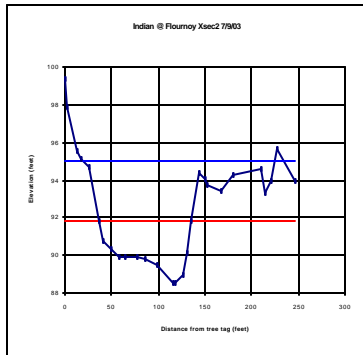

Dist from left stake	Depth	Bankfull elevation	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	0.89	98.31	97.78	95.02	95.02	entri
2	2.1	97.9	97.78	95.02	95.02	
13.5	4.5	95.5	97.78	95.02	95.02	
16.5	4.85	95.15	97.78	95.02	95.02	
26.5	5.32	94.68	97.78	95.02	95.02	tbl
36	8.22	0	91.78	97.78	95.02	tbl
40	8.22	1	90.78	97.78	95.02	wel
50.1	9.63	1.41	90.37	97.78	95.02	
57.7	10.05	1.83	89.95	97.78	95.02	
64.9	10.08	1.86	89.91	97.78	95.02	
76.7	10.16	1.94	89.84	97.78	95.02	
85.3	10.55	2.33	89.45	97.78	95.02	
96.5	10.55	2.33	89.45	97.78	95.02	
115.6	11.42	3.2	88.58	97.78	95.02	
118.1	11.46	3.24	88.54	97.78	95.02	t
126	11.01	2.79	88.99	97.78	95.02	
133.3	9.83	1.61	90.17	97.78	95.02	wer
135	8.22	0	91.78	97.78	95.02	tbl
142.8	5.84	94.36	97.78	95.02	tbl	tbl
150	5.91	94.09	97.78	95.02		
153	6.29	93.71	97.78	95.02		
167	6.57	93.43	97.78	95.02		
180	5.71	94.29	97.78	95.02		
209	5.44	94.56	97.78	95.02		
214	6.7	93.3	97.78	95.02		
220	6.01	93.99	97.78	95.02		
228	4.4	95.6	97.78	95.02		
247	6.02	93.98	97.78	95.02		

TOP=Top of pipe/bench mark

LEW=Left edge of water

REW=Right edge of water

MPD=Maximum pool depth

TBM=Temporary bench mark

TP=Turning point

TOBL=Top of bank

PCT=Pool tail crest

TOB=Top of bank


BF=Bankfull

T=Thalweg

Three Year SUMMAR1						
Year	section	Width	Depth	Bankfull	Bankfull	Depth prone ment
						Ratio width Ratio
1999	2	97.5	1.76	2.66	55.3	193.2 2.0
2001	2	103.6	2.29	3.46	45.2	303.6 2.9
2003	2	99.0	1.92	3.24	51.5	242.0 2.4


UTM X=coord = 6962237
 UTM Y=coord = 4437327

Indian Cr below Red Clover X-sec 3

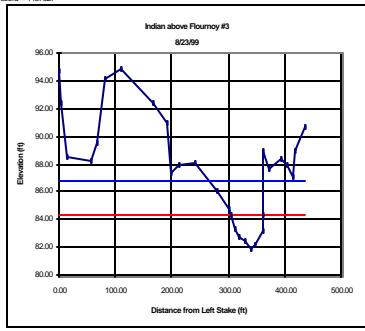


Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2x Bankfull Elevation
0.00	94.75	84.35	86.77
3.00	92.46	84.35	86.77
13.00	88.53	84.35	86.77
58.50	88.25	84.35	86.77
67.40	89.54	84.35	86.77
80.40	94.06	84.35	86.77
110.00	94.78	84.35	86.77
169.00	92.46	84.35	86.77
191.00	90.92	84.35	86.77
199.00	87.33	84.35	86.77
211.00	87.91	84.35	86.77
241.00	88.09	84.35	86.77
281.50	86.03	84.35	86.77
300.00	84.76	84.35	86.77
304.70	84.35	84.35	86.77
311.00	83.34	84.35	86.77
320.40	82.78	84.35	86.77
330.40	82.44	84.35	86.77
339.00	81.93	84.35	86.77
349.00	82.10	84.35	86.77
361.00	83.23	84.35	86.77
361.01	84.35	84.35	86.77
362.00	88.95	84.35	86.77
373.00	87.67	84.35	86.77
383.00	88.39	84.35	86.77
408.00	87.92	84.35	86.77
414.50	87.01	84.35	86.77
419.00	88.99	84.35	86.77
436.00	90.65	84.35	86.77

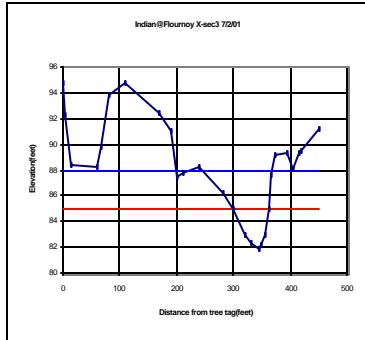

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2x Bankfull Elevation	Notes
0	5.3	84.7	84.91	TBMLB
3	7.86	82.32	84.91	
13	11.54	88.46	84.91	
58.5	11.8	88.2	84.91	
67.4	10.15	89.85	84.91	
80.4	6.12	93.88	84.91	
110	5.3	84.7	84.91	
169	7.81	82.39	84.91	
191	8.91	91.09	84.91	TOBL
199	12.54	87.46	84.91	
211	12.3	87.7	84.91	
241	11.81	88.19	84.91	
281.5	13.78	86.22	84.91	
300	15.06	84.91	84.91	
300.7	15.06	84.91	84.91	BFL
321.6	17.36	82.82	84.91	LEW
330.4	17.65	82.35	84.91	
344	16.14	81.86	84.91	T
349	17.84	82.16	84.91	
362.2	17.07	82.83	84.91	REW
363.8	15.09	84.91	84.91	BFR
367.5	12.33	87.67	84.91	TOBR
373	10.88	89.12	84.91	
383	10.88	89.32	84.91	
408	11.99	88.01	84.91	
414.5	10.74	89.26	84.91	
419	10.6	89.4	84.91	
449	8.84	91.16	84.91	

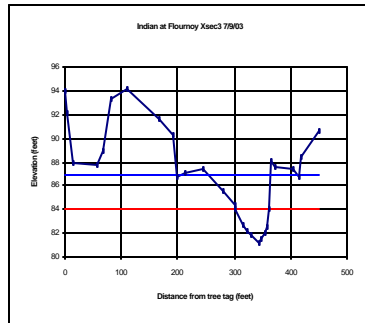

Dist from	Total Elev	Bankfull Elev	2x Bankfull Elev	Notes
0	6.03	93.97	84.05	stn1
3	7.91	92.09	84.05	
13	12.1	87.9	84.05	
58.5	12.31	87.69	84.05	
67.4	11.1	88.9	84.05	
80.4	6.68	93.32	84.05	
110	5.9	94.1	84.05	
169	8.31	91.69	84.05	
191	8.8	92.2	84.05	tbl
199	13.26	86.74	84.05	
211	12.89	87.01	84.05	
244	12.59	87.41	84.05	
281.5	14.47	85.53	84.05	
300	15.64	84.36	84.05	
302	15.95	0	84.05	tbl
316.6	17.36	1.41	82.64	well
321.6	17.77	1.82	82.23	
330.4	16.16	2.23	81.82	
344.3	16.78	2.83	81.22	t
349	16.54	2.59	81.46	
362.2	18.04	2.09	81.96	
369.4	17.39	1.44	82.61	wer
382	15.95	0	84.05	tbl
387	11.94	88.06	84.05	tbl
373	12.4	87.6	84.05	
406	12.56	87.44	84.05	
413.5	13.19	88.81	84.05	
419	11.62	88.38	84.05	
449	9.43	90.57	84.05	

TOP=Top of pipe/bench mark

LEW=Left edge of water

REW=Right edge of water

MPD=Maximum pool depth

TBM=Temporary bench mark

PCT=Pool tail crest

TP=Turning point

TOP=Top of pool

S-MAX=Max depth sediment lens

LB=Left bank

RB=Right bank

TOB=Top of bank


BF=Bankfull

T=Thalweg

Three Year SUMMAR1							Mean	Max	Width:	Flood- Entren
Year	sector	Width	Depth	Depth Ratio	width	Ratio				
1999	3	56.3	1.71	2.42	32.9	94.6	1.7			
2001	3	63.1	2.05	3.05	30.7	276.1	4.4			
2003	3	60.0	1.80	2.83	33.3	214.9	3.6			


UTM X-coord = 684669
 UTM Y-coord = 4438760

Indian Cr below T-ville Bridge X-sec 1

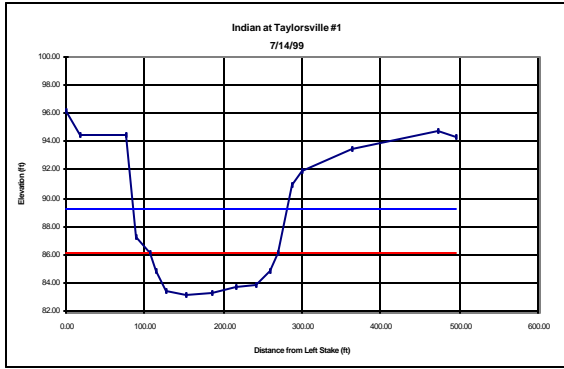


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	96.15	86.18	89.26
19.00	94.50	86.18	89.26
76.00	94.52	86.18	89.26
89.20	87.26	86.18	89.26
106.80	86.18	86.18	89.26
115.00	84.88	86.18	89.26
128.30	83.44	86.18	89.26
153.80	83.10	86.18	89.26
186.60	83.27	86.18	89.26
215.00	83.74	86.18	89.26
242.50	83.82	86.18	89.26
259.70	84.86	86.18	89.26
270.60	86.18	86.18	89.26
288.50	90.90	86.18	89.26
299.00	91.96	86.18	89.26
364.70	93.48	86.18	89.26
471.80	94.80	86.18	89.26
495.60	94.36	86.18	89.26

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

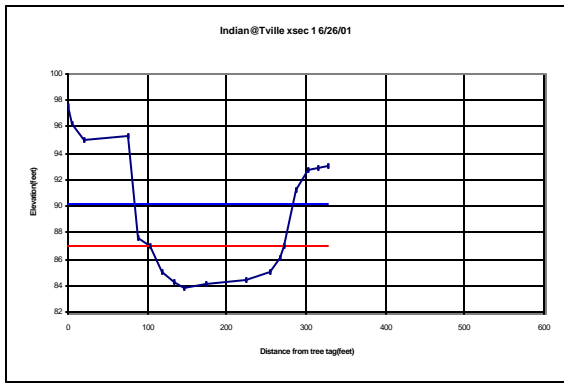

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
0	2.36	97.64	86.97	90.19	TBM-LB
52	3.72	96.28	86.97	90.19	
19.4	4.92	95.08	86.97	90.19	
75.1	4.72	95.28	86.97	90.19	TOBL
89.4	12.38	87.62	86.97	90.19	
104.4	13.03	86.97	86.97	90.19	BFL
118.8	14.94	85.06	86.97	90.19	LEW
133	15.76	84.24	86.97	90.19	
146.6	16.25	83.75	86.97	90.19	T
175	15.89	84.11	86.97	90.19	
223.9	15.52	84.48	86.97	90.19	
254.5	14.99	85.01	86.97	90.19	REW
266.2	13.87	86.13	86.97	90.19	
271.9	13.03	86.97	86.97	90.19	BFR
287.6	8.73	91.27	86.97	90.19	TOBR
301.5	7.2	92.8	86.97	90.19	
314	7.15	92.85	86.97	90.19	
327.4	7.02	92.98	86.97	90.19	End

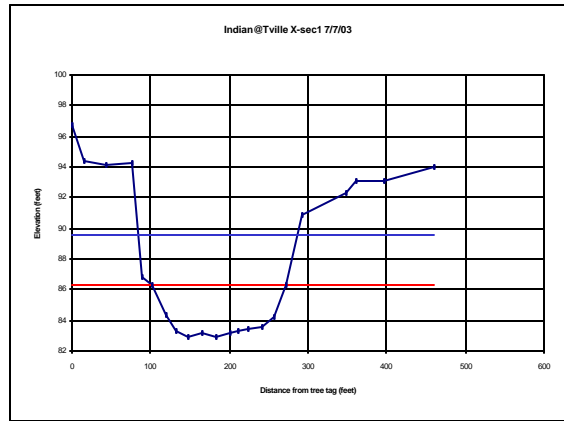


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	Bankfull elevation	Notes
0	3.25		96.75	86.25	89.61	tbrml
15.4	5.65		94.35	86.25	89.61	
44	5.92		94.08	86.25	89.61	
75	5.75		94.25	86.25	89.61	tobl
87.8	13.14		86.86	86.25	89.61	
101	13.75	0	86.25	86.25	89.61	bfl
118.5	15.66	1.91	84.34	86.25	89.61	wel
133	16.76	3.01	83.24	86.25	89.61	
147	17.11	3.36	82.89	86.25	89.61	t
166	16.8	3.05	83.2	86.25	89.61	
182	17.07	3.32	82.93	86.25	89.61	
200	16.83	3.08	83.17	86.25	89.61	
211	16.64	2.89	83.36	86.25	89.61	
223.5	16.55	2.8	83.45	86.25	89.61	
240.4	16.48	2.73	83.52	86.25	89.61	
255.8	15.8	2.05	84.2	86.25	89.61	wer
271.5	13.75	0	86.25	86.25	89.61	btr
292.5	9.11		90.89	86.25	89.61	tobr
349.5	7.65		92.35	86.25	89.61	
361.5	6.91		93.09	86.25	89.61	
397.5	6.96		93.04	86.25	89.61	
459.5	6.03		93.97	86.25	89.61	end

TOP=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOP=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg
 all measurements in feet

Three Year SUMMARY		Mean	Max	Width:	Flood-	Entrench-	
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Ratio	ment Ratio	
1999	1	163.80	2.31	3.08	71.00	196.72	1.20
2001	1	167.50	2.00	3.22	83.75	261.40	1.56
2003	1	170.50	2.56	2.56	66.51	201.50	1.18


UTM X-coord = 684812
 UTM Y-coord = 428413

Indian Cr below T-ville Bridge x-sec 2

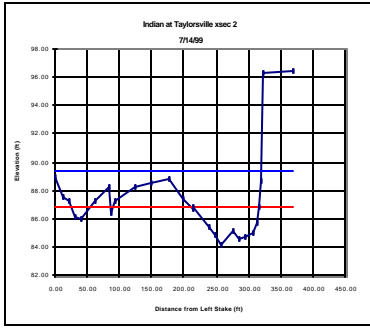


Blue Line=2-Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2-Bankfull Elevation
1.00	88.06	86.76	89.41
13.00	87.57	86.76	89.41
23.00	87.24	86.76	89.41
31.50	86.07	86.76	89.41
41.00	85.91	86.76	89.41
61.00	87.29	86.76	89.41
82.00	86.18	86.76	89.41
86.50	87.24	86.76	89.41
123.50	88.29	86.76	89.41
148.00	88.46	86.76	89.41
178.00	88.54	86.76	89.41
203.00	87.31	86.76	89.41
213.00	86.08	86.76	89.41
213.50	86.76	86.76	89.41
237.50	85.48	86.76	89.41
249.50	84.89	86.76	89.41
257.50	84.11	86.76	89.41
277.50	85.18	86.76	89.41
286.00	84.67	86.76	89.41
295.50	84.65	86.76	89.41
306.70	85.04	86.76	89.41
313.10	85.65	86.76	89.41
315.90	86.76	86.76	89.41
318.90	86.63	86.76	89.41
322.00	86.33	86.76	89.41
370.00	86.41	86.76	89.41

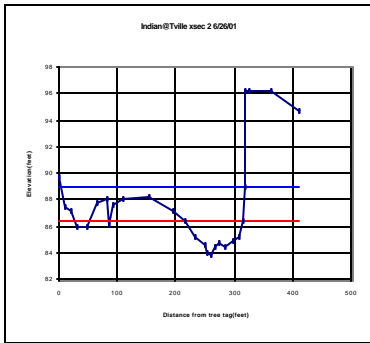

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2-Bankfull Elevation	Notes
0	10.37	89.63	86.4	88.97 TBM-LB
10.4	12.51	87.49	86.4	88.97
21.45	12.8	87.2	86.4	88.97
29.3	14	86	86.4	88.97
49	14	86	86.4	88.97
64.35	12.31	87.69	86.4	88.97
81.2	11.89	88.01	86.4	88.97
85.1	13.02	86.08	86.4	88.97
93.6	12.43	87.57	86.4	88.97
108.65	11.98	88.02	86.4	88.97
155.1	11.74	88.25	86.4	88.97
195.1	12.86	87.14	86.4	88.97 BFL
215.3	13.6	86.4	86.4	88.97
232.4	14.78	85.22	86.4	88.97 LEW
249.5	15.5	84.5	86.4	88.97
255	15.89	84.01	86.4	88.97 T
259.3	16.17	83.83	86.4	88.97
266	15.59	84.41	86.4	88.97
275.65	15.22	84.78	86.4	88.97
283.8	15.63	84.37	86.4	88.97
299.1	15.16	84.84	86.4	88.97 REW
306.7	14.78	85.24	86.4	88.97
313.8	13.6	86.4	86.4	88.97 BFR
317	11.04	88.96	86.4	88.97
319.8	3.85	96.15	86.4	88.97 TOBR
324	3.78	96.22	86.4	88.97
362	3.77	96.23	86.4	88.97
410	5.34	94.66	86.4	88.97 TBM-RB

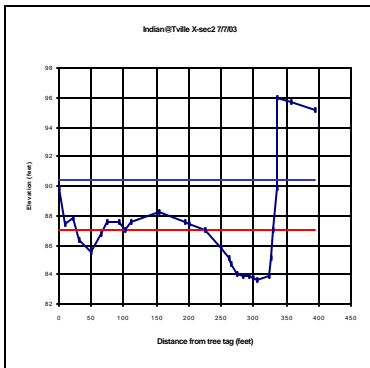

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2-Bankfull Elevation	Notes
0	10.14	89.86	87.02	90.43 bml
10.6	12.64	87.36	87.02	90.43 tdb
21.45	12.22	87.78	87.02	90.43
29.3	13.61	86.39	87.02	90.43
49	14.5	85.5	87.02	90.43
64.35	13.04	86.76	87.02	90.43
74	12.5	87.5	87.02	90.43
91	12.38	87.62	87.02	90.43
101	12.88	87.02	87.02	90.43
110	12.45	87.55	87.02	90.43
155	11.82	88.18	87.02	90.43
195	12.38	87.62	87.02	90.43
200	12.69	87.42	87.02	90.43
224.3	12.88	0	87.02	87.02 90.43 bfl
249.5	14.16	1.18	85.84	87.02 90.43 wfl
260.5	14.88	1.9	85.12	87.02 90.43
266	15.32	2.34	84.68	87.02 90.43
275.6	15.9	2.92	83.9	87.02 90.43
284.5	16.1	3.12	83.9	87.02 90.43
294	16.14	3.16	83.86	87.02 90.43
299	16.21	3.23	83.79	87.02 90.43
306	16.39	3.41	83.61	87.02 90.43 t
322.8	16.13	3.15	83.87	87.02 90.43
328	14.85	1.87	85.15	87.02 90.43 wer
331	12.98	0	87.02	87.02 90.43 bfr
336	10.15	0	89.85	87.02 90.43
338.5	4.01	95.99	87.02	90.43 vbr
356	4.24	95.76	87.02	90.43
366	4.88	95.12	87.02	90.43 end

TOP=Top of pipe/bench mark

LEW=Left edge of water

REW=Right edge of water

MPD=Maximum pool depth

TBM=Temporary bench mark

PCT=Pool tail crest

TP=Turning point

TOP=Top of pool

S-MAX=Max depth sediment lens

LB=Left bank

RB=Right bank

TOB=Top of bank

BF=Bankfull


T=Thalweg

All measurements in feet

Three Year SUMMAR1						
Year	section	Width	Depth	Bankfull Ratio	Bankfull width	Entren ment Ratio
1999	2	###	1.82	2.65	56.36	### 3.11
2001	2	98.50	1.64	2.57	60.06	### 5.11
2003	2	###	2.39	3.41	44.66	### 4.72


UTM X-coord = 654541
UTM Y-coord = 4438327

Indian Cr below Tville Bridge x-sec 3

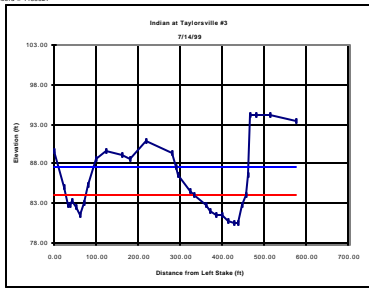


Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From	Total	Bankfull	2xBankfull
0.00	89.59	84.07	87.59
23.00	85.13	84.07	87.59
32.30	82.92	84.07	87.59
38.30	82.71	84.07	87.59
41.00	83.36	84.07	87.59
51.60	82.63	84.07	87.59
60.30	81.66	84.07	87.59
71.00	83.08	84.07	87.59
80.20	85.31	84.07	87.59
88.50	88.65	84.07	87.59
124.90	89.65	84.07	87.59
162.40	89.10	84.07	87.59
180.00	88.63	84.07	87.59
216.10	90.78	84.07	87.59
281.00	89.34	84.07	87.59
289.00	87.55	84.07	87.59
294.00	86.48	84.07	87.59
323.00	84.55	84.07	87.59
331.40	84.07	84.07	87.59
361.80	82.77	84.07	87.59
371.00	82.10	84.07	87.59
386.00	81.65	84.07	87.59
402.30	81.45	84.07	87.59
414.50	80.88	84.07	87.59
428.50	80.55	84.07	87.59
436.60	80.60	84.07	87.59
449.50	82.70	84.07	87.59
458.80	84.07	84.07	87.59
481.00	86.58	84.07	87.59
486.00	84.14	84.07	87.59
481.00	84.24	84.07	87.59
516.00	84.11	84.07	87.59
576.00	83.38	84.07	87.59

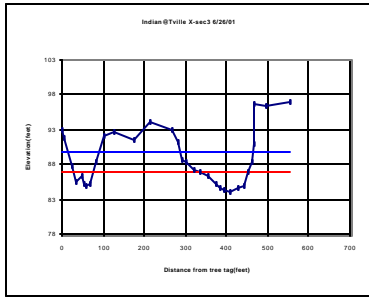

Dist. From	Total	Bankfull	2xBankfull	Notes
0	7.14	82.86	86.91	89.67
3	8.16	91.84	86.91	89.67
24	12.09	87.91	86.91	89.67
35	14.4	85.6	86.91	89.67
48.5	13.81	86.19	86.91	89.67
54	14.9	85.1	86.91	89.67
56.1	15.19	84.81	86.91	89.67
66.2	14.81	80.19	86.91	89.67
82	11.54	88.46	86.91	89.67
103.3	7.93	82.11	86.91	89.67
124.7	7.29	82.71	86.91	89.67
174.3	8.44	91.56	86.91	89.67
216.3	6	94	86.91	89.67
267.3	6.93	93.07	86.91	89.67
280.5	8.83	91.17	86.91	89.67
293.3	11.43	88.37	86.91	89.67
300	11.74	88.36	86.91	89.67
319	12.77	87.23	86.91	89.67
335.4	13.09	86.91	86.91	89.67
352.8	13.78	86.22	86.91	89.67
374.6	14.95	85.05	86.91	89.67
383.5	15.37	84.63	86.91	89.67
394	15.6	84.4	86.91	89.67
408.3	15.85	84.15	86.91	89.67
428.1	15.37	84.63	86.91	89.67
443.5	15.01	84.99	86.91	89.67
454.1	13.09	86.91	86.91	89.67
459.6	11.78	88.22	86.91	89.67
464.8	8.93	91.07	86.91	89.67
466.5	3.25	96.75	86.91	89.67
498	3.51	96.49	86.91	89.67
552	2.94	97.06	86.91	89.67

T=Thalweg

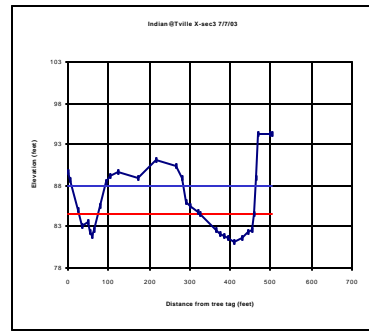


Dist from	Total	Bankfull	Total	Bankfull	bankfull	Notes
0	10.26	89.74	84.56	87.88	87.88	tsml
3	11.3	88.7	84.56	87.88	87.88	
24	14.96	85.04	84.56	87.88	87.88	
35	17	83	84.56	87.88	87.88	
48.5	16.46	83.55	84.56	87.88	87.88	
54	17.71	82.29	84.56	87.88	87.88	
56.1	16.11	81.89	84.56	87.88	87.88	of
66.2	17.47	82.53	84.56	87.88	87.88	
80	14.37	85.63	84.56	87.88	87.88	
93	11.53	88.47	84.56	87.88	87.88	
103	10.87	89.13	84.56	87.88	87.88	
134	10.27	89.73	84.56	87.88	87.88	
174	11.11	88.89	84.56	87.88	87.88	
216	8.81	91.19	84.56	87.88	87.88	
267	9.73	90.27	84.56	87.88	87.88	tsml
280.5	11.05	88.95	84.56	87.88	87.88	
293	13.93	86.07	84.56	87.88	87.88	
300	14.42	85.58	84.56	87.88	87.88	
319	16.31	84.69	84.56	87.88	87.88	
327.5	15.44	0	84.56	84.56	87.88	tsl
355.4	17.36	1.92	82.64	84.56	87.88	wsl
374.6	17.79	2.35	82.21	84.56	87.88	
383.5	16.09	2.65	81.91	84.56	87.88	
394	18.37	2.93	81.63	84.56	87.88	
407.1	18.76	3.32	81.24	84.56	87.88	1
428	18.4	2.96	81.6	84.56	87.88	
443.5	17.67	2.23	82.33	84.56	87.88	
451.85	17.3	1.86	82.7	84.56	87.88	war
456.5	15.44	0	84.56	84.56	87.88	br
465	10.98	89.02	84.56	87.88	87.88	
467.5	5.7	94.3	84.56	87.88	87.88	tsbr
498	5.71	94.29	84.56	87.88	87.88	
501	5.68	94.32	84.56	87.88	87.88	endr

TOP=Top of pipe/bench mark
LEW=Left edge of water
REW=Right edge of water
MPD=Maximum pool depth
TBM=Temporary bench mark
PCT=Post tail crest
TP=Turning point
TOP=Top of post
S-MAX=Max depth sediment lens
LB=Left bank
RB=Right bank
TOB=Top of bank
BF=Bankfull
all measurements in feet

Three Year SUMMARY						
Year	section	Width	Depth	Bankfull	Bankfull	Bankfull
1999	3	125.40	2.48	3.52	50.51	451.79
2001	3	118.70	1.78	2.76	66.08	252.20
2003	3	129.00	2.25	3.32	57.42	174.70


UTM X-coord = 684402
 UTM Y-coord = 4440968

Lights Cr X-sec 1

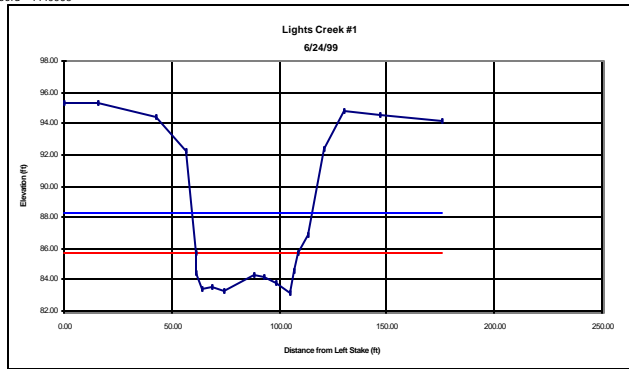


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	95.30	85.75	88.3
16.00	95.35	85.75	88.3
43.00	94.45	85.75	88.3
56.60	92.20	85.75	88.3
61.10	85.75	85.75	88.3
61.80	84.45	85.75	88.3
64.00	83.40	85.75	88.3
69.00	83.60	85.75	88.3
74.00	83.34	85.75	88.3
87.90	84.27	85.75	88.3
93.20	84.19	85.75	88.3
98.20	83.85	85.75	88.3
104.60	83.20	85.75	88.3
106.50	84.56	85.75	88.3
108.30	85.75	85.75	88.3
113.00	86.85	85.75	88.3
121.00	92.35	85.75	88.3
130.30	94.75	85.75	88.3
147.00	94.55	85.75	88.3
176.00	94.10	85.75	88.3

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

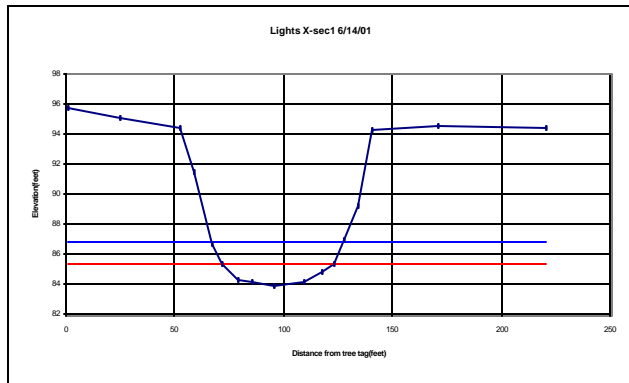

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
1	4.3	95.7	85.37	86.85	TBM-LB
25	4.9	95.1	85.37	86.85	
52	5.65	94.35	85.37	86.85	TOBL
59.2	8.55	91.45	85.37	86.85	
67.5	13.36	86.64	85.37	86.85	
72.05	14.63	85.37	85.37	86.85	BFL
78.8	15.71	84.29	85.37	86.85	
85.2	15.9	84.1	85.37	86.85	LEW
95.3	16.11	83.89	85.37	86.85	T
109.3	15.84	84.16	85.37	86.85	REW
118	15.2	84.8	85.37	86.85	
123	14.63	85.37	85.37	86.85	BFR
128	13.03	86.97	85.37	86.85	
134.2	10.75	89.25	85.37	86.85	
140.4	5.75	94.25	85.37	86.85	TOBR
170.9	5.42	94.58	85.37	86.85	
220.6	5.65	94.35	85.37	86.85	TBM-RB

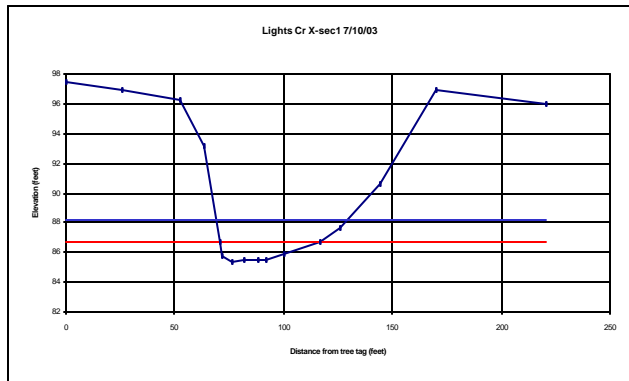


Dist from le	Total Depth	Bankfull deq	Total eleva	Bankfull elev	2x Bankfull	Notes
0	2.5		97.5	86.75	88.2	tbrl
26	3.02		96.98	86.75	88.2	
52	3.75		96.25	86.75	88.2	tbl
63	6.88		93.12	86.75	88.2	
70.5	13.25	0	86.75	86.75	88.2	bl
71.5	14.29	1.04	85.71	86.75	88.2	wel
76	14.7	1.45	85.3	86.75	88.2	t
82.2	14.54	1.29	85.46	86.75	88.2	
88.2	14.52	1.27	85.48	86.75	88.2	
92.1	14.44	1.19	85.56	86.75	88.2	
100	14.16	0.91	85.84	86.75	88.2	wer
116.9	13.25	0	86.75	86.75	88.2	blr
125.8	12.31		87.69	86.75	88.2	
144	9.42		90.58	86.75	88.2	
170	3.05		96.95	86.75	88.2	tobr
220.6	4		96	86.75	88.2	endr

TOP=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg
 all measurements in feet

Three Year SUMMARY		Mean	Max	Width: Flood-	Entrench-
Year	Cross-section	Bankfull Width	Bankfull Depth	Ratio	ment Ratio
1999	1	47.20	1.88	25.15	55.79
2001	1	49.95	0.94	53.13	65.23
2003	1	46.40	1.02	45.43	59.60


UTM X-coord = 684548
 UTM Y-coord = 4440878

Lights Cr X-sec 2

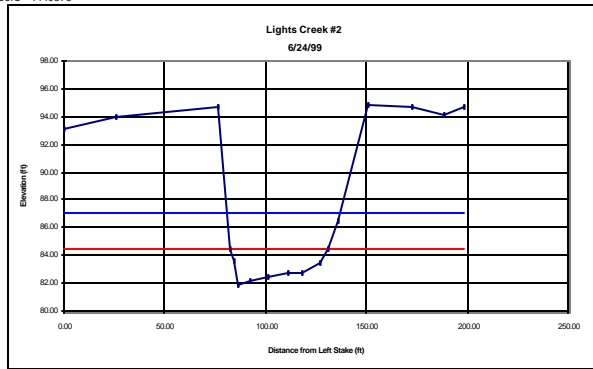


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	93.15	84.46	87.07
26.00	94.00	84.46	87.07
76.50	94.67	84.46	87.07
82.20	84.46	84.46	87.07
84.70	83.57	84.46	87.07
86.30	81.85	84.46	87.07
92.00	82.20	84.46	87.07
101.00	82.45	84.46	87.07
111.00	82.75	84.46	87.07
118.40	82.74	84.46	87.07
126.60	83.48	84.46	87.07
131.00	84.46	84.46	87.07
136.20	86.41	84.46	87.07
151.00	94.83	84.46	87.07
173.00	94.75	84.46	87.07
188.00	94.05	84.46	87.07
198.00	94.65	84.46	87.07

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

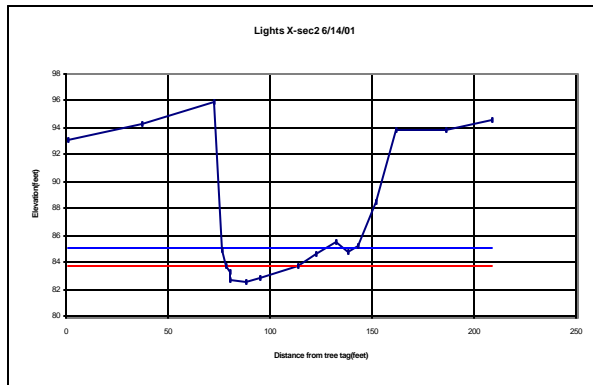

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
1	6.93	93.07	83.78	84.99	TBM-LB
37	5.78	94.22	83.78	84.99	TOBL
72.5	4.09	95.91	83.78	84.99	
76.4	15.15	84.85	83.78	84.99	
78.8	16.22	83.78	83.78	84.99	BFL
80.5	16.74	83.26	83.78	84.99	
80.3	17.28	82.72	83.78	84.99	LEW
88.5	17.43	82.57	83.78	84.99	T
94.9	17.18	82.82	83.78	84.99	REW
113.3	16.22	83.78	83.78	84.99	BFR
122.4	15.4	84.6	83.78	84.99	
132.2	14.47	85.53	83.78	84.99	
138.7	15.18	84.82	83.78	84.99	
143.5	14.8	85.2	83.78	84.99	
151.5	11.55	88.45	83.78	84.99	
161.9	6.23	93.77	83.78	84.99	TOBR
186.5	6.14	93.86	83.78	84.99	
209.2	5.45	94.55	83.78	84.99	

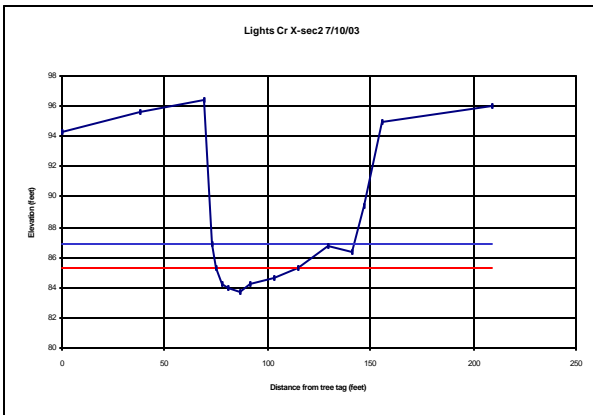


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x bankfull elevation	Notes
0	5.7		94.3	85.3	86.94	tbrml
38	4.42		95.58	85.3	86.94	
69	3.6		96.4	85.3	86.94	tobl
73	13.18		86.82	85.3	86.94	
75	14.7	0	85.3	85.3	86.94	blf
77.5	15.74	1.04	84.26	85.3	86.94	wel
80.5	16.05	1.35	83.95	85.3	86.94	
86.3	16.34	1.64	83.66	85.3	86.94	t
91.8	15.83	1.13	84.17	85.3	86.94	
103	15.39	0.69	84.61	85.3	86.94	wer
115	14.7	0	85.3	85.3	86.94	br
129	13.22		86.78	85.3	86.94	
141	13.59		86.41	85.3	86.94	
147	10.57		89.43	85.3	86.94	
155.6	5.02		94.98	85.3	86.94	toibr
209.2	4		96	85.3	86.94	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg
 all measurements in feet

Three Year SUMMARY		Mean	Max	Width:	Flood-	Entrench-
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Ratio	prone width	ment Ratio
1999	2	48.80	1.74	2.61	28.05	56.62
2001	2	33.50	1.32	1.21	25.45	73.00
2003	2	40.00	0.98	1.64	41.03	70.20


UTM X=coord = 684806
 UTM Y=coord = 4440228

Lights Cr X-sec 3

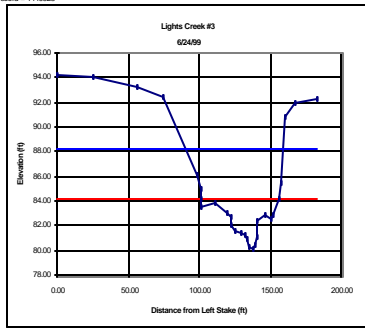


Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From	Total	Bankfull	2xBankfull
Left Stake	Elevation	Elevation	Elevation
0.00	94.25	84.16	88.26
26.00	94.00	84.16	88.26
57.00	93.20	84.16	88.26
74.00	92.50	84.16	88.26
86.00	88.06	84.16	88.26
101.50	85.05	84.16	88.26
102.00	84.16	84.16	88.26
102.01	83.56	84.16	88.26
111.00	83.86	84.16	88.26
120.00	82.97	84.16	88.26
122.70	82.63	84.16	88.26
123.10	82.09	84.16	88.26
125.30	81.58	84.16	88.26
129.00	81.34	84.16	88.26
131.20	81.20	84.16	88.26
134.00	80.96	84.16	88.26
137.70	80.24	84.16	88.26
138.10	80.36	84.16	88.26
140.70	81.05	84.16	88.26
141.00	82.35	84.16	88.26
147.00	82.35	84.16	88.26
150.00	82.46	84.16	88.26
152.10	82.85	84.16	88.26
155.70	84.16	84.16	88.26
158.30	85.50	84.16	88.26
160.40	90.75	84.16	88.26
167.60	91.90	84.16	88.26
183.00	92.35	84.16	88.26

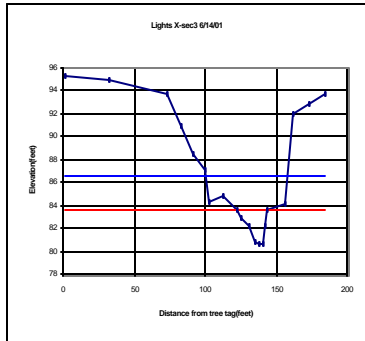

Lights 67401

Dist. From	Total	Total	Bankfull	2xBankfull	Notes
left stake	depth	Elevation	Elevation	Elevation	
1	4.75	95.25	83.59	88.53	TBMLB
32	5.12	94.88	83.59	88.53	
73	6.19	93.81	83.59	88.53	TOBL
83	9.03	90.87	83.59	88.53	
91.5	11.52	88.48	83.59	88.53	
100	12.98	87.02	83.59	88.53	
103.3	15.75	84.25	83.59	88.53	
112	15.22	84.78	83.59	88.53	
123	16.41	83.59	83.59	88.53	BFL
125	17.03	82.87	83.59	88.53	
131	17.86	82.14	83.59	88.53	LEW
135.7	19.14	80.86	83.59	88.53	
137.5	19.35	80.65	83.59	88.53	T
140.9	19.31	80.69	83.59	88.53	
142.8	17.89	82.11	83.59	88.53	REW
144.1	16.41	83.59	83.59	88.53	BFR
150.3	15.81	84.09	83.59	88.53	
162.2	8.02	91.98	83.59	88.53	TOBR
173	7.11	92.89	83.59	88.53	
183.9	6.35	93.65	83.59	88.53	TBMR

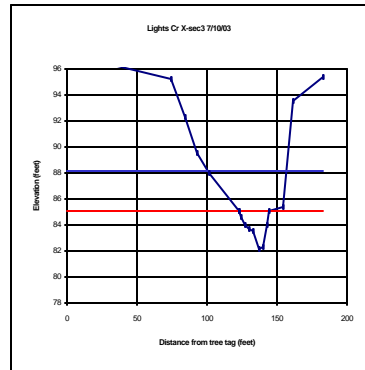

7/10/03 lights cr section-3


Dist. from	Total	Bankfull	Total	Bankfull	Bankfull	Notes
left stake	Depth	depth	elevation	elevation	elevation	
0	3.1		96.9	85.14	88.09	stwt
33	3.76		96.24	85.14	88.09	
74	4.77		95.23	85.14	88.09	tbl
84	7.74		92.26	85.14	88.09	
82.5	10.5		89.5	85.14	88.09	
101	11.99		88.01	85.14	88.09	
122.5	14.86	0	85.14	85.14	88.09	bfl
122.2	14.86	0	85.14	85.14	88.09	
124.2	15.38	0.52	84.62	85.14	88.09	
128.8	16.01	1.15	83.99	85.14	88.09	wel
130.5	16.59	1.43	83.71	85.14	88.09	
133.9	16.44	1.58	83.56	85.14	88.09	
137.7	17.81	2.35	82.19	85.14	88.09	t
140.2	17.7	2.84	82.3	85.14	88.09	
143	16.02	1.16	83.98	85.14	88.09	wet
144.9	14.86	0	85.14	85.14	88.09	bfl
154.6	14.59		85.41	85.14	88.09	
161	6.43		93.57	85.14	88.09	tblr
183	4.65		95.35	85.14	88.09	

- TOPipe=Top of pipe/bench mark
- LEW=Left edge of water
- REW=Right edge of water
- MPD=Maximum pool depth
- TBM=Temporary bench mark
- PCT=Pool tail crest
- TP=Turning point
- TOP=Top of pool
- S-MAX=Max. depth sediment tens
- LB=Left bank
- RB=Right bank
- TOB=Top of bank
- BF=Bankfull
- T=Thalweg
- all measurements in feet

Three Year SUMMAR1						
Year	section	Width	Depth	Bankfull	Bankfull	Depth
		Ratio	Ratio	Ratio	Ratio	Ratio
1999	3	53.70	2.25	4.10	23.86	69.60
2001	3	20.10	1.73	2.94	11.61	57.30
2003	3	22.40	1.29	2.95	17.33	49.90


UTM X=coord = 675963
 UTM Y=coord = 4446225

Wolf Cr X-sec 1

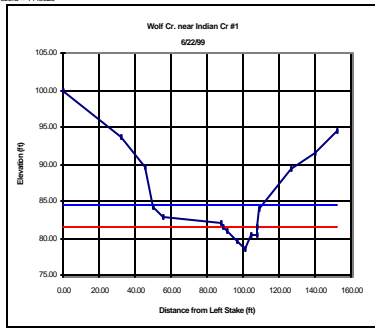


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2x Bankfull Elevation
0.00	100.00	81.5	84.55
31.80	93.54	81.5	84.55
45.50	89.65	81.5	84.55
59.50	84.08	81.5	84.55
66.00	82.80	81.5	84.55
67.50	82.15	81.5	84.55
68.00	81.50	81.5	84.55
69.00	80.89	81.5	84.55
69.60	79.50	81.5	84.55
100.00	78.45	81.5	84.55
104.00	80.30	81.5	84.55
104.00	80.51	81.5	84.55
108.10	81.50	81.5	84.55
109.20	81.50	81.5	84.55
109.40	83.79	81.5	84.55
126.75	88.19	81.5	84.55
140.00	91.60	81.5	84.55
152.00	94.40	81.5	84.55

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

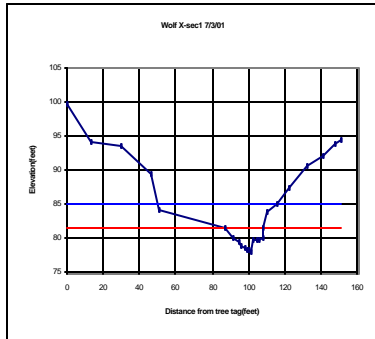

Dist. From left stake	Total Elevation	Bankfull Elevation	2x Bankfull Elevation	Notes
0	0.42	89.50	81.49	84.99 TBM/LB
13	5.8	84.2	81.49	84.99
30	6.34	83.06	81.49	84.99
46.8	10.65	80.55	81.49	84.99 TOBL
50.7	15.9	84.1	81.49	84.99
67.5	18.51	81.49	81.49	84.99 BFL
92.1	20.02	79.98	81.49	84.99 LEW
94.7	20.6	79.4	81.49	84.99
96.3	21.26	78.74	81.49	84.99
98	21.5	78.5	81.49	84.99
99.2	21.65	78.15	81.49	84.99
100	21.65	78.15	81.49	84.99
101.2	22.01	77.99	81.49	84.99 T
102.8	20.41	76.59	81.49	84.99
104.6	20.43	75.57	81.49	84.99
106.2	20.42	75.56	81.49	84.99
107.9	20.09	75.91	81.49	84.99
108.5	18.51	81.49	81.49	84.99 BFR
110.6	16.08	83.02	81.49	84.99
115.9	14.98	85.02	81.49	84.99
123	12.03	87.37	81.49	84.99
132.3	9.49	89.51	81.49	84.99
141.5	8.05	91.85	81.49	84.99
147.7	6.09	93.91	81.49	84.99
151.4	5.48	94.52	81.49	84.99 Pump-house

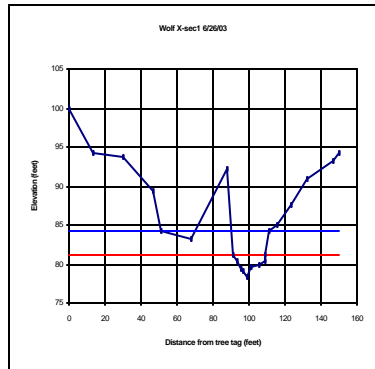

Dist from left stake	Total Elevation	Bankfull Elevation	2x Bankfull Elevation	Notes
0	0.14	99.86	81.23	84.17 br
13	5.62	94.18	81.23	84.17
30	6.33	93.07	81.23	84.17
46.8	10.66	89.34	81.23	84.17 tbr
50.7	15.78	84.22	81.23	84.17
66	16.52	83.08	81.23	84.17
67.5	7.83	82.17	81.23	84.17
91.45	18.77	0	81.23	84.17 br
93.25	19.58	0.79	80.44	81.23 84.17 wfl
95.5	20.69	1.52	79.31	81.23 84.17
96.9	20.81	2.04	78.19	81.23 84.17
99.3	21.71	2.84	76.29	81.23 84.17 t
101.2	20.5	1.73	79.5	81.23 84.17
106	20.15	1.38	79.85	81.23 84.17
108.5	19.74	0.97	80.26	81.23 84.17 wfl
109	18.77	0	81.23	81.23 84.17 br
110.6	15.76	84.25	81.23	84.17
115	15	85	81.23	84.17 tbr
123	12.38	87.52	81.23	84.17
132.3	9.22	90.78	81.23	84.17
147	6.73	93.27	81.23	84.17
150	5.67	94.13	81.23	84.17

TOP=Top of pipe/bench mark
 LEW=Left edge of water

REV=Right edge of water

MPD=Maximum pool depth

TBM=Temporary bench mark

PCT=Pool tail crest

TP=Turning point

TOP=Top of pool

S-MAX=Max depth sediment lens

LB=Left bank

RB=Right bank

TOB=Top of bank

BF=Bankfull


T=Trailway

all measurements in feet

Three Year SUMMAR1		Mean	Max	Width:	Flood -	Entrench-
Year	sector	Cross-Width	Bankfull Depth	Bankfull Depth	Ratio	ment Ratio
1999	1	19.60	1.57	3.05	12.48	61.78 3.15
2001	1	21.00	2.44	3.50	9.41	#### 9.29
2003	1	17.55	1.47	2.94	11.93	58.20 3.32


UTM X-coord = 676101
 UTM Y-coord = 4445068

Wolf Cr X-sec 2

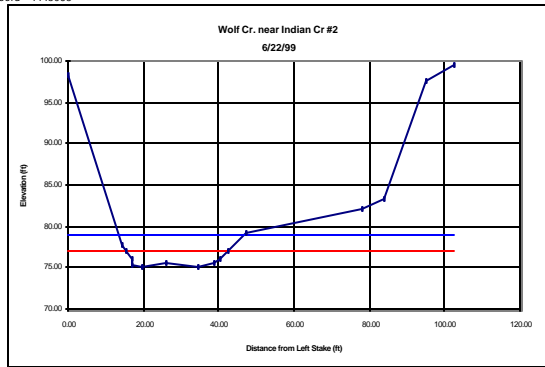


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	98.22	77.04	79.04
14.50	77.65	77.04	79.04
15.20	77.04	77.04	79.04
17.00	76.00	77.04	79.04
17.10	75.27	77.04	79.04
19.80	75.04	77.04	79.04
26.00	75.63	77.04	79.04
34.50	75.19	77.04	79.04
39.00	75.54	77.04	79.04
40.40	75.96	77.04	79.04
42.50	77.04	77.04	79.04
47.00	79.23	77.04	79.04
78.00	82.00	77.04	79.04
84.00	83.35	77.04	79.04
95.00	97.70	77.04	79.04
102.50	99.40	77.04	79.04

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

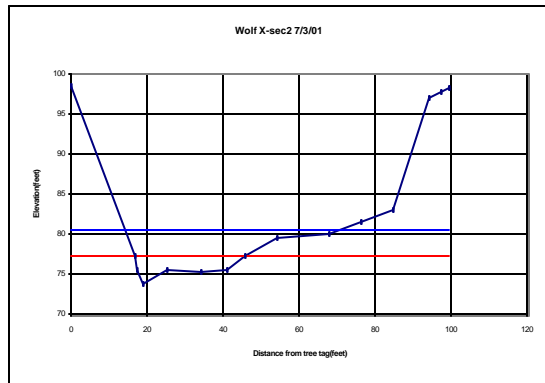

Wolf left stake	7/3/01 depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
0	1.55	98.45	77.17	80.47	TBM-LB
16.9	22.83	77.17	77.17	80.47	BFL
17.5	24.6	75.4	77.17	80.47	LEW
18.8	26.13	73.87	77.17	80.47	T
25	24.61	75.39	77.17	80.47	
34.2	24.74	75.26	77.17	80.47	
41.3	24.54	75.46	77.17	80.47	REW
45.7	22.83	77.17	77.17	80.47	BFR
54.4	20.57	79.43	77.17	80.47	
68	19.89	80.11	77.17	80.47	
76.2	18.43	81.57	77.17	80.47	
84.6	16.97	83.03	77.17	80.47	
94.4	2.88	97.12	77.17	80.47	TOBR
97.3	2.33	97.67	77.17	80.47	
99.5	1.74	98.26	77.17	80.47	

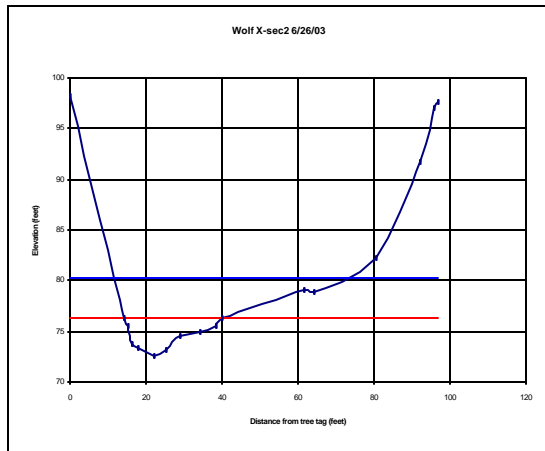


6/26/03 wolf crossect-2 Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	Bankfull elevation	Notes
0	1.86		98.14	76.4	80.33	tbrm
14.3	23.6	0	76.4	76.4	80.33	bf
15.1	24.42	0.82	75.58	76.4	80.33	wel
16.5	26.29	2.69	73.71	76.4	80.33	
18	26.68	3.08	73.32	76.4	80.33	
22	27.53	3.93	72.47	76.4	80.33	t
25	26.77	3.17	73.23	76.4	80.33	
29	25.54	1.94	74.46	76.4	80.33	
34	25.08	1.48	74.92	76.4	80.33	
38.3	24.39	0.79	75.61	76.4	80.33	wer
40.1	23.6	0	76.4	76.4	80.33	bf
61.4	20.85		79.15	76.4	80.33	
64	21.2		78.8	76.4	80.33	
80.3	17.82		82.18	76.4	80.33	
92.2	8.26		91.74	76.4	80.33	
95.6	2.96		97.04	76.4	80.33	tobr
97	2.43		97.57	76.4	80.33	end r

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Three Year SUMMARY							
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Depth Ratio	Flood-prone width	Entrenchment Ratio
1999	2	27.30	1.52	2.00	17.94	33.09	1.21
2001	2	28.80	1.74	3.30	16.50	79.50	2.76
2003	2	25.80	1.99	3.93	12.97	63.50	2.46


UTM X-coord = 676246
 UTM Y-coord = 4445050

Wolf Cr X-sec 3

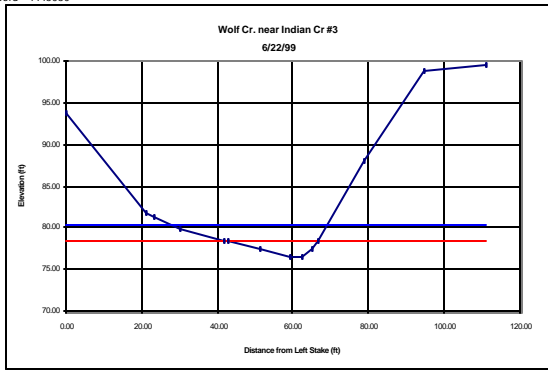


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	93.75	78.39	80.34
21.00	81.83	78.39	80.34
23.00	81.22	78.39	80.34
30.00	79.90	78.39	80.34
42.00	78.44	78.39	80.34
43.00	78.39	78.39	80.34
51.30	77.53	78.39	80.34
59.20	76.44	78.39	80.34
62.50	76.45	78.39	80.34
64.80	77.33	78.39	80.34
66.50	78.39	78.39	80.34
78.80	87.92	78.39	80.34
94.50	98.90	78.39	80.34
111.00	99.58	78.39	80.34

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

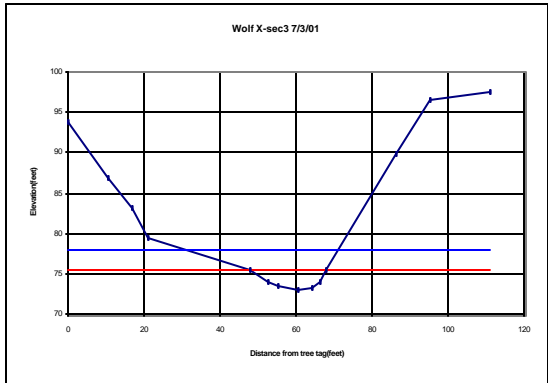

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
0	6.19	93.81	75.44	77.91	TBM-LB
10.5	13.2	86.8	75.44	77.91	TOBL
16.8	16.82	83.18	75.44	77.91	
21.3	20.49	79.51	75.44	77.91	
48.05	24.56	75.44	75.44	77.91	BFL
52.75	26.07	73.93	75.44	77.91	LEW
55.1	26.45	73.55	75.44	77.91	
60.3	27.03	72.97	75.44	77.91	T
64.3	26.67	73.33	75.44	77.91	
66.2	26.07	73.93	75.44	77.91	REW
68.1	24.56	75.44	75.44	77.91	BFR
86.5	10.18	89.82	75.44	77.91	
95	3.48	96.52	75.44	77.91	TOBR
111	2.44	97.56	75.44	77.91	TBM-RB

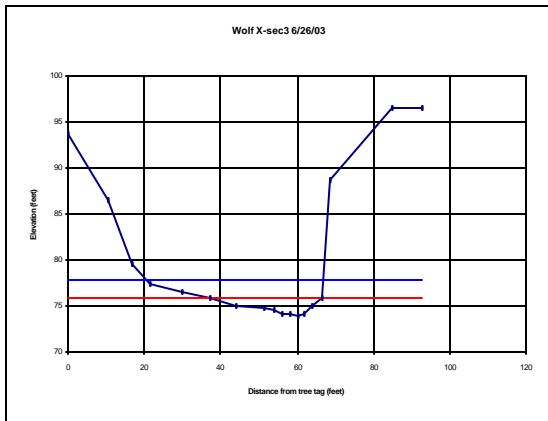


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	Bankfull elevation	Notes
0	6.28		93.72	75.86	77.83	tbrml
10.5	13.55		86.45	75.86	77.83	tbl
16.8	pp			75.86	77.83	
21.3	20.54		79.46	75.86	77.83	
30.1	22.5		77.5	75.86	77.83	
37.3	23.5		76.5	75.86	77.83	
43.8	24.14	0	75.86	75.86	77.83	bfl
51.3	24.96	0.82	75.04	75.86	77.83	wel
54	25.23	1.09	74.77	75.86	77.83	
56	25.45	1.31	74.55	75.86	77.83	
58	25.79	1.65	74.21	75.86	77.83	
60	25.93	1.79	74.07	75.86	77.83	
62	26.11	1.97	73.89	75.86	77.83	t
64	25.91	1.77	74.09	75.86	77.83	
66.7	24.96	0.82	75.04	75.86	77.83	wer
68.6	24.14	0	75.86	75.86	77.83	bfr
85	11.26		88.74	75.86	77.83	
93	3.42		96.58	75.86	77.83	tobr
105	3.54		96.46	75.86	77.83	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg
 all measurements in feet


Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Bankfull Depth	Flood prone width Ratio	Entrenchment Ratio
1999	3	23.50	1.45	1.95	16.18	41.35	1.76
2001	3	20.05	1.58	2.47	12.68	60.80	3.03
2003	3	24.80	1.25	1.97	19.89	45.90	1.85

Indian Cr abv Spanish X-sec 1

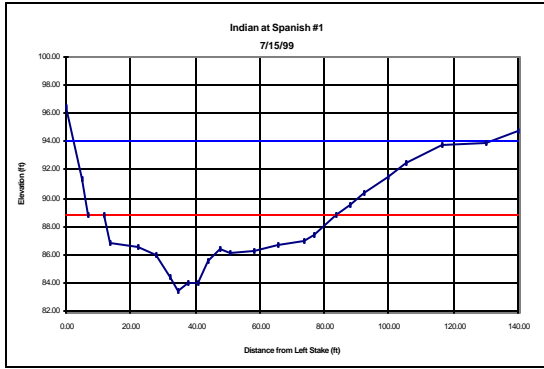


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	96.39	88.77	94.07
5.00	91.33	88.77	94.07
7.10	88.77	88.77	94.07
11.60	88.77	88.77	94.07
13.50	86.79	88.77	94.07
22.50	86.53	88.77	94.07
28.00	85.93	88.77	94.07
32.30	84.48	88.77	94.07
34.70	83.47	88.77	94.07
38.00	83.93	88.77	94.07
40.90	83.92	88.77	94.07
44.10	85.60	88.77	94.07
47.60	86.46	88.77	94.07
51.00	86.12	88.77	94.07
58.20	86.23	88.77	94.07
65.50	86.69	88.77	94.07
73.50	86.89	88.77	94.07
77.00	87.45	88.77	94.07
83.80	88.77	88.77	94.07
88.20	89.51	88.77	94.07
92.50	90.36	88.77	94.07
100.00	91.53	88.77	94.07
105.20	92.43	88.77	94.07
116.60	93.79	88.77	94.07
130.20	93.96	88.77	94.07
140.00	94.82	88.77	94.07

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

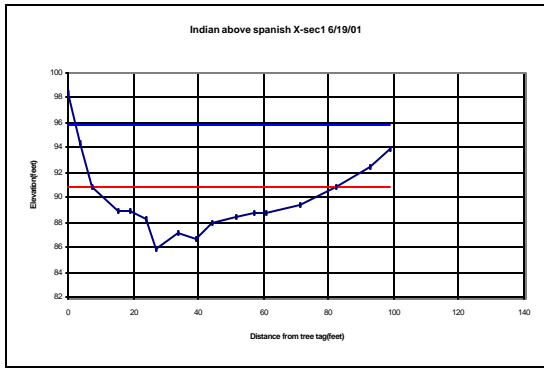

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
0	1.55	98.45	90.89	95.88	TBM-LB
3.5	5.65	94.35	90.89	95.88	
7.6	9.11	90.89	90.89	95.88	BFL
15.6	11.02	88.98	90.89	95.88	
19.2	11.11	88.89	90.89	95.88	LEW
23.8	11.79	88.21	90.89	95.88	
27	14.1	85.9	90.89	95.88	T
33.5	12.93	87.07	90.89	95.88	
39.35	13.36	86.64	90.89	95.88	
44.2	12.1	87.9	90.89	95.88	
51.8	11.65	88.35	90.89	95.88	
57.1	11.26	88.74	90.89	95.88	
60.5	11.18	88.82	90.89	95.88	REW
71.25	10.68	89.32	90.89	95.88	
82.5	9.11	90.89	90.89	95.88	BFR
92.5	7.49	92.51	90.89	95.88	
99.1	6.14	93.86	90.89	95.88	TBM-RB

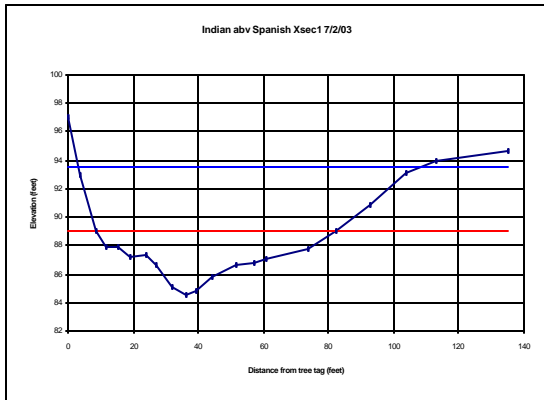

Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	Bankfull elevation	Notes
0	2.94		97.06	89.06	93.57	tbrml
3.5	7.1		92.9	89.06	93.57	
8.5	10.94	0	89.06	89.06	93.57	bfl
11.7	12.09	1.15	87.91	89.06	93.57	wel
15.6	12.16	1.22	87.84	89.06	93.57	
19.2	12.81	1.87	87.19	89.06	93.57	
23.8	12.68	1.74	87.32	89.06	93.57	
27	13.38	2.44	86.62	89.06	93.57	
32	14.88	3.94	85.12	89.06	93.57	
36	15.45	4.51	84.55	89.06	93.57	t
39.3	15.2	4.26	84.8	89.06	93.57	
44.2	14.16	3.22	85.84	89.06	93.57	
51.8	13.33	2.39	86.67	89.06	93.57	
57.1	13.26	2.32	86.74	89.06	93.57	
60.5	13	2.06	87	89.06	93.57	
73.4	12.27	1.33	87.73	89.06	93.57	wer
82.5	10.94	0	89.06	89.06	93.57	bfr
92.5	9.12		90.88	89.06	93.57	
104	6.86		93.14	89.06	93.57	tobr
113	6.03		93.97	89.06	93.57	
135	5.4		94.6	89.06	93.57	endr


TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Three Year SUMMARY							
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Width: Depth Ratio	Flood-prone width Ratio	Entrenchment
1999	1	76.70	2.82	5.30	27.21	129.16	1.68
2001	1	74.90	2.58	4.99	29.03	80.40	1.07
2003	1	74.00	2.32	4.51	31.90	103.40	1.40

UTM X=coord = 672802
 UTM Y=coord = 4432038


Indian Cr abv Spanish X

Dist. From Total Bankfull 2xBankfull

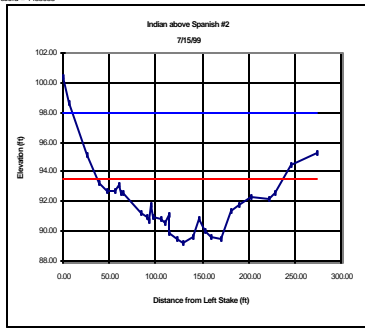


Left Stake	Elevation	Elevation	Elevation
0.00	100.32	93.525	97.9
7.00	98.66	93.525	97.9
25.00	95.20	93.525	97.9
38.00	93.30	93.525	97.9
47.00	92.72	93.525	97.9
56.00	92.73	93.525	97.9
61.00	93.18	93.525	97.9
63.00	92.54	93.525	97.9
64.00	92.61	93.525	97.9
84.00	91.21	93.525	97.9
89.00	90.90	93.525	97.9
93.00	90.65	93.525	97.9
94.70	91.73	93.525	97.9
96.70	91.00	93.525	97.9
106.00	90.77	93.525	97.9
110.00	90.55	93.525	97.9
114.40	91.13	93.525	97.9
115.40	89.87	93.525	97.9
122.20	89.50	93.525	97.9
129.20	89.15	93.525	97.9
140.00	89.60	93.525	97.9
147.00	90.84	93.525	97.9
153.00	90.02	93.525	97.9
160.00	89.56	93.525	97.9
170.50	89.53	93.525	97.9
180.50	91.41	93.525	97.9
190.20	91.73	93.525	97.9
203.30	92.36	93.525	97.9
222.20	92.12	93.525	97.9
229.20	92.61	93.525	97.9
246.00	94.44	93.525	97.9
275.00	95.21	93.525	97.9

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

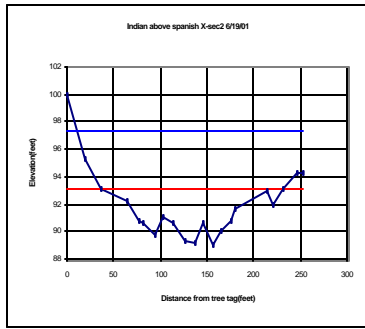

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
1	0.02	99.98	93.15	97.31	TBMLB
19.65	4.72	95.28	93.15	97.31	TCB-LB
36.8	6.85	93.15	93.15	97.31	BFL
65	7.83	92.17	93.15	97.31	
76.3	9.28	90.72	93.15	97.31	
80.9	9.37	90.63	93.15	97.31	LEW
94.6	10.22	89.78	93.15	97.31	
102.15	8.97	91.03	93.15	97.31	
114.5	9.42	90.58	93.15	97.31	
126.2	10.71	89.29	93.15	97.31	
137.6	10.79	89.21	93.15	97.31	
145.3	9.4	89.6	93.15	97.31	
155.55	11.01	88.99	93.15	97.31	T
164.9	10.03	89.97	93.15	97.31	
175.13	9.22	90.78	93.15	97.31	REW
179.75	8.3	91.7	93.15	97.31	
213.8	6.98	93.02	93.15	97.31	
220.3	8.07	91.88	93.15	97.31	
231.75	6.85	93.15	93.15	97.31	BFR
246	5.79	94.21	93.15	97.31	TCB-RB
253.7	5.8	94.2	93.15	97.31	TBM-RB

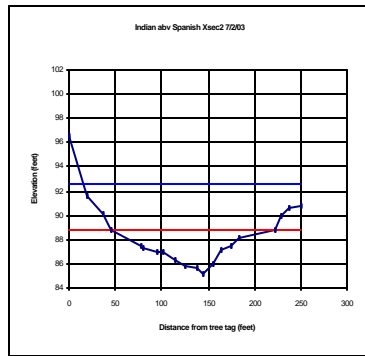

Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	3.42		90.58	89.06	92.62	tbml
19.65	8.4		91.6	89.06	92.62	tbl
36.8	9.92		90.08	89.06	92.62	
44.3	11.14	0	88.96	89.06	92.62	bf
76.5	12.45	1.31	87.55	89.06	92.62	well
80.9	12.88	1.54	87.32	89.06	92.62	
94.6	13.1	1.96	86.9	89.06	92.62	
102.5	13.03	1.89	86.97	89.06	92.62	
114.5	13.73	2.59	86.27	89.06	92.62	
126	14.23	3.09	85.77	89.06	92.62	
137.5	14.31	3.17	85.69	89.06	92.62	
145	14.9	3.76	85.1	89.06	92.62	t
155.5	14.02	2.88	85.98	89.06	92.62	
164.9	12.97	1.73	87.13	89.06	92.62	
174.4	12.45	1.31	87.55	89.06	92.62	wer
183	11.87	0.73	88.13	89.06	92.62	
223	11.14	0	88.96	89.06	92.62	bf
228	10.1		89.9	89.06	92.62	
237	9.34		90.66	89.06	92.62	
250	9.22		90.78	89.06	92.62	tblrend

TOPipe=Top of pipe/bench mark

LEW=Left edge of water

REW=Right edge of water

MPD=Maximum pool depth

TBM=Temporary bench mark

PCT=Pool tail crest

TP=Turning point

TOPool=Top of pool

S-MAX=Max. depth sediment tenser

LB=Left bank

RB=Right bank

TCB=Top of bank


BF=Bankfull

T=Thalweg

Three Year SUMMAR1						
Year	sector	Width	Depth	Depth Ratio	width	Ratio
1999	2	#####	1.93	3.46	94.37	#####
2001	2	#####	2.30	4.16	84.30	#####
2003	2	#####	2.00	3.76	89.49	#####


UTM X-coord = 672974
 UTM Y-coord = 4435197

Indian Cr abv Spanish X-sec 3

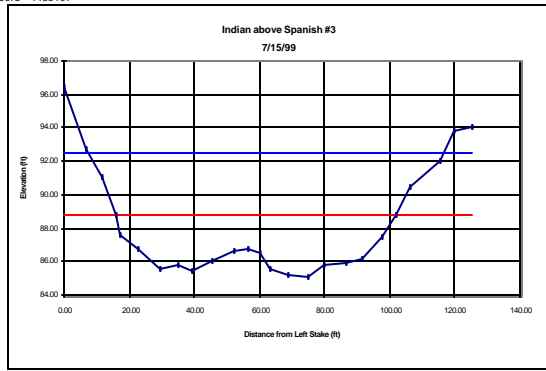


Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	96.45	88.79	92.53
7.00	92.73	88.79	92.53
11.90	91.05	88.79	92.53
16.10	88.79	88.79	92.53
16.90	87.59	88.79	92.53
22.70	86.79	88.79	92.53
29.60	85.59	88.79	92.53
34.90	85.80	88.79	92.53
39.50	85.44	88.79	92.53
45.50	86.00	88.79	92.53
52.00	86.60	88.79	92.53
56.20	86.76	88.79	92.53
60.00	86.55	88.79	92.53
63.00	85.57	88.79	92.53
68.70	85.15	88.79	92.53
74.80	85.05	88.79	92.53
80.00	85.74	88.79	92.53
86.50	85.86	88.79	92.53
91.50	86.19	88.79	92.53
97.80	87.47	88.79	92.53
102.10	88.79	88.79	92.53
106.20	90.51	88.79	92.53
115.50	91.96	88.79	92.53
119.50	93.83	88.79	92.53
125.00	94.09	88.79	92.53

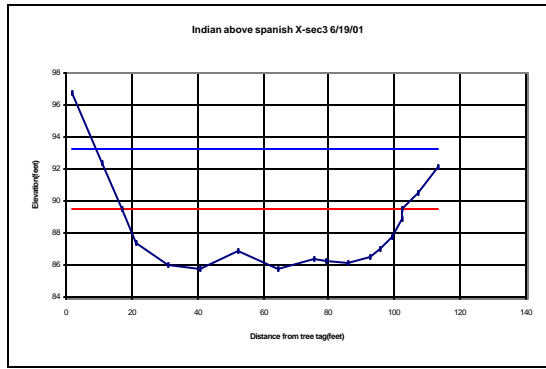

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
2	3.2	96.8	89.46	93.21	TBM-LB
10.7	7.65	92.35	89.46	93.21	TOB-LB
17.2	10.54	89.46	89.46	93.21	BFL
21.3	12.59	87.41	89.46	93.21	LEW
31.2	13.99	86.01	89.46	93.21	
41	14.28	85.72	89.46	93.21	T
52.2	13.14	86.86	89.46	93.21	
64.4	14.21	85.79	89.46	93.21	
75.6	13.64	86.36	89.46	93.21	
79	13.73	86.27	89.46	93.21	
85.9	13.91	86.09	89.46	93.21	
92.3	13.44	86.56	89.46	93.21	
95.8	13.01	86.99	89.46	93.21	REW
99	12.22	87.78	89.46	93.21	
102	11.09	88.91	89.46	93.21	
102.3	10.54	89.46	89.46	93.21	BFR
107	9.46	90.54	89.46	93.21	
113	7.92	92.08	89.46	93.21	

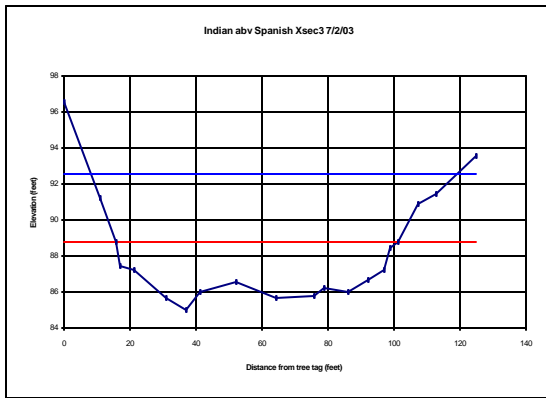


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	Bankfull elevation	Notes
0	3.4		96.6	88.77	92.52	tbrml
10.7	8.79		91.21	88.77	92.52	tbl
15.5	11.23	0	88.77	88.77	92.52	bfl
17	12.54	1.31	87.46	88.77	92.52	wel
21.3	12.79	1.56	87.21	88.77	92.52	
31.2	14.31	3.08	85.69	88.77	92.52	
36.8	14.98	3.75	85.02	88.77	92.52	t
41	14.04	2.81	85.96	88.77	92.52	
52.2	13.48	2.25	86.52	88.77	92.52	
64.4	14.28	3.05	85.72	88.77	92.52	
75.6	14.23	3	85.77	88.77	92.52	
79	13.76	2.53	86.24	88.77	92.52	
85.9	14	2.77	86	88.77	92.52	
92.3	13.38	2.15	86.62	88.77	92.52	
96.9	12.73	1.5	87.27	88.77	92.52	wer
99	11.6	0.37	88.4	88.77	92.52	
101.5	11.23	0	88.77	88.77	92.52	br
107	9.08		90.92	88.77	92.52	
113	8.53		91.47	88.77	92.52	
125	6.45		93.55	88.77	92.52	endr

TOP=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOP=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Three Year SUMMARY							
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Flood-prone Ratio	Entrenchment Ratio	
1999	3	86.00	2.66	3.74	32.38	109.14	1.27
2001	3	83.10	2.52	3.75	32.97	104.30	1.25
2003	3	86.00	2.15	3.75	39.96	108.00	1.26


UTM X-coord = 669002
 UTM Y-coord = 4423141

Rock Cr (Spanish Trib) X-sec 1

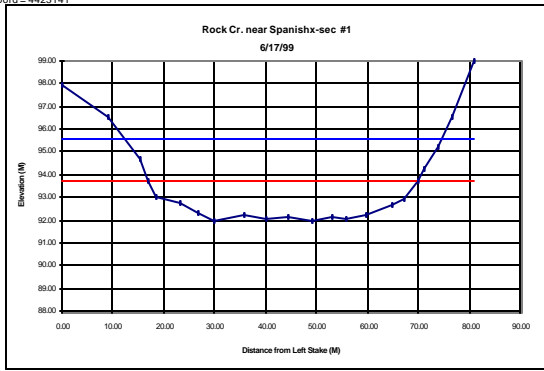


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	97.93	93.7336	95.53806
9.10	96.52	93.7336	95.53806
15.20	94.69	93.7336	95.53806
17.00	93.73	93.7336	95.53806
18.60	92.98	93.7336	95.53806
23.00	92.78	93.7336	95.53806
26.90	92.32	93.7336	95.53806
29.90	91.99	93.7336	95.53806
35.60	92.19	93.7336	95.53806
39.90	92.03	93.7336	95.53806
44.50	92.16	93.7336	95.53806
49.20	91.93	93.7336	95.53806
53.00	92.09	93.7336	95.53806
56.00	92.03	93.7336	95.53806
59.60	92.19	93.7336	95.53806
64.70	92.65	93.7336	95.53806
67.20	92.95	93.7336	95.53806
69.80	93.73	93.7336	95.53806
71.00	94.29	93.73	95.53806
74.00	95.21	93.7336	95.53806
76.70	96.52	93.7336	95.53806
81.00	98.98	93.7336	95.53806

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

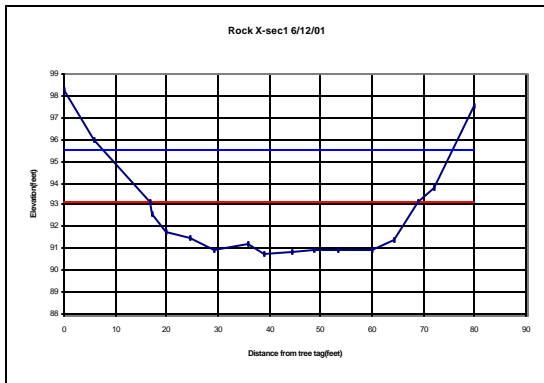

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
0	1.7	98.3	93.12	95.48	TBM-LB
6	3.99	96.01	93.12	95.48	
16.9	6.88	93.12	93.12	95.48	BFL
17.3	7.42	92.58	93.12	95.48	
19.7	8.24	91.76	93.12	95.48	
24.7	8.55	91.45	93.12	95.48	LEW
29.3	9.07	90.93	93.12	95.48	
35.8	8.79	91.21	93.12	95.48	
38.9	9.24	90.76	93.12	95.48	T
44.3	9.16	90.84	93.12	95.48	
48.8	9.09	90.91	93.12	95.48	
53.4	9.06	90.94	93.12	95.48	
60	9.03	90.97	93.12	95.48	
64.4	8.6	91.4	93.12	95.48	REW
69	6.88	93.12	93.12	95.48	BFR
72	6.2	93.8	93.12	95.48	
80	2.43	97.57	93.12	95.48	End

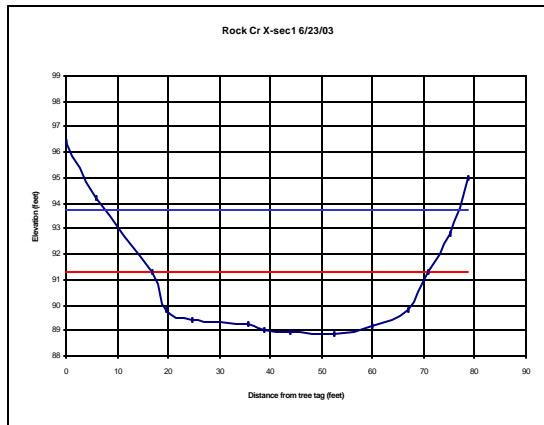


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x bankfull elevation	Notes
0	3.59		96.41	91.3	93.7	tbm
6	5.83		94.17	91.3	93.7	
16.9	8.7	0	91.3	91.3	93.7	bfl
19.7	10.17	1.47	89.83	91.3	93.7	wel
24.7	10.59	1.89	89.41	91.3	93.7	
35.8	10.72	2.02	89.28	91.3	93.7	
38.9	11	2.3	89	91.3	93.7	
44	11.09	2.39	88.91	91.3	93.7	
52.6	11.1	2.4	88.9	91.3	93.7	t
60	10.82	2.12	89.18	91.3	93.7	
67	10.2	1.5	89.8	91.3	93.7	wer
70.9	8.7	0	91.3	91.3	93.7	bfr
75	7.21		92.79	91.3	93.7	
78.8	5.02		94.98	91.3	93.7	end

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg
 all measurements in feet

Year	Cross-section	Bankfull		Bankfull Depth	Width: Flood- prone	Entrenchment Ratio
		Width	Depth			
1999	1	52.80	1.40	1.80	37.74	1.18
2001	1	52.10	1.71	2.36	30.46	1.30
2003	1	54.00	1.79	2.40	30.21	1.23


UTM X-coord = 668844
 UTM Y-coord = 4423052

Rock Cr (Spanish trib) X-sec 2

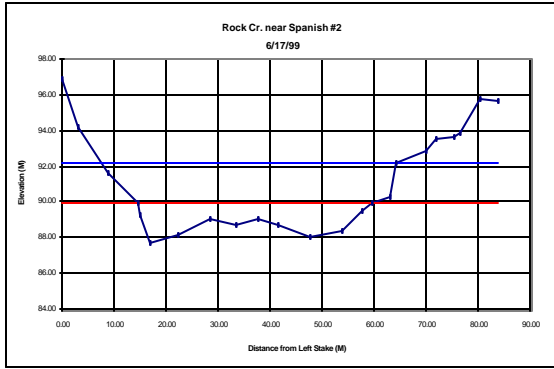


Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	96.88	89.94423	92.15879
3.00	94.16	89.94423	92.15879
9.00	91.60	89.94423	92.15879
14.60	89.94	89.94423	92.15879
15.00	89.30	89.94423	92.15879
17.00	87.73	89.94423	92.15879
22.30	88.12	89.94423	92.15879
28.40	89.09	89.94423	92.15879
33.30	88.68	89.94423	92.15879
37.80	89.07	89.94423	92.15879
41.60	88.71	89.94423	92.15879
47.80	87.99	89.94423	92.15879
53.90	88.32	89.94423	92.15879
57.50	89.44	89.94423	92.15879
59.60	89.94	89.94423	92.15879
63.00	90.26	89.94423	92.15879
64.40	92.13	89.94423	92.15879
70.10	92.85	89.94423	92.15879
71.90	93.54	89.94	92.15879
75.40	93.62	89.94423	92.15879
76.60	93.83	89.94423	92.15879
80.30	95.80	89.94423	92.15879
84.00	95.67	89.94423	92.15879

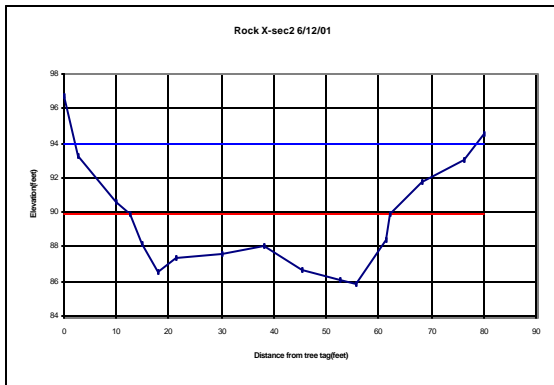

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
0	3.25	96.75	89.89	93.93	TBM-LB
2.8	6.77	93.23	89.89	93.93	
9.8	9.4	90.6	89.89	93.93	
12.7	10.11	89.89	89.89	93.93	BFL
14.8	11.84	88.16	89.89	93.93	LEW
17.85	13.4	86.6	89.89	93.93	
21.4	12.65	87.35	89.89	93.93	
29.95	12.42	87.58	89.89	93.93	
38	11.94	88.06	89.89	93.93	
45.2	13.34	86.66	89.89	93.93	
52.7	13.95	86.05	89.89	93.93	
55.5	14.15	85.85	89.89	93.93	T
61.5	11.59	88.41	89.89	93.93	REW
62.25	10.11	89.89	89.89	93.93	BFR
68.4	8.24	91.76	89.89	93.93	TOBR
76.1	6.92	93.08	89.89	93.93	
80	5.45	94.55	89.89	93.93	TBM-RB

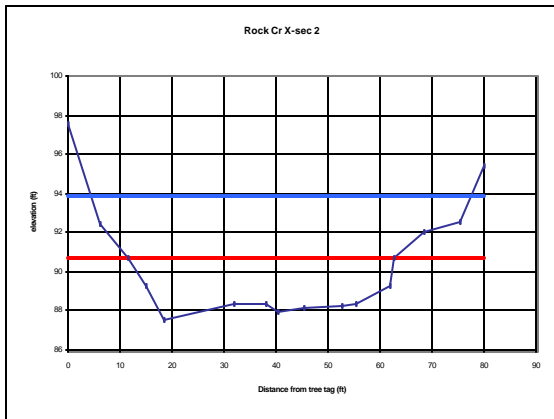


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	Bankfull elevation	Notes
0	2.42		97.58	90.72	93.89	tbr
6.1	7.58		92.42	90.72	93.89	
11.4	9.28	0	90.72	90.72	93.89	bfl
15	10.74	1.46	89.26	90.72	93.89	wel
18.5	12.45	3.17	87.55	90.72	93.89	t
32	11.67	2.39	88.33	90.72	93.89	
38	11.6	2.32	88.4	90.72	93.89	
40.5	12.01	2.73	87.99	90.72	93.89	
45.2	11.85	2.57	88.15	90.72	93.89	
52.7	11.75	2.47	88.25	90.72	93.89	
55.5	11.63	2.35	88.37	90.72	93.89	
62	10.78	1.5	89.22	90.72	93.89	wel
62.5	9.28	0	90.72	90.72	93.89	bfl
68.5	7.98		92.02	90.72	93.89	
75.5	7.5		92.5	90.72	93.89	to br
80	4.6		95.4	90.72	93.89	end

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Year	Cross-section	Bankfull		Bankfull Depth	Width Ratio	Flood-prone width	Entrenchment Ratio
		Width	Depth				
1999	2	45.00	1.29	2.21	34.82	56.97	1.27
2001	2	49.55	2.43	4.04	20.39	75.40	1.52
2003	2	51.10	2.10	3.17	24.38	74.00	1.45


UTM X-coord = 668631
 UTM Y-coord = 4422813

Rock Cr (Spanish trib) X-sec 3

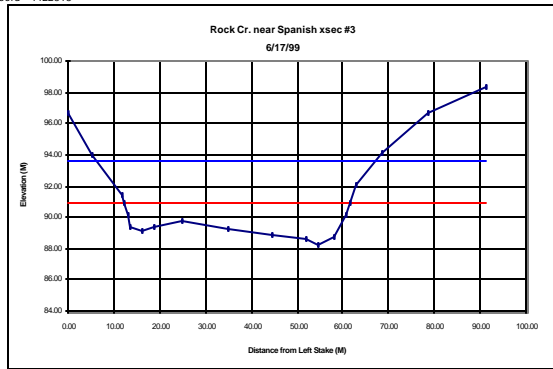


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	96.65	90.91207	93.53675
5.15	94.03	90.91207	93.53675
12.00	91.40	90.91207	93.53675
12.10	90.91	90.91207	93.53675
13.00	90.12	90.91207	93.53675
13.60	89.44	90.91207	93.53675
16.00	89.14	90.91207	93.53675
18.80	89.34	90.91207	93.53675
25.00	89.80	90.91207	93.53675
35.00	89.30	90.91207	93.53675
44.70	88.81	90.91207	93.53675
52.00	88.58	90.91207	93.53675
54.80	88.29	90.91207	93.53675
58.00	88.78	90.91207	93.53675
60.70	90.12	90.91207	93.53675
61.45	90.91	90.91207	93.53675
62.80	92.06	90.91207	93.53675
68.60	94.13	90.91207	93.53675
78.60	96.65	90.91	93.53675
91.20	98.36	90.91207	93.53675

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

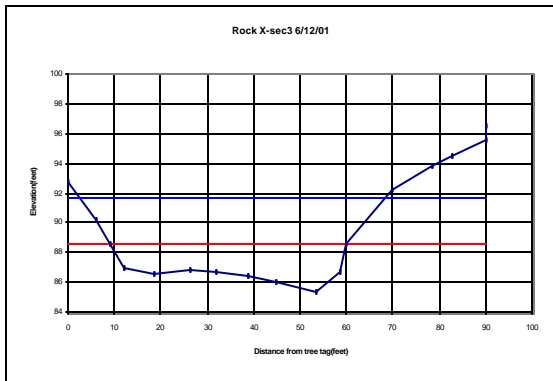

Rock left stake	6/12/01 depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
0	7.32	92.68	88.54	91.7	TBM-LB
6.1	9.85	90.15	88.54	91.7	TOBL
9.2	11.46	88.54	88.54	91.7	BFL
12	13.03	86.97	88.54	91.7	
18.5	13.42	86.58	88.54	91.7	
26.4	13.12	86.88	88.54	91.7	
32	13.32	86.68	88.54	91.7	LEW
39	13.63	86.37	88.54	91.7	
45	13.95	86.05	88.54	91.7	
53.3	14.62	85.38	88.54	91.7	T
58.6	13.32	86.68	88.54	91.7	REW
59.8	11.46	88.54	88.54	91.7	BFR
70	7.85	92.15	88.54	91.7	TOBR
78.4	6.15	93.85	88.54	91.7	
82.7	5.5	94.5	88.54	91.7	
89.9	4.5	95.5	88.54	91.7	
89.9	3.56	96.44	88.54	91.7	TBM-RB

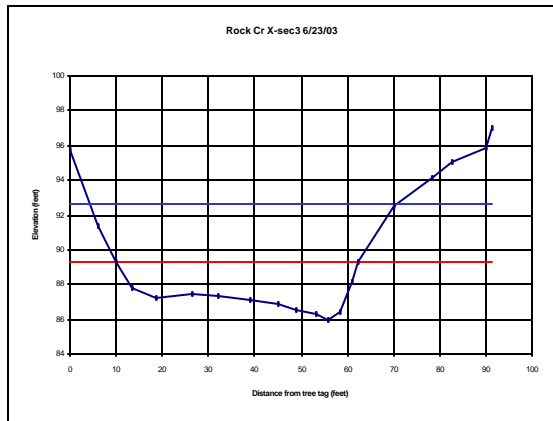


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	Bankfull elevation	Notes
0	4.28		95.72	89.29	92.62	tbr
6.1	8.61		91.39	89.29	92.62	
10	10.71	0	89.29	89.29	92.62	bfl
13.5	12.18	1.47	87.82	89.29	92.62	wel
18.5	12.72	2.01	87.28	89.29	92.62	
26.4	12.55	1.84	87.45	89.29	92.62	
32	12.63	1.92	87.37	89.29	92.62	
39	12.89	2.18	87.11	89.29	92.62	
45	13.15	2.44	86.85	89.29	92.62	
49	13.44	2.73	86.56	89.29	92.62	
53.3	13.75	3.04	86.25	89.29	92.62	
55.9	14.04	3.33	85.96	89.29	92.62	t
58.6	13.56	2.85	86.44	89.29	92.62	
61	11.82	1.11	88.18	89.29	92.62	wer
62.5	10.71	0	89.29	89.29	92.62	bfr
70	7.45		92.55	89.29	92.62	
78.4	5.87		94.13	89.29	92.62	
82.7	5		95	89.29	92.62	
89.9	4.17		95.83	89.29	92.62	
91.4	2.95		97.05	89.29	92.62	tbr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Three Year SUMMARY						
Year	Cross-section	Bankfull Width	Bankfull Depth	Max Bankfull Depth	Flood-prone width	Entrenchment Ratio
1999	3	49.35	1.66	2.62	29.70	60.51
2001	3	50.60	1.90	3.16	26.60	65.80
2003	3	52.50	2.08	3.33	25.28	66.80


UTM X-coord = 678091
 UTM Y-coord = 4425831

Greenhorn Cr X-sec 1

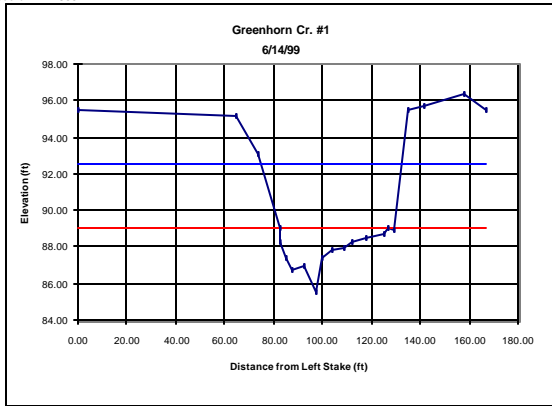


Dist. From Total	Bankfull	2xBankfull
Left Stake	Elevation	Elevation
0.00	95.54	89.00919
65.00	95.21	89.00919
73.30	93.08	89.00919
83.00	89.01	89.00919
83.00	88.22	89.00919
85.30	87.37	89.00919
87.20	86.68	89.00919
92.20	86.94	89.00919
97.00	85.50	89.00919
100.00	87.34	89.00919
103.60	87.86	89.00919
109.00	87.93	89.00919
112.40	88.25	89.00919
117.90	88.45	89.00919
125.10	88.68	89.00919
126.90	89.01	89.00919
129.60	88.91	89.00919
134.60	95.47	89.00919
141.40	95.70	89.01
158.20	96.36	89.00919
166.70	95.51	89.00919

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

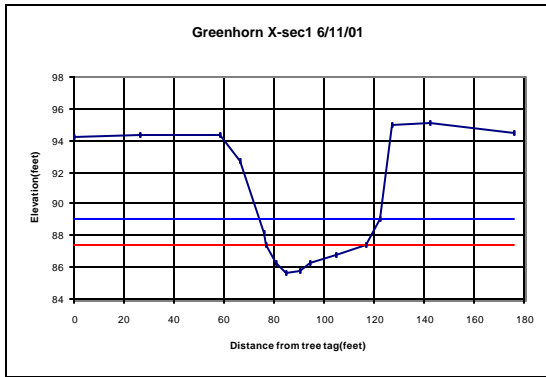

June 11, 2001 Cross-section measurement

Dist. From Total	Total	Bankfull	2xBankfull	Notes
left stake	Depth	Elevation	Elevation	Elevation
0	5.8	94.2	87.36	89.02 TBM
26	5.68	94.32	87.36	89.02
58	5.63	94.37	87.36	89.02 TOBL
66.5	7.27	92.73	87.36	89.02
75.6	11.88	88.12	87.36	89.02
76.7	12.64	87.36	87.36	89.02 BFL
80.5	13.75	86.25	87.36	89.02 WEL
85	14.3	85.7	87.36	89.02 T
90.5	14.22	85.78	87.36	89.02
94.5	13.7	86.3	87.36	89.02 WER
105	13.2	86.8	87.36	89.02
116.4	12.64	87.36	87.36	89.02 BFR
122.7	10.93	89.07	87.36	89.02
127	5.08	94.92	87.36	89.02 TOBR
142	4.85	95.15	87.36	89.02
176	5.57	94.43	87.36	89.02 END

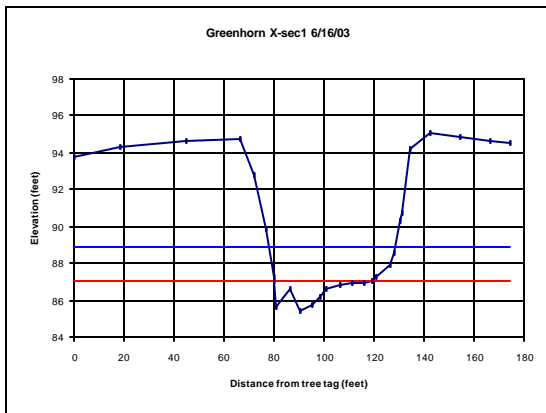

6/16/03 green hon Xsect-1


Dist from Total	Bankfull	Total	Bankfull	bankfull	Notes
left stake	Depth	depth	elevation	elevation	elevation
0	6.2		93.8	87.03	88.85 tbn lb
18	5.67		94.33	87.03	88.85
45	5.35		94.65	87.03	88.85
66	5.29		94.71	87.03	88.85 tobl
72	7.19		92.81	87.03	88.85
76.5	10.18		89.82	87.03	88.85
80	12.72	0	87.28	87.03	88.85 bfl
80.1	12.97	0.25	87.03	87.03	88.85 wel
80.62	14.33	1.61	85.67	87.03	88.85
86.4	13.44	0.72	86.56	87.03	88.85
90.7	14.54	1.82	85.46	87.03	88.85 t
95	14.24	1.52	85.76	87.03	88.85
98	13.78	1.06	86.22	87.03	88.85
101.15	13.41	0.69	86.59	87.03	88.85
106.35	13.16	0.44	86.84	87.03	88.85
111.1	13.03	0.31	86.97	87.03	88.85
115.8	13.05	0.33	86.95	87.03	88.85
119.2	12.94	0.22	87.06	87.03	88.85 wer
120.6	12.72	0	87.28	87.03	88.85 bfr
126	12.13		87.87	87.03	88.85
127.8	11.46		88.54	87.03	88.85
130.2	9.73		90.27	87.03	88.85
131.05	9.22		90.78	87.03	88.85
134.2	5.78		94.22	87.03	88.85 tobr
142	4.95		95.05	87.03	88.85
154.5	5.14		94.86	87.03	88.85
166	5.35		94.65	87.03	88.85
174	5.5		94.5	87.03	88.85

all measurements in feet

Year	section	Width	Bankfull Depth	Bankfull Depth	Bankfull Depth	Flood- prone Ratio	Entrench ment Ratio
1999	1	43.90	1.44	3.51	30.39	57.72	1.31
2001	1	40.30	1.00	1.66	40.50	48.80	1.21
2003	1	39.10	0.75	1.82	52.13	50.70	1.30


TOP=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Greenhorn Cr X-sec 2

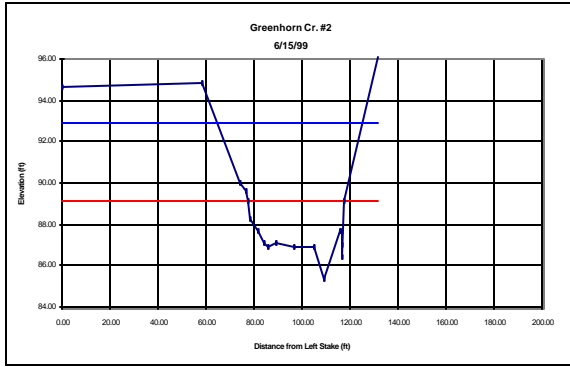


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	94.62	89.14042	92.88058
58.00	94.85	89.14042	92.88058
74.40	89.96	89.14042	92.88058
76.50	89.63	89.14042	92.88058
77.70	89.14	89.14042	92.88058
78.20	88.25	89.14042	92.88058
81.80	87.63	89.14042	92.88058
84.00	87.14	89.14042	92.88058
85.80	86.94	89.14042	92.88058
88.90	87.11	89.14042	92.88058
97.00	86.91	89.14042	92.88058
104.80	86.88	89.14042	92.88058
109.20	85.40	89.14042	92.88058
116.00	87.66	89.14042	92.88058
116.40	87.70	89.14042	92.88058
116.80	87.04	89.14042	92.88058
117.00	86.38	89.14042	92.88058
117.70	89.14	89.14042	92.88058
132.00	96.10	89.14	92.88058
145.00	99.80	89.14042	92.88058

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

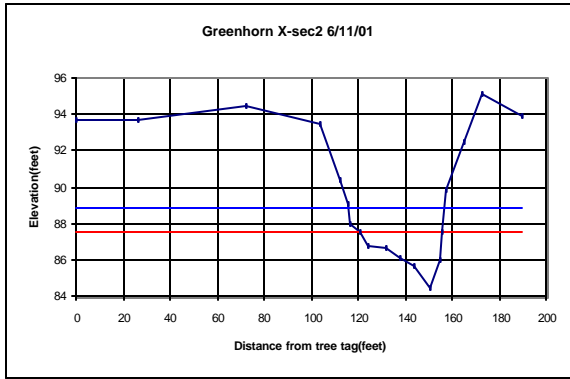

June 11, 2001 Cross-Section Measurements

Dist. From Left Stake	Total Depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	6.35	93.65	87.48	88.86	TBM
26	6.36	93.64	87.48	88.86	
72	5.57	94.43	87.48	88.86	
104	6.52	93.48	87.48	88.86	TOBL
112	9.64	90.36	87.48	88.86	
115.6	10.9	89.1	87.48	88.86	
117	12.01	87.99	87.48	88.86	
120.5	12.52	87.48	87.48	88.86	BFL
124.1	13.28	86.72	87.48	88.86	
131.6	13.39	86.61	87.48	88.86	
138.2	13.89	86.11	87.48	88.86	WEL
143.9	14.35	85.65	87.48	88.86	
150.3	15.61	84.39	87.48	88.86	T
154.6	14.04	85.96	87.48	88.86	WER
155.9	12.52	87.48	87.48	88.86	BFR
157.6	10.21	89.79	87.48	88.86	
165.3	7.55	92.45	87.48	88.86	
172.4	4.84	95.16	87.48	88.86	TOBR
190	6.12	93.88	87.48	88.86	END

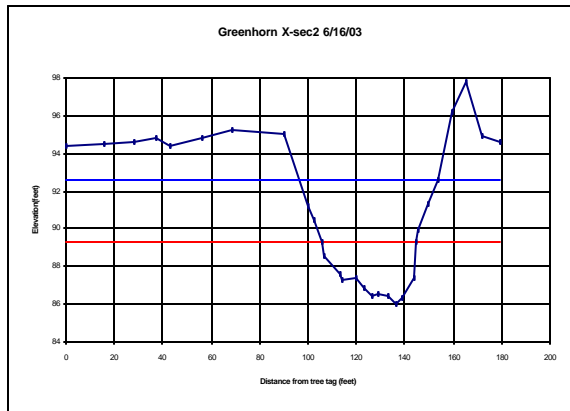

6/16/03 greenhorn x-sec2

Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	Bankfull elevation	Notes
0	5.61		94.39	89.3	92.56	tbr
16	5.45		94.55	89.3	92.56	
28	5.38		94.62	89.3	92.56	
37.5	5.23		94.77	89.3	92.56	
42.6	5.65		94.35	89.3	92.56	
56.3	5.15		94.85	89.3	92.56	
68.8	4.75		95.25	89.3	92.56	
89.9	4.93		95.07	89.3	92.56	tbl
100	8.74		91.26	89.3	92.56	
102.5	9.54		90.46	89.3	92.56	
105.9	10.7		89.3	89.3	92.56	bfl
106.3	11.42	1.71	88.58	89.3	92.56	
113	12.41	1.98	87.59	89.3	92.56	
114	12.68	1.93	87.32	89.3	92.56	wel
120.2	12.63	2.39	87.37	89.3	92.56	
123.2	13.09	2.81	86.91	89.3	92.56	
126.1	13.51	2.77	86.49	89.3	92.56	
128.9	13.47	2.84	86.53	89.3	92.56	
133.1	13.54	3.26	86.46	89.3	92.56	
136.1	13.96	2.95	86.04	89.3	92.56	t
138.95	13.65	1.91	86.35	89.3	92.56	
143.8	12.61	0	87.39	89.3	92.56	wer
144.8	10.7	-0.63	89.3	89.3	92.56	bfl
145.7	10.07		89.93	89.3	92.56	
149.3	8.69		91.31	89.3	92.56	
153.4	7.44		92.56	89.3	92.56	
159.5	3.8		96.2	89.3	92.56	toBR
165	2.21		97.79	89.3	92.56	
172.3	5.11		94.89	89.3	92.56	
179	5.35		94.65	89.3	92.56	end


all measurements in feet

- TOP=Top of pipe/bench mark
- LEW=Left edge of water
- REW=Right edge of water
- MPD=Maximum pool depth
- TBM=Temporary bench mark
- PCT=Pool tail crest
- TP=Turning point
- TOP=Top of pool
- S-MAX=Max depth sediment lens
- LB=Left bank
- RB=Right bank
- TOB=Top of bank
- BF=Bankfull
- T=Thalweg

Three Year SUMMARY		Mean	Max	Width:	Flood-	Entrenc
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Ratio	ment Ratio
1999	2	40.00	2.05	3.74	19.49	60.79
2001	2	35.40	1.30	1.38	27.20	46.20
2003	2	38.90	2.10	3.26	18.52	55.80


UTM X-coord = 678221
 UTM Y-coord = 4425656

Greenhorn Cr X-sec 3

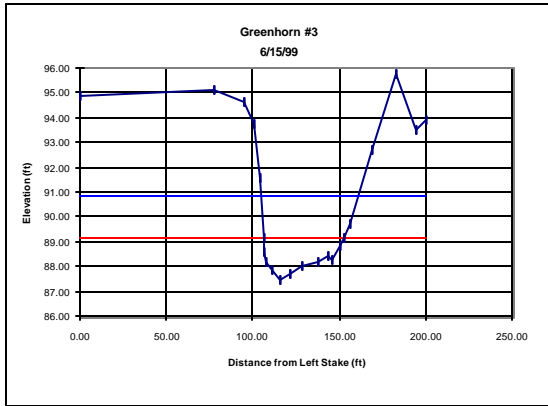


Dist. From Total	Bankfull	2xBankfull
Left Stake	Elevation	Elevation
0.00	94.85	89.14042
77.30	95.14	89.14042
95.00	94.62	89.14042
100.70	93.73	89.14042
104.20	91.57	89.14042
106.30	89.14	89.14042
106.90	88.62	89.14042
107.80	88.16	89.14042
111.10	87.86	89.14042
115.30	87.43	89.14042
122.00	87.70	89.14042
129.00	87.99	89.14042
138.00	88.16	89.14042
143.00	88.42	89.14042
145.60	88.29	89.14042
151.00	88.85	89.14042
153.10	89.14	89.14042
156.00	89.73	89.14042
168.50	92.72	89.14
183.00	95.77	89.14042
194.00	93.47	89.14042
200.00	93.90	89.14042

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line wMarkers=Basic Cross Section

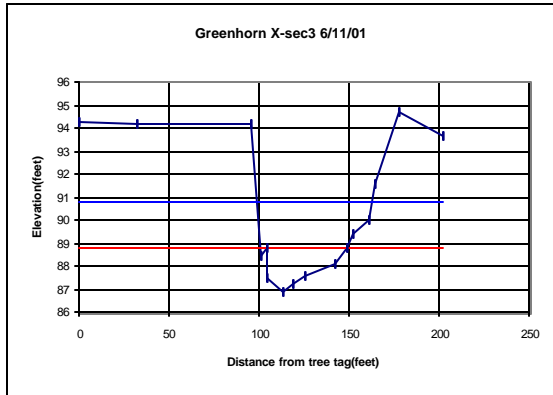

Dist. From Total	Total	Bankfull	2xBankfull	Notes
Left Stake	Depth	Elevation	Elevation	Elevation
0	5.77	94.23	88.82	90.81 TBM
32	5.82	94.18	88.82	90.81
96	5.86	94.14	88.82	90.81 TOBL
101.4	11.53	88.47	88.82	90.81
104.8	11.18	88.82	88.82	90.81 BFL
104.9	12.52	87.48	88.82	90.81 WEL
112.8	13.17	86.83	88.82	90.81 T
118.5	12.75	87.25	88.82	90.81
125	12.44	87.56	88.82	90.81
142.7	11.92	88.08	88.82	90.81 WER
148.9	11.18	88.82	88.82	90.81 BFR
152.5	10.64	89.36	88.82	90.81
161	9.98	90.02	88.82	90.81
164.3	8.44	91.56	88.82	90.81
177.4	5.32	94.68	88.82	90.81 TOBR
202	6.33	93.67	88.82	90.81 END

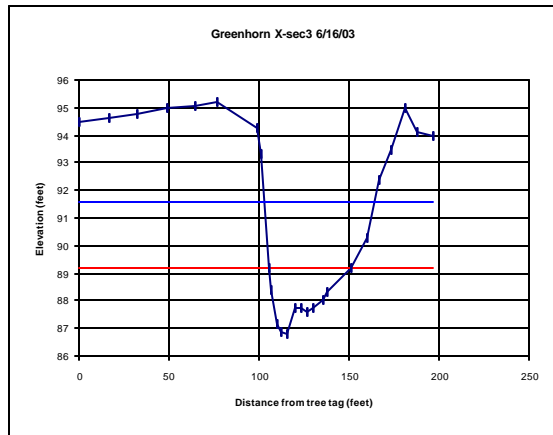

6/16/03 Greenhorn Xsect-3


Dist from Total	Bankfull	Total	Bankfull	bankfull	Notes
left stake	Depth	depth	elevation	elevation	elevation
0	5.5		94.5	89.2	91.57 tbrn
17	5.39		94.61	89.2	91.57
32.5	5.26		94.74	89.2	91.57
49	5.05		94.95	89.2	91.57
64	4.92		95.08	89.2	91.57
77	4.79		95.21	89.2	91.57
98.4	5.77		94.23	89.2	91.57 tobl
101	6.68		93.32	89.2	91.57
105.1	10.8	0	89.2	89.2	91.57 bfl
106.7	11.6	0.8	88.4	89.2	91.57 wel
110.4	12.81	2.01	87.19	89.2	91.57
112.1	13.14	2.34	86.86	89.2	91.57
115.6	13.17	2.37	86.83	89.2	91.57
119.5	12.29	1.49	87.71	89.2	91.57
123	12.26	1.46	87.74	89.2	91.57
127	12.42	1.62	87.58	89.2	91.57
130.2	12.29	1.49	87.71	89.2	91.57
135	11.96	1.16	88.04	89.2	91.57 wer
137.3	11.67	0.87	88.33	89.2	91.57
151	10.8	0	89.2	89.2	91.57 bfr
159.6	9.75		90.25	89.2	91.57
166.5	7.61		92.39	89.2	91.57
173.6	6.53		93.47	89.2	91.57
180.6	5		95	89.2	91.57 tobr
187.7	5.9		94.1	89.2	91.57
196.5	6.02		93.98	89.2	91.57 end

all measurements in feet

Year	section	Width	Bankfull Depth	Bankfull Ratio	Bankfull width	Flood-prone	Entrenchment
1999	3	46.80	0.99	1.71	47.10	55.85	1.19
2001	3	44.10	1.15	1.99	38.30	65.00	1.47
2003	3	45.90	1.41	2.37	32.55	60.70	1.32


TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

UTM X-coord = 673368
 UTM Y-coord = 4432362

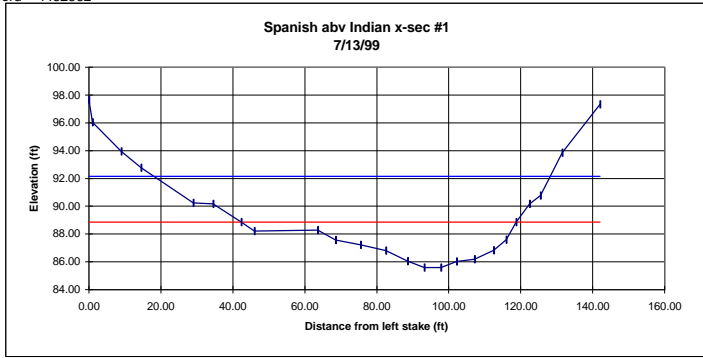


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	97.65	88.86	92.14
1.00	96.05	88.86	92.14
9.00	93.94	88.86	92.14
14.50	92.76	88.86	92.14
29.00	90.25	88.86	92.14
34.50	90.17	88.86	92.14
42.30	88.86	88.86	92.14
46.00	88.21	88.86	92.14
63.60	88.29	88.86	92.14
68.60	87.56	88.86	92.14
75.50	87.23	88.86	92.14
82.50	86.80	88.86	92.14
88.60	86.06	88.86	92.14
93.20	85.58	88.86	92.14
97.80	85.60	88.86	92.14
102.20	86.03	88.86	92.14
107.20	86.18	88.86	92.14
112.50	86.84	88.86	92.14
116.00	87.59	88.86	92.14
118.70	88.86	88.86	92.14
122.50	90.18	88.86	92.14
125.50	90.76	88.86	92.14
131.50	93.85	88.86	92.14
142.00	97.32	88.86	92.14

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

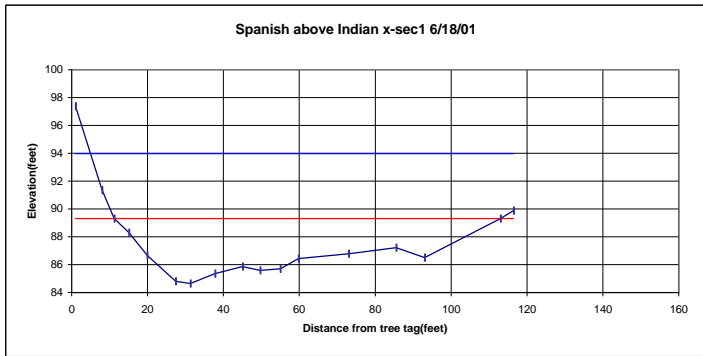

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Notes
1	2.61	97.39	89.31	93.97 TBM-LB
8	8.64	91.36	89.31	93.97
11.2	10.69	89.31	89.31	93.97 BFL
15.1	11.7	88.3	89.31	93.97
19.9	13.34	86.66	89.31	93.97 LEW
27.4	15.2	84.8	89.31	93.97
31.3	15.35	84.65	89.31	93.97 T
37.8	14.64	85.36	89.31	93.97
45	14.13	85.87	89.31	93.97
49.7	14.41	85.59	89.31	93.97
55	14.29	85.71	89.31	93.97
59.8	13.56	86.44	89.31	93.97 REW
73	13.21	86.79	89.31	93.97
85.5	12.78	87.22	89.31	93.97
93	13.49	86.51	89.31	93.97
113	10.69	89.31	89.31	93.97 BFR
116.5	10.12	89.88	89.31	93.97

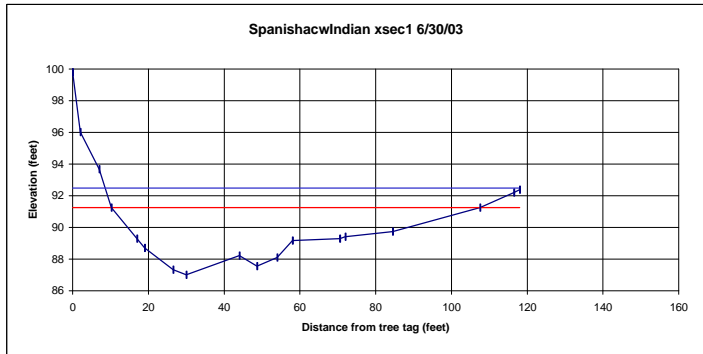


Dist from left stake	Total Depth	Bankfull depth	total elevation	bankfull elevation	2x bankfull elevation	Notes
0	0.2		99.8	91.25	92.48	ttml
2	3.97		96.03	91.25	92.48	tbl
7	6.33		93.67	91.25	92.48	
10.2	8.75	0	91.25	91.25	92.48	bfl
17	10.71	1.96	89.29	91.25	92.48	wel
19	11.29	2.54	88.71	91.25	92.48	
26.5	12.67	3.92	87.33	91.25	92.48	
30	12.98	4.23	87.02	91.25	92.48	t
44	11.78	3.03	88.22	91.25	92.48	
48.7	12.45	3.7	87.55	91.25	92.48	
54	11.9	3.15	88.1	91.25	92.48	
58	10.82	2.07	89.18	91.25	92.48	
70.5	10.71	1.96	89.29	91.25	92.48	wer
72	10.58	1.83	89.42	91.25	92.48	
84.5	10.26	1.51	89.74	91.25	92.48	
107.5	8.75	0	91.25	91.25	92.48	bfr
116.5	7.8		92.2	91.25	92.48	
118	7.62		92.38	91.25	92.48	end,tobr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg


Three Year SUMMARY		Mean	Max	Width:	Flood-	Entrench-
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Ratio	ment Ratio
1999	1	76.40	2.03	3.28	37.65	110.10 1.44
2001	1	101.80	2.90	4.66	35.10	151.80 1.49
2003	1	97.30	2.49	4.23	39.05	147.30 1.51

UTM X-coord = 673593
 UTM Y-coord = 4432299

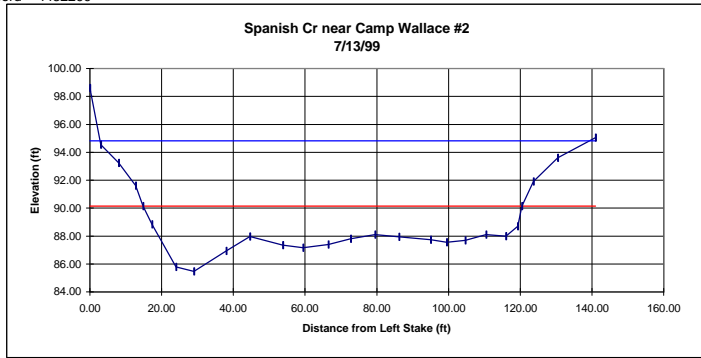


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	98.61	90.14	94.82
3.00	94.54	90.14	94.82
8.00	93.24	90.14	94.82
12.80	91.62	90.14	94.82
14.80	90.14	90.14	94.82
17.30	88.84	90.14	94.82
24.00	85.78	90.14	94.82
29.00	85.46	90.14	94.82
38.00	86.94	90.14	94.82
44.60	87.97	90.14	94.82
53.80	87.34	90.14	94.82
59.40	87.17	90.14	94.82
66.50	87.39	90.14	94.82
72.70	87.80	90.14	94.82
79.50	88.11	90.14	94.82
86.20	87.95	90.14	94.82
95.00	87.74	90.14	94.82
99.50	87.55	90.14	94.82
104.70	87.68	90.14	94.82
110.50	88.11	90.14	94.82
116.00	87.98	90.14	94.82
119.30	88.69	90.14	94.82
120.50	90.14	90.14	94.82
123.70	91.90	90.14	94.82
130.50	93.60	90.14	94.82
141.00	95.06	90.14	94.82

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

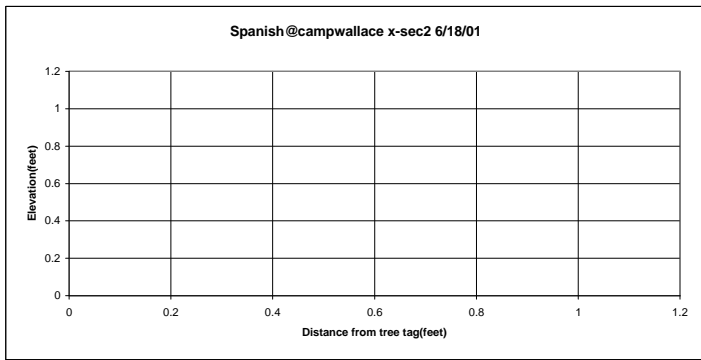

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Notes
1	1.15	98.85	91.71	96.86 TBM-LB
6	5.81	94.19	91.71	96.86 TOBL
14	8.29	91.71	91.71	96.86 BFL
19	10.75	89.25	91.71	96.86 LEW
30	13.44	86.56	91.71	96.86 T
39.6	11.72	88.28	91.71	96.86
57	12.33	87.67	91.71	96.86
73.3	11.52	88.48	91.71	96.86
92.1	11.23	88.77	91.71	96.86
101	11.66	88.34	91.71	96.86
113	11.64	88.36	91.71	96.86
123	10.84	89.16	91.71	96.86 REW
123	8.29	91.71	91.71	96.86 BFR
127.4	7.08	92.92	91.71	96.86
131	5.52	94.48	91.71	96.86 TOBR
142	2.8	97.2	91.71	96.86

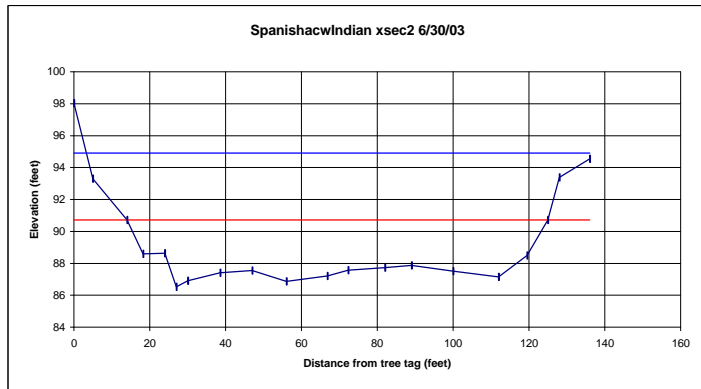


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	1.96		98.04	90.71	94.9	ttml
5	6.7		93.3	90.71	94.9	tbl
14	9.29	0	90.71	90.71	94.9	bfl
18.2	11.41	2.12	88.59	90.71	94.9	wel
24	11.37	2.08	88.63	90.71	94.9	
27	13.48	4.19	86.52	90.71	94.9	t
30	13.1	3.81	86.9	90.71	94.9	
38.6	12.6	3.31	87.4	90.71	94.9	
47	12.45	3.16	87.55	90.71	94.9	
56	13.14	3.85	86.86	90.71	94.9	
66.8	12.79	3.5	87.21	90.71	94.9	
72.3	12.43	3.14	87.57	90.71	94.9	
82	12.28	2.99	87.72	90.71	94.9	
89	12.13	2.84	87.87	90.71	94.9	
100	12.49	3.2	87.51	90.71	94.9	
112	12.86	3.57	87.14	90.71	94.9	
119.5	11.51	2.22	88.49	90.71	94.9	wer
125	9.29	0	90.71	90.71	94.9	bfr
128	6.61		93.39	90.71	94.9	
136	5.45		94.55	90.71	94.9	tobr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg


Three Year SUMMARY							
Year	Cross-section	Bankfull Width	Bankfull Depth	Max Bankfull Depth	Width: Depth Ratio	Flood-prone width	Entrenchment Ratio
1999	2	105.70	2.58	4.68	40.95	136.48	1.29
2001	2	109.00	3.05	5.15	35.70	135.60	1.24
2003	2	111.00	2.93	4.19	37.86	136.50	1.23

UTM X-coord = 673699 all measurements are in feet
 UTM Y-coord = 4432358

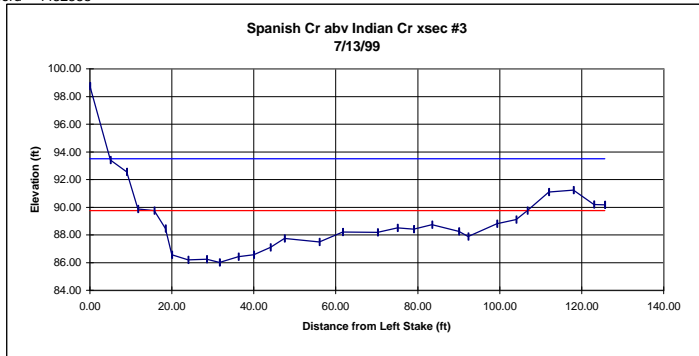


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	98.75	89.76	93.51
5.00	93.42	89.76	93.51
9.00	92.55	89.76	93.51
11.70	89.87	89.76	93.51
15.70	89.76	89.76	93.51
18.40	88.46	89.76	93.51
20.00	86.57	89.76	93.51
24.00	86.20	89.76	93.51
28.50	86.25	89.76	93.51
31.60	86.01	89.76	93.51
36.20	86.42	89.76	93.51
40.00	86.56	89.76	93.51
44.00	87.09	89.76	93.51
47.50	87.75	89.76	93.51
56.00	87.48	89.76	93.51
61.70	88.21	89.76	93.51
70.20	88.19	89.76	93.51
75.00	88.51	89.76	93.51
79.00	88.41	89.76	93.51
83.50	88.75	89.76	93.51
90.00	88.26	89.76	93.51
92.30	87.88	89.76	93.51
99.30	88.81	89.76	93.51
104.00	89.10	89.76	93.51
106.70	89.76	89.76	93.51
112.00	91.10	89.76	93.51
118.00	91.24	89.76	93.51
123.00	90.20	89.76	93.51
125.60	90.17	89.76	93.51

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

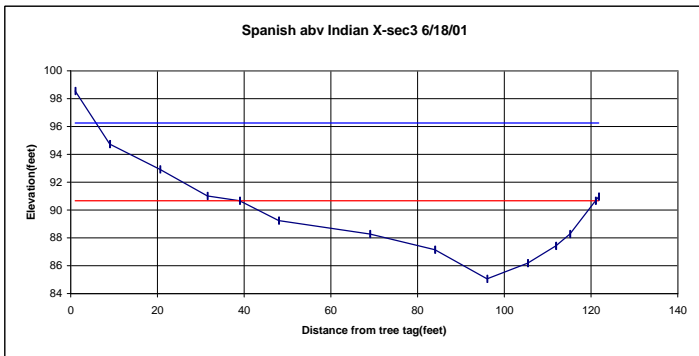

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Notes
1	1.44	98.56	90.66	96.26 TBM-LB
9	5.27	94.73	90.66	96.26 TOBL
20.6	7.08	92.92	90.66	96.26
31.5	8.98	91.02	90.66	96.26
39	9.34	90.66	90.66	96.26 BFL
48	10.77	89.23	90.66	96.26
69	11.72	88.28	90.66	96.26 LEW
84	12.86	87.14	90.66	96.26
96	14.94	85.06	90.66	96.26 T
105.4	13.81	86.19	90.66	96.26
111.9	12.58	87.42	90.66	96.26
115.1	11.73	88.27	90.66	96.26 REW
121	9.34	90.66	90.66	96.26 BFR
121.8	9.03	90.97	90.66	96.26

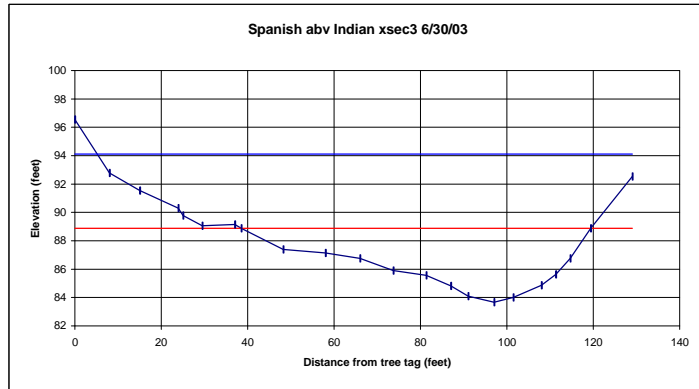


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x bankfull elevation	Notes
0	3.46		96.54	88.89	94.11	ttml
8	7.22		92.78	88.89	94.11	
15	8.45		91.55	88.89	94.11	tob
23.9	9.69		90.31	88.89	94.11	
25	10.21		89.79	88.89	94.11	
29.5	10.95		89.05	88.89	94.11	
37	10.84		89.16	88.89	94.11	
38.5	11.11	0	88.89	88.89	94.11	bfl
48.2	12.6	1.49	87.4	88.89	94.11	
58	12.85	1.74	87.15	88.89	94.11	
66	13.23	2.12	86.77	88.89	94.11	wel
73.7	14.09	2.98	85.91	88.89	94.11	
81.3	14.43	3.32	85.57	88.89	94.11	
87	15.18	4.07	84.82	88.89	94.11	
91	15.9	4.79	84.1	88.89	94.11	
97	16.33	5.22	83.67	88.89	94.11	t
101.5	15.99	4.88	84.01	88.89	94.11	
108	15.13	4.02	84.87	88.89	94.11	
111.3	14.36	3.25	85.64	88.89	94.11	
114.7	13.24	2.13	86.76	88.89	94.11	wer
119.4	11.11	0	88.89	88.89	94.11	bfr
129	7.46		92.54	88.89	94.11	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg


Three Year SUMMARY		Mean	Max	Width:	Flood-	Entrench-
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Ratio	ment Ratio
1999	3	91.00	2.13	3.75	42.66	141.00 1.55
2001	3	83.00	2.80	5.60	29.28	137.50 1.67
2003	3	80.90	3.08	5.22	26.29	131.50 1.63

UTM X-coord = 651875 all measurements in feet
 UTM Y-coord = 4430545

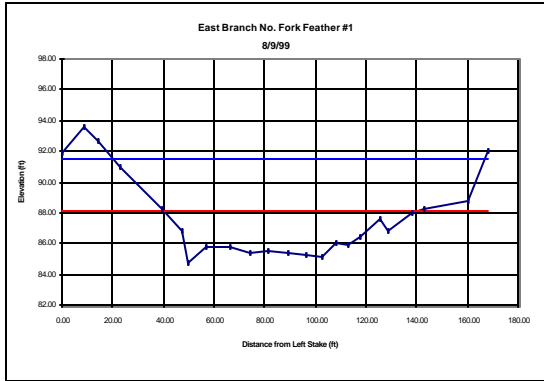


Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	91.83	88.095	91.45
9.00	93.61	88.095	91.45
14.00	92.64	88.095	91.45
22.50	91.02	88.095	91.45
39.40	88.27	88.095	91.45
47.00	86.78	88.095	91.45
50.00	84.74	88.095	91.45
56.90	85.73	88.095	91.45
66.20	85.79	88.095	91.45
74.00	85.35	88.095	91.45
81.00	85.46	88.095	91.45
89.00	85.40	88.095	91.45
96.50	85.26	88.095	91.45
103.00	85.06	88.095	91.45
108.00	86.05	88.095	91.45
113.00	85.85	88.095	91.45
118.00	86.43	88.095	91.45
125.50	87.54	88.095	91.45
129.00	86.80	88.10	91.45
138.00	87.92	88.095	91.45
143.00	88.26	88.095	91.45
160.00	88.75	88.095	91.45
168.00	92.05	88.095	91.45

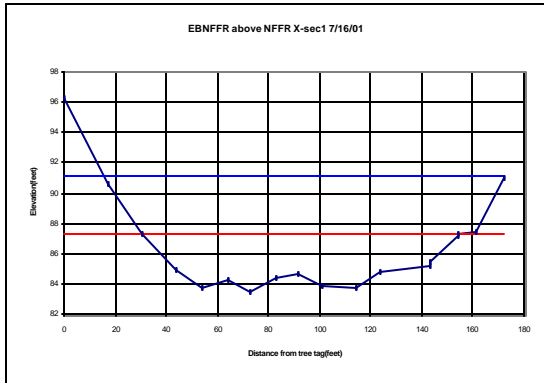

EBNFFR above NFFR 7/16/01

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
0	3.68	96.32	87.32	91.18	TBM
17.5	9.43	90.57	87.32	91.18	
30.2	12.68	87.32	87.32	91.18	BFL
43.6	15.04	84.96	87.32	91.18	LEW
54.3	16.26	83.74	87.32	91.18	
64	15.8	84.2	87.32	91.18	
72.6	16.54	83.46	87.32	91.18	T
82.6	15.56	84.44	87.32	91.18	
91.2	15.4	84.6	87.32	91.18	
101.3	16.18	83.82	87.32	91.18	
114.2	16.3	83.7	87.32	91.18	
124	15.17	84.83	87.32	91.18	REW
143.2	14.85	85.15	87.32	91.18	
143.4	14.55	85.45	87.32	91.18	
154	12.89	87.11	87.32	91.18	
154.4	12.68	87.32	87.32	91.18	BFR
161.3	12.55	87.45	87.32	91.18	
172	8.97	91.03	87.32	91.18	END

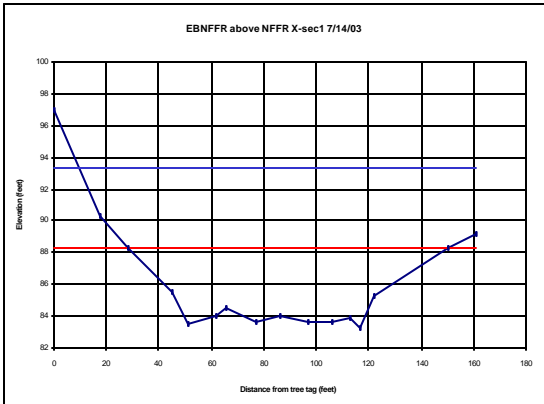


ebnffr cross-section-1 7/14/03

Dist from left stake	Total Depth	Bankfull depth	Total elevation	bankfull elevation	bankfull elevation	Notes
0	3.07		96.93	88.24	93.27	tbnl
17.5	9.69		90.31	88.24	93.27	tobl
28	11.76	0	88.24	88.24	93.27	bfl
45.3	14.51	2.75	85.49	88.24	93.27	wel
50.8	16.44	4.68	83.56	88.24	93.27	
61.4	15.95	4.19	84.05	88.24	93.27	
65.7	15.48	3.72	84.52	88.24	93.27	
77	16.32	4.56	83.68	88.24	93.27	
86	16	4.24	84	88.24	93.27	
96.7	16.41	4.65	83.59	88.24	93.27	
106.3	16.35	4.59	83.65	88.24	93.27	
113	16.07	4.31	83.93	88.24	93.27	
117	16.79	5.03	83.21	88.24	93.27	t
121.7	14.78	3.02	85.22	88.24	93.27	wer
150.4	11.76	0	88.24	88.24	93.27	bfr
161	10.88		89.12	88.24	93.27	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg


Three Year SUMMARY		Mean	Max	Width:	Flood- prone	Entrench- ment
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth Ratio	width	Ratio
1999	1	98.60	2.26	3.53	43.63	141.95 1.44
2001	1	124.20	2.49	3.86	49.87	169.00 1.36
2003	1	122.40	3.81	5.03	32.11	160.30 1.31

UTM X-coord = 652079 all measurements in feet
 UTM Y-coord = 4430227

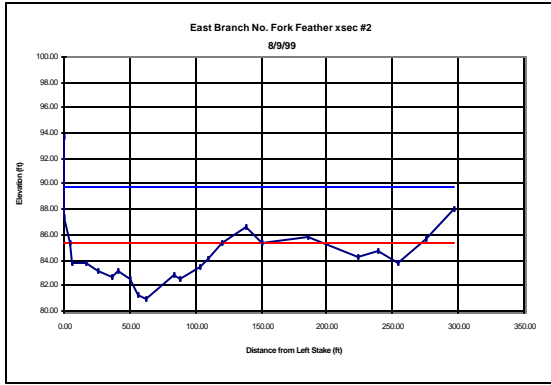


Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	93.68	85.33	89.72
0.01	87.38	85.33	89.72
4.80	85.33	85.33	89.72
6.50	83.84	85.33	89.72
16.00	83.79	85.33	89.72
25.70	83.15	85.33	89.72
36.00	82.64	85.33	89.72
41.30	83.19	85.33	89.72
50.60	82.49	85.33	89.72
57.00	81.29	85.33	89.72
62.00	80.94	85.33	89.72
83.90	82.87	85.33	89.72
89.00	82.50	85.33	89.72
103.80	83.50	85.33	89.72
110.00	84.15	85.33	89.72
120.10	85.33	85.33	89.72
138.00	86.63	85.33	89.72
150.60	85.38	85.33	89.72
185.00	85.90	85.33	89.72
224.00	84.25	85.33	89.72
238.40	84.75	85.33	89.72
254.00	83.78	85.33	89.72
275.50	85.64	85.33	89.72
296.00	87.99	85.33	89.72

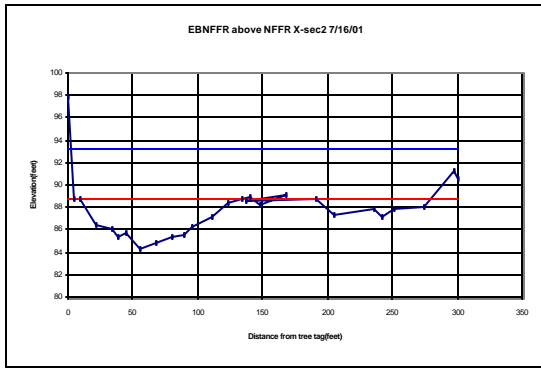

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
0	2.2	97.8	88.77	93.26	TBM
4.2	11.23	88.77	88.77	93.26	BFL
9	11.25	88.75	88.77	93.26	
21.4	13.64	86.36	88.77	93.26	LEW
34.5	13.86	86.14	88.77	93.26	
39	14.67	85.33	88.77	93.26	
45.3	14.3	85.7	88.77	93.26	
56	15.72	84.28	88.77	93.26	T
68	15.22	84.78	88.77	93.26	
80.4	14.71	85.29	88.77	93.26	
90	14.52	85.48	88.77	93.26	
95	13.72	86.28	88.77	93.26	REW
110.5	12.85	87.15	88.77	93.26	
124.1	11.68	88.32	88.77	93.26	
133.5	11.23	88.77	88.77	93.26	BFR
141	11.02	88.98	88.77	93.26	
147.8	11.73	88.27	88.77	93.26	
168.8	10.91	89.09	88.77	93.26	
136.7	11.5	88.5	88.77	93.26	
191.3	11.25	88.75	88.77	93.26	
205.2	12.72	87.28	88.77	93.26	
236	12.15	87.85	88.77	93.26	
242	12.02	87.08	88.77	93.26	
251.6	12.16	87.84	88.77	93.26	
274.5	11.94	88.06	88.77	93.26	
297	8.68	91.32	88.77	93.26	
300.6	9.42	90.58	88.77	93.26	END

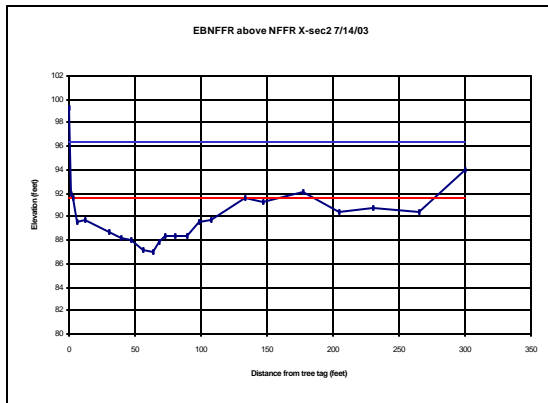


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x bankfull elevation	Notes
0	0.79		99.21	91.65	96.34	tbnl
2	7.99		92.01	91.65	96.34	
3	8.35	0	91.65	91.65	96.34	bnl
6.5	10.37	2.02	89.63	91.65	96.34	wel
12.4	10.22	1.87	89.78	91.65	96.34	
30	11.34	2.99	88.66	91.65	96.34	
39.7	11.73	3.38	88.27	91.65	96.34	
47.7	11.93	3.58	88.07	91.65	96.34	
55.8	12.81	4.46	87.19	91.65	96.34	
63.4	13.04	4.69	86.96	91.65	96.34	
68.6	12.21	3.86	87.79	91.65	96.34	t
73	11.61	3.26	88.39	91.65	96.34	
79.6	11.57	3.22	88.43	91.65	96.34	
89.5	11.61	3.26	88.39	91.65	96.34	
98.7	10.42	2.07	89.58	91.65	96.34	
107.1	10.28	1.93	89.72	91.65	96.34	
133.5	8.35	0	91.65	91.65	96.34	wer
147.5	8.68		91.32	91.65	96.34	bnr
177.5	7.87		92.13	91.65	96.34	
204.4	9.63		90.37	91.65	96.34	
230.9	9.18		90.82	91.65	96.34	
265	9.61		90.39	91.65	96.34	
300	6.09		93.91	91.65	96.34	

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg


Three Year SUMMARY						
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Flood-prone Ratio	Entrenchment Ratio
1999	2	115.30	2.47	4.39	46.73	294.80
2001	2	129.30	2.41	4.49	53.65	342.00
2003	2	130.50	3.48	4.69	37.54	327.40

UTM X-coord = 652407 all measurements are in feet
 UTM Y-coord = 4430502

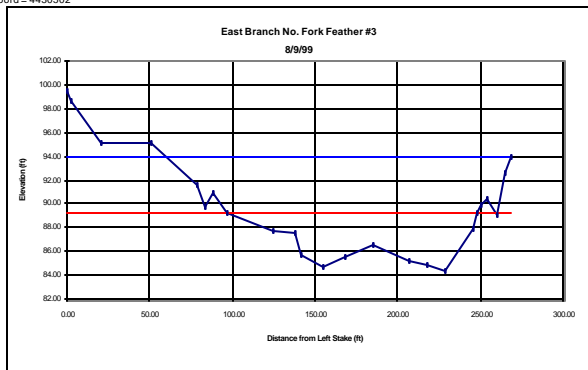


Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	99.48	89.2	93.98
2.00	98.69	89.2	93.98
21.00	95.10	89.2	93.98
51.00	95.09	89.2	93.98
79.00	91.56	89.2	93.98
83.00	89.66	89.2	93.98
88.00	90.96	89.2	93.98
97.00	89.20	89.2	93.98
125.00	87.71	89.2	93.98
138.00	87.55	89.2	93.98
142.00	85.75	89.2	93.98
155.00	84.75	89.2	93.98
168.50	85.50	89.2	93.98
184.60	86.62	89.2	93.98
206.70	85.26	89.2	93.98
218.00	84.87	89.2	93.98
228.50	84.42	89.2	93.98
245.00	87.83	89.2	93.98
247.60	89.20	89.20	93.98
250.70	89.86	89.2	93.98
254.00	90.32	89.2	93.98
260.00	89.03	89.2	93.98
265.30	92.52	89.2	93.98
268.60	93.98	89.2	93.98

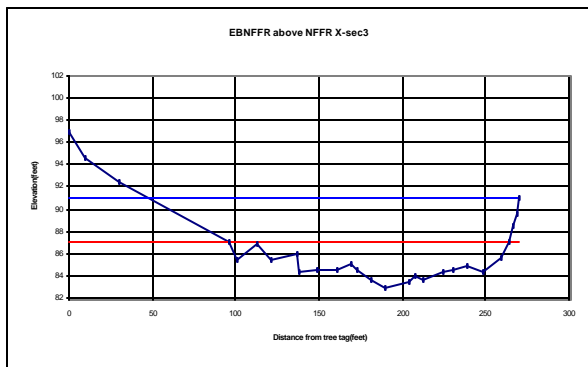

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
0	3	97	86.96	90.94	TBM-LB
10	5.35	94.65	86.96	90.94	
30	7.57	92.43	86.96	90.94	
96.3	13.04	86.96	86.96	90.94	BFL
100.5	14.56	85.44	86.96	90.94	
113	13.2	86.8	86.96	90.94	
121.5	14.58	85.42	86.96	90.94	
137	13.96	86.04	86.96	90.94	
138.5	15.57	84.43	86.96	90.94	LEW
148.4	15.52	84.48	86.96	90.94	
161	15.48	84.52	86.96	90.94	
169	15.02	84.98	86.96	90.94	
172.8	15.42	84.58	86.96	90.94	
181	16.36	83.64	86.96	90.94	
189	17.02	82.98	86.96	90.94	T
204	16.5	83.5	86.96	90.94	
207.3	16.06	83.94	86.96	90.94	
212.5	16.36	83.64	86.96	90.94	
224.3	15.65	84.35	86.96	90.94	
230.1	15.42	84.58	86.96	90.94	REW
238.8	15.1	84.9	86.96	90.94	
248	15.57	84.43	86.96	90.94	
258.6	14.42	85.58	86.96	90.94	
263.9	13.04	86.96	86.96	90.94	BFR
266.5	11.46	88.54	86.96	90.94	
268.6	10.41	89.59	86.96	90.94	
269.5	8.91	91.09	86.96	90.94	END

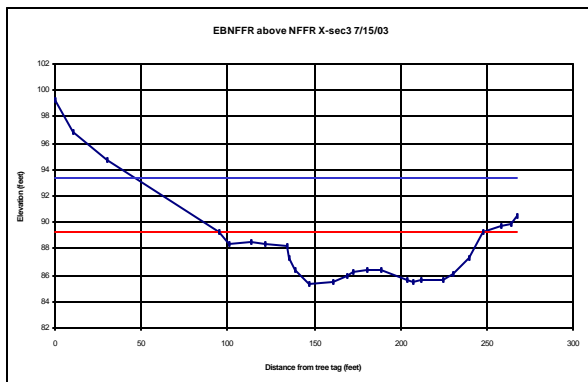


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x bankfull	Notes
0	0.8		99.2	89.32	93.38	tbrtl
10	3.08		96.92	89.32	93.38	
30	5.2		94.8	89.32	93.38	tblt
95.3	10.68	0	89.32	89.32	93.38	tbl
100.5	11.58	0.9	88.42	89.32	93.38	
113	11.52	0.84	88.48	89.32	93.38	
121.5	11.71	1.03	88.29	89.32	93.38	
134.3	11.74	1.06	88.26	89.32	93.38	
135.5	12.7	2.02	87.3	89.32	93.38	wel
138.5	13.57	2.89	86.43	89.32	93.38	
147.1	14.74	4.06	85.26	89.32	93.38	t
161	14.45	3.77	85.55	89.32	93.38	
169	14.13	3.45	85.87	89.32	93.38	
172.8	13.81	3.13	86.19	89.32	93.38	
181	13.56	2.88	86.44	89.32	93.38	
189	13.63	2.95	86.37	89.32	93.38	
204	14.35	3.67	85.65	89.32	93.38	
207.3	14.46	3.78	85.54	89.32	93.38	
212.5	14.42	3.74	85.58	89.32	93.38	
224.3	14.29	3.61	85.71	89.32	93.38	
230.1	13.88	3.2	86.12	89.32	93.38	
240.3	12.68	2	87.32	89.32	93.38	wer
247.4	10.68	0	89.32	89.32	93.38	br
258.6	10.2		89.8	89.32	93.38	
263.9	10.11		89.89	89.32	93.38	
267	9.55		90.45	89.32	93.38	

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Three Year SUMMARY						
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Flood-prone width	Entrenchment Ratio
1999	3	150.60	3.17	4.78	47.45	214.30 1.42
2001	3	167.60	2.20	3.98	76.18	211.40 1.26
2003	3	152.10	2.58	4.06	59.00	207.20 1.36

UTM X-coord. = 722738
 UTM Y-coord = 4410307

All measurements are in feet

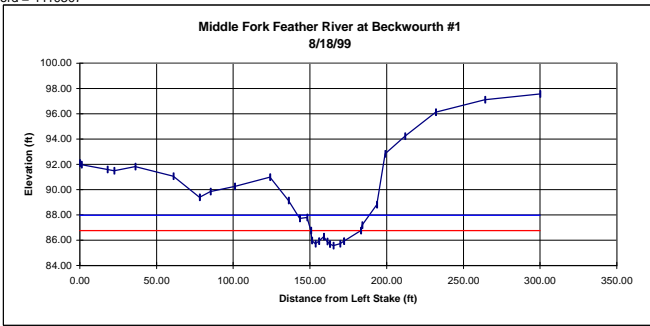


Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Left Stake	Total Elevation	Bankfull Elevation	UTM X-coord. = 722739
0.00	92.11	86.77	UTM Y-coord = 4410308
1.00	91.98	86.77	
18.00	91.60	86.77	
22.30	91.49	86.77	
36.00	91.82	86.77	
61.00	91.07	86.77	
78.00	89.39	86.77	
85.00	89.85	86.77	
101.00	90.25	86.77	
124.00	91.00	86.77	
136.00	89.15	86.77	
143.30	87.72	86.77	
148.00	87.81	86.77	
150.50	86.77	86.77	
151.20	85.97	86.77	
153.50	85.71	86.77	
155.80	85.92	86.77	
159.00	86.28	86.77	
161.20	85.90	86.77	
163.00	85.69	86.77	
165.30	85.57	86.77	
169.50	85.72	86.77	
172.00	85.93	86.77	
183.20	86.77	86.77	
184.00	87.20	86.77	
193.50	88.80	86.77	
199.00	92.83	86.77	
212.00	94.24	86.77	
232.00	96.12	86.77	
264.00	97.11	86.77	
300.00	97.57	86.77	



Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	5.66	94.34	90.99	93.26	TBM
6.6	6	94	90.99	93.26	
15.8	5.73	94.27	90.99	93.26	
31.7	7.51	92.49	90.99	93.26	
53	6.83	93.17	90.99	93.26	
67.8	6.03	93.97	90.99	93.26	
93.6	9.01	90.99	90.99	93.26	BFL
118.3	9.81	90.19	90.99	93.26	
136	10.53	89.47	90.99	93.26	
142.4	10.92	89.08	90.99	93.26	
147.8	11.18	88.82	90.99	93.26	
151.5	11.28	88.72	90.99	93.26	T
157.3	10.89	89.11	90.99	93.26	
161.1	10.69	89.31	90.99	93.26	
165	10.86	89.14	90.99	93.26	
169.8	10.69	89.31	90.99	93.26	
172.8	9.82	90.18	90.99	93.26	
179.5	9.01	90.99	90.99	93.26	BFR
183.05	7.45	92.55	90.99	93.26	
184.5	8.07	91.93	90.99	93.26	
191.2	6.04	93.96	90.99	93.26	
199.3	6.93	93.07	90.99	93.26	
207	3.95	96.05	90.99	93.26	TOBR
217	3.93	96.07	90.99	93.26	
238.9	4.05	95.95	90.99	93.26	
265.4	4.28	95.72	90.99	93.26	
274.8	4.75	95.25	90.99	93.26	
296.1	5.18	94.82	90.99	93.26	End

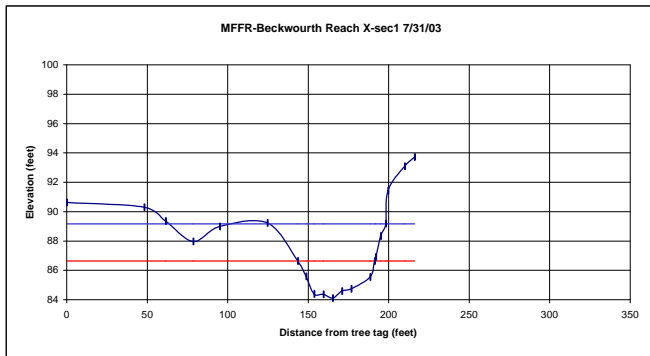

Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x bankfull elevation	Notes
0	9.37		90.63	86.64	89.17	tbml
48	9.7		90.3	86.64	89.17	
61.5	10.63		89.37	86.64	89.17	
78.5	12.04		87.96	86.64	89.17	
95	11.01		88.99	86.64	89.17	
124.6	10.77		89.23	86.64	89.17	tbl
143.5	13.36	0	86.64	86.64	89.17	bfl
148.6	14.4	1.04	85.6	86.64	89.17	
153.6	15.6	2.24	84.4	86.64	89.17	
159.4	15.64	2.28	84.36	86.64	89.17	
165.2	15.89	2.53	84.11	86.64	89.17	t
171	15.42	2.06	84.58	86.64	89.17	
176.6	15.25	1.89	84.75	86.64	89.17	
188.4	14.46	1.1	85.54	86.64	89.17	
191.2	13.36	0	86.64	86.64	89.17	bfr
192	13.08		86.92	86.64	89.17	
195	11.67		88.33	86.64	89.17	
198.1	10.82		89.18	86.64	89.17	
199.5	8.56		91.44	86.64	89.17	
209.9	6.91		93.09	86.64	89.17	toBR
216	6.27		93.73	86.64	89.17	endr


TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Three Year SUMMARY						
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Flood-prone width	Entrenchment Ratio
1999	1	32.70	0.92	1.20	35.72	1.42
2001	1	85.90	1.50	2.27	57.26	1.45
2003	1	47.70	1.64	2.53	29.04	2.91

UTM X-coord. = 722605.9
 UTM Y-coord = 4410413.5


All measurements are in feet

Dist. From Total UTM X-coord. = 722605.10
 Left Stake Elevation UTM Y-coord = 4410413.6

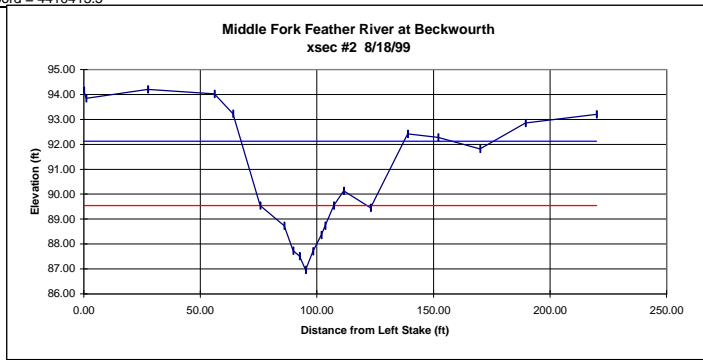


Dist. From Left Stake	Total Elevation
0.00	94.15
1.00	93.84
27.50	94.21
56.00	94.02
64.00	93.23
75.70	89.54
86.00	88.74
89.80	87.73
92.50	87.51
95.20	86.96
98.30	87.71
101.80	88.36
103.50	88.74
107.20	89.54
111.50	90.13
123.00	89.46
139.00	92.42
152.00	92.28
170.00	91.81
189.50	92.86
220.00	93.20

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

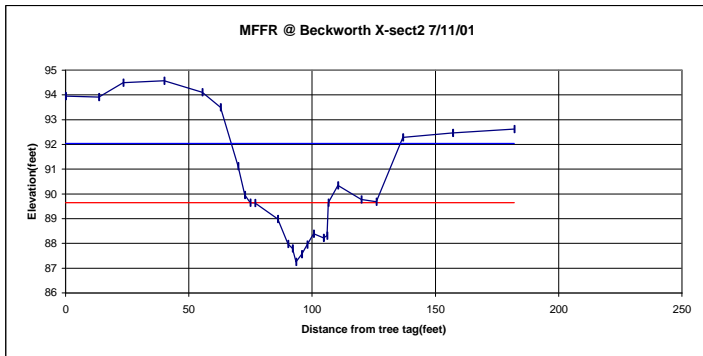

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	6.05	93.95	89.65	92.04	TBM-LB
13.5	6.09	93.91	89.65	92.04	
23.3	5.51	94.49	89.65	92.04	
40	5.43	94.57	89.65	92.04	
55.4	5.89	94.11	89.65	92.04	
62.8	6.5	93.5	89.65	92.04	TOBL
70	8.88	91.12	89.65	92.04	
72.7	10.04	89.96	89.65	92.04	
74.9	10.35	89.65	89.65	92.04	BFL
76.9	10.36	89.64	89.65	92.04	
86.1	11.01	88.99	89.65	92.04	
90.2	12.02	87.98	89.65	92.04	LEW
92	12.2	87.8	89.65	92.04	
93.4	12.74	87.26	89.65	92.04	T
95.8	12.44	87.56	89.65	92.04	
98	12.05	87.95	89.65	92.04	REW
100.6	11.61	88.39	89.65	92.04	
104.6	11.78	88.22	89.65	92.04	
106.1	11.68	88.32	89.65	92.04	
106.6	10.35	89.65	89.65	92.04	BFR
110.5	9.65	90.35	89.65	92.04	
120	10.23	89.77	89.65	92.04	
126	10.32	89.68	89.65	92.04	
136.8	7.72	92.28	89.65	92.04	TOBR
157	7.53	92.47	89.65	92.04	
182	7.38	92.62	89.65	92.04	TBM-RB

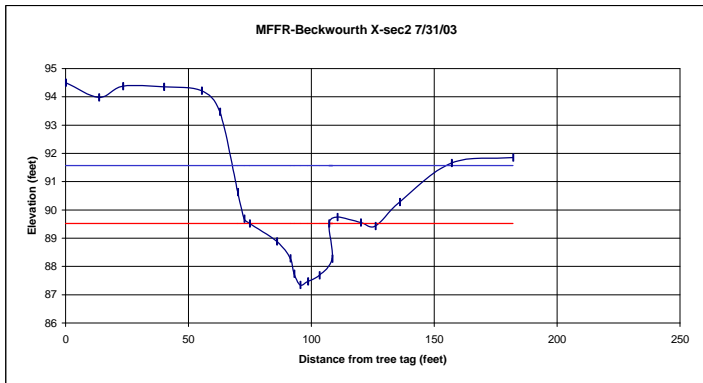


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	5.5		94.5	89.52	91.57	tbml
13.5	6.02		93.98	89.52	91.57	
23.3	5.62		94.38	89.52	91.57	
40	5.64		94.36	89.52	91.57	
55.4	5.78		94.22	89.52	91.57	
62.8	6.53		93.47	89.52	91.57	tbl
70	9.37		90.63	89.52	91.57	
72.7	10.31		89.69	89.52	91.57	
74.9	10.48	0	89.52	89.52	91.57	bfl
85.9	11.11	0.63	88.89	89.52	91.57	
91.4	11.71	1.23	88.29	89.52	91.57	wel
93	12.26	1.78	87.74	89.52	91.57	
95.4	12.65	2.17	87.35	89.52	91.57	
98.6	12.53	2.05	87.47	89.52	91.57	t
103.2	12.31	1.83	87.69	89.52	91.57	
108.4	11.72	1.24	88.28	89.52	91.57	wer
107.2	10.48	0	89.52	89.52	91.57	bfr
110.5	10.25		89.75	89.52	91.57	
120	10.44		89.56	89.52	91.57	
126	10.57		89.43	89.52	91.57	
136	9.72		90.28	89.52	91.57	
157	8.34		91.66	89.52	91.57	
182	8.15		91.85	89.52	91.57	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Three Year SUMMARY						
Year	Cross-section	Bankfull Width	Bankfull Depth	Max Bankfull Depth	Width: Depth Ratio	Flood-prone width
1999	2	31.50	1.58	2.58	19.99	108.24
2001	2	31.70	1.30	2.39	24.38	66.90
2003	2	32.30	1.37	2.05	23.64	54.10


UTM X-coord = 722527.9
 UTM Y-coord = 4410614.5

all measurements in feet

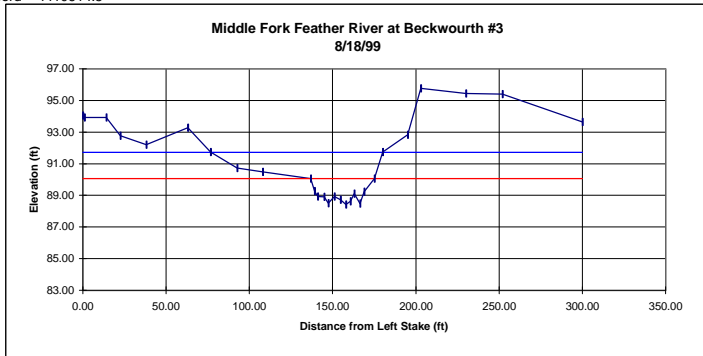


Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	94.04	90.07	91.71
1.00	93.92	90.07	91.71
14.00	93.92	90.07	91.71
22.50	92.77	90.07	91.71
38.00	92.20	90.07	91.71
63.00	93.27	90.07	91.71
76.70	91.75	90.07	91.71
92.60	90.72	90.07	91.71
108.00	90.49	90.07	91.71
136.80	90.07	90.07	91.71
139.20	89.27	90.07	91.71
141.00	88.93	90.07	91.71
145.00	88.91	90.07	91.71
147.50	88.51	90.07	91.71
151.00	88.92	90.07	91.71
154.80	88.73	90.07	91.71
158.00	88.43	90.07	91.71
160.70	88.62	90.07	91.71
163.00	89.11	90.07	91.71
166.50	88.48	90.07	91.71
169.00	89.24	90.07	91.71
175.00	90.07	90.07	91.71
180.00	91.74	90.07	91.71
195.00	92.84	90.07	91.71
203.00	95.77	90.07	91.71
230.00	95.45	90.07	91.71
252.00	95.40	90.07	91.71
300.00	93.64	90.07	91.71

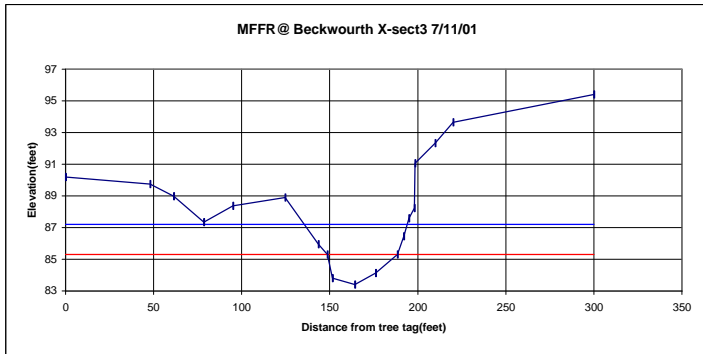

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Notes
0	9.8	90.2	85.3	87.2 TBM
48	10.26	89.74	85.3	87.2
61.5	11.03	88.97	85.3	87.2
78.5	12.66	87.34	85.3	87.2
95	11.63	88.37	85.3	87.2
124.6	11.1	88.9	85.3	87.2 TOBL
143.5	14.06	85.94	85.3	87.2
148.6	14.7	85.3	85.3	87.2 BFL
151.6	16.2	83.8	85.3	87.2
164.3	16.6	83.4	85.3	87.2 T
176	15.87	84.13	85.3	87.2
188.4	14.7	85.3	85.3	87.2 BFR
192	13.54	86.46	85.3	87.2
195	12.41	87.59	85.3	87.2
198.1	11.76	88.24	85.3	87.2
198.4	8.93	91.07	85.3	87.2
209.9	7.66	92.34	85.3	87.2 TOBR
220	6.35	93.65	85.3	87.2
300	4.6	95.4	85.3	87.2 End

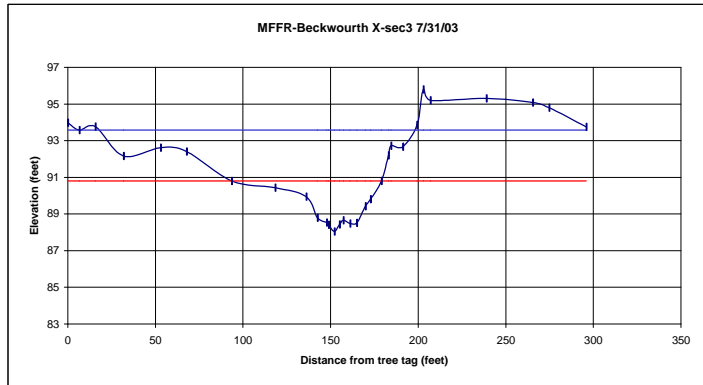


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	6.02		93.98	90.81	93.57	tbml
6.6	6.43		93.57	90.81	93.57	
15.8	6.23		93.77	90.81	93.57	
31.7	7.84		92.16	90.81	93.57	
53	7.38		92.62	90.81	93.57	
67.8	7.59		92.41	90.81	93.57	tbl
93.6	9.19	0	90.81	90.81	93.57	bfl
118.3	9.56	0.37	90.44	90.81	93.57	
136	10.05	0.86	89.95	90.81	93.57	
142.4	11.2	2.01	88.8	90.81	93.57	
147.8	11.46	2.27	88.54	90.81	93.57	
148.9	11.58	2.39	88.42	90.81	93.57	wel
152.2	11.95	2.76	88.05	90.81	93.57	t
155	11.57	2.38	88.43	90.81	93.57	wer
157.3	11.34	2.15	88.66	90.81	93.57	
161.1	11.52	2.33	88.48	90.81	93.57	
165	11.48	2.29	88.52	90.81	93.57	
169.8	10.57	1.38	89.43	90.81	93.57	
172.8	10.2	1.01	89.8	90.81	93.57	
179	9.19	0	90.81	90.81	93.57	bfr
183	7.8		92.2	90.81	93.57	
184.5	7.27		92.73	90.81	93.57	
191.2	7.33		92.67	90.81	93.57	
199.3	6.15		93.85	90.81	93.57	
203	4.2		95.8	90.81	93.57	toBr
207	4.8		95.2	90.81	93.57	
238.9	4.7		95.3	90.81	93.57	
265.4	4.92		95.08	90.81	93.57	
274.8	5.2		94.8	90.81	93.57	
296	6.25		93.75	90.81	93.57	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Three Year SUMMARY		Mean	Max	Width:	Flood-	Entrench	
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Ratio	ment Ratio	
1999	3	38.20	1.24	1.64	30.85	102.59	2.69
2001	3	39.80	1.14	1.90	34.91	139.50	3.57
2003	3	85.40	1.71	2.76	50.01	189.50	2.22


UTM X-coord = 707611.7
 UTM Y-coord = 4401493.8

Sulphur x-sec 1

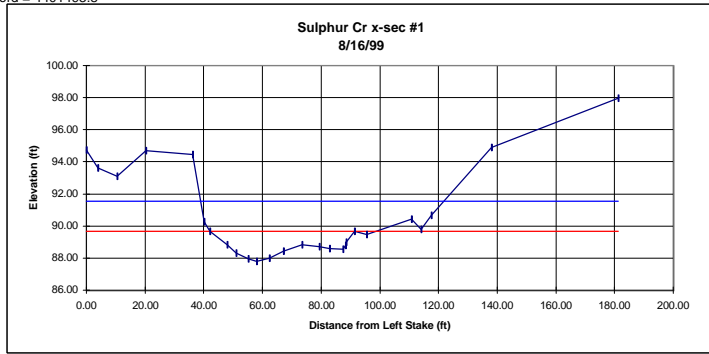


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	94.72	89.68	91.56
4.00	93.63	89.68	91.56
10.40	93.09	89.68	91.56
20.30	94.69	89.68	91.56
36.30	94.44	89.68	91.56
40.20	90.28	89.68	91.56
42.00	89.68	89.68	91.56
48.00	88.82	89.68	91.56
51.00	88.30	89.68	91.56
55.20	87.95	89.68	91.56
58.10	87.80	89.68	91.56
62.30	88.00	89.68	91.56
67.20	88.44	89.68	91.56
73.60	88.85	89.68	91.56
79.40	88.70	89.68	91.56
82.80	88.59	89.68	91.56
87.40	88.56	89.68	91.56
88.40	88.80	89.68	91.56
88.50	89.00	89.68	91.56
91.30	89.68	89.68	91.56
95.60	89.47	89.68	91.56
110.90	90.43	89.68	91.56
114.00	89.80	89.68	91.56
117.60	90.66	89.68	91.56
138.00	94.91	89.68	91.56
181.20	97.96	89.68	91.56

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

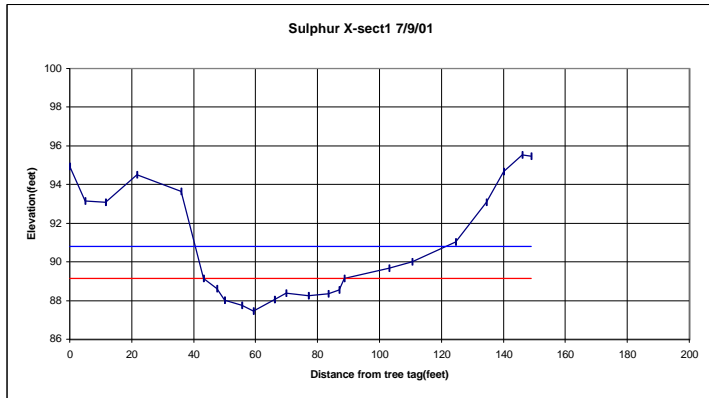

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	5.07	94.93	89.14	90.81	TBM-LB
5	6.86	93.14	89.14	90.81	
11.5	6.93	93.07	89.14	90.81	
21.7	5.5	94.5	89.14	90.81	
36	6.34	93.66	89.14	90.81	TOBL
43.2	10.86	89.14	89.14	90.81	BFL
47.5	11.4	88.6	89.14	90.81	
50	11.97	88.03	89.14	90.81	LEW
55.5	12.26	87.74	89.14	90.81	
59.3	12.53	87.47	89.14	90.81	T
66.2	11.96	88.04	89.14	90.81	
69.9	11.61	88.39	89.14	90.81	
77.1	11.75	88.25	89.14	90.81	
83.4	11.65	88.35	89.14	90.81	
86.9	11.45	88.55	89.14	90.81	REW
88.6	10.86	89.14	89.14	90.81	BFR
103	10.31	89.69	89.14	90.81	
110.6	10.01	89.99	89.14	90.81	
124.65	8.96	91.04	89.14	90.81	
134.6	6.91	93.09	89.14	90.81	
140.1	5.32	94.68	89.14	90.81	TOBR
146.1	4.48	95.52	89.14	90.81	
149	4.53	95.47	89.14	90.81	TBM-RB

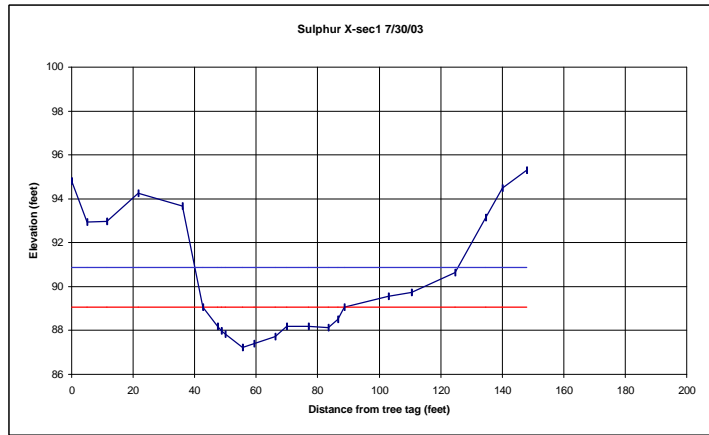


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	5.2		94.8	89.05	90.88	tbml
5	7.05		92.95	89.05	90.88	
11.5	7.02		92.98	89.05	90.88	
21.7	5.75		94.25	89.05	90.88	
36	6.34		93.66	89.05	90.88	tbl
42.6	10.95	0	89.05	89.05	90.88	bfl
47.5	11.81	0.86	88.19	89.05	90.88	
48.6	12.02	1.07	87.98	89.05	90.88	wel
50	12.16	1.21	87.84	89.05	90.88	
55.5	12.78	1.83	87.22	89.05	90.88	t
59.3	12.59	1.64	87.41	89.05	90.88	
66.2	12.28	1.33	87.72	89.05	90.88	
69.9	11.81	0.86	88.19	89.05	90.88	
77.1	11.82	0.87	88.18	89.05	90.88	
83.4	11.88	0.93	88.12	89.05	90.88	
86.5	11.49	0.54	88.51	89.05	90.88	wer
88.7	10.95	0	89.05	89.05	90.88	bfr
103	10.44		89.56	89.05	90.88	
110.6	10.26		89.74	89.05	90.88	
124.6	9.35		90.65	89.05	90.88	
134.6	6.85		93.15	89.05	90.88	
140.1	5.5		94.5	89.05	90.88	toBR
148	4.69		95.31	89.05	90.88	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg
 all measurements in feet


Three Year SUMMARY			Mean	Max	Width:	Flood-	Entrench-
Year	section	Cross- Bankfull Width	Bankfull Depth	Bankfull Depth	Depth Ratio	prone width	ment Ratio
1999	1	49.3	1.2	1.88	41.23	82.92	1.68
2001	1	45.40	0.88	1.67	51.60	84.40	1.86
2003	1	46.10	1.01	1.83	45.52	88.10	1.91

UTM X-coord = 707691.4
 UTM Y-coord = 4401392.4

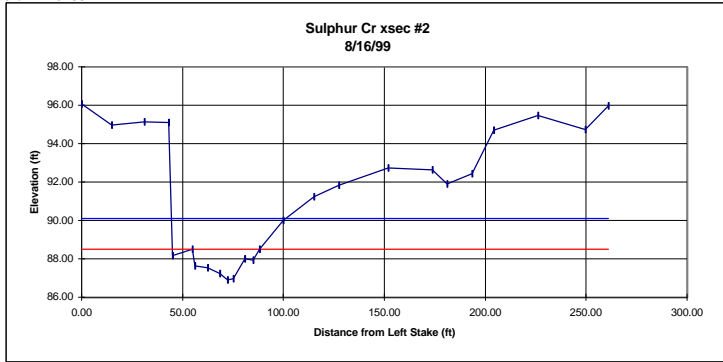


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	96.08	88.5	90.1
15.00	94.95	88.5	90.1
31.00	95.12	88.5	90.1
43.00	95.10	88.5	90.1
45.00	88.17	88.5	90.1
54.90	88.50	88.5	90.1
56.00	87.64	88.5	90.1
62.50	87.55	88.5	90.1
68.50	87.24	88.5	90.1
72.20	86.90	88.5	90.1
75.00	86.95	88.5	90.1
80.90	87.99	88.5	90.1
85.00	87.92	88.5	90.1
88.30	88.50	88.5	90.1
100.00	89.99	88.5	90.1
115.00	91.23	88.5	90.1
127.50	91.85	88.5	90.1
152.00	92.75	88.5	90.1
173.70	92.63	88.50	90.1
181.00	91.91	88.5	90.1
193.50	92.42	88.5	90.1
204.30	94.69	88.5	90.1
226.00	95.47	88.5	90.1
249.70	94.72	88.5	90.1
261.00	95.95	88.5	90.1

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

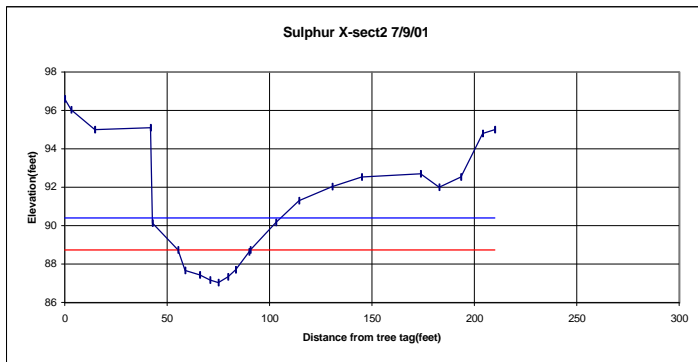

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	3.4	96.6	88.72	90.39	TBM-LB
3	3.95	96.05	88.72	90.39	
14.7	5	95	88.72	90.39	
42	4.9	95.1	88.72	90.39	TOBL
42.8	9.88	90.12	88.72	90.39	
55.4	11.28	88.72	88.72	90.39	BFL
58.8	12.34	87.66	88.72	90.39	LEW
65.9	12.57	87.43	88.72	90.39	
71	12.85	87.15	88.72	90.39	
75	12.95	87.05	88.72	90.39	T
79.7	12.65	87.35	88.72	90.39	
83.5	12.3	87.7	88.72	90.39	REW
89.9	11.36	88.64	88.72	90.39	
90.5	11.28	88.72	88.72	90.39	BFR
103	9.84	90.16	88.72	90.39	
114.4	8.71	91.29	88.72	90.39	
130.5	7.98	92.02	88.72	90.39	
145.1	7.46	92.54	88.72	90.39	
173.8	7.3	92.7	88.72	90.39	
182.7	8.01	91.99	88.72	90.39	
193.5	7.46	92.54	88.72	90.39	
204	5.19	94.81	88.72	90.39	TOBR
210	5	95	88.72	90.39	TBM-RB

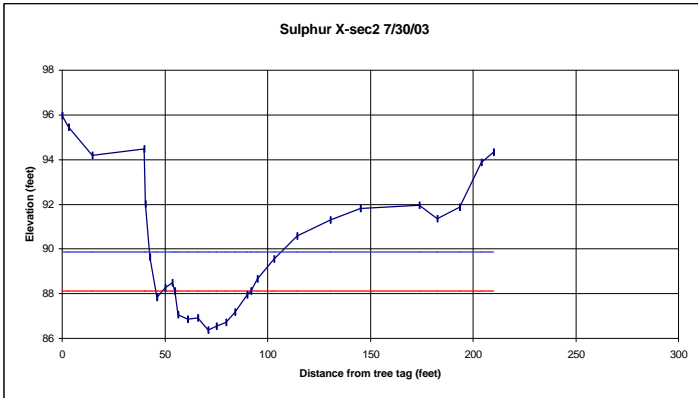


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	4.02		95.98	88.12	89.87	tbml
3	4.56		95.44	88.12	89.87	
14.7	5.8		94.2	88.12	89.87	
40	5.53		94.47	88.12	89.87	tbl
40.6	7.99		92.01	88.12	89.87	
42.7	10.36		89.64	88.12	89.87	
46	12.17		87.83	88.12	89.87	
50	11.75		88.25	88.12	89.87	
53.6	11.52		88.48	88.12	89.87	
54.7	11.88	0	88.12	88.12	89.87	bfl
56.5	12.95	1.07	87.05	88.12	89.87	wel
61	13.14	1.26	86.86	88.12	89.87	
65.9	13.07	1.19	86.93	88.12	89.87	
71	13.63	1.75	86.37	88.12	89.87	t
75	13.46	1.58	86.54	88.12	89.87	
79.7	13.28	1.4	86.72	88.12	89.87	
84.2	12.83	0.95	87.17	88.12	89.87	wer
89.9	12.04	0.16	87.96	88.12	89.87	
91.9	11.88	0	88.12	88.12	89.87	bfr
95	11.34		88.66	88.12	89.87	
103	10.44		89.56	88.12	89.87	
114.4	9.41		90.59	88.12	89.87	
130.5	8.71		91.29	88.12	89.87	
145.1	8.2		91.8	88.12	89.87	
173.8	8.04		91.96	88.12	89.87	
182.7	8.64		91.36	88.12	89.87	
193.5	8.12		91.88	88.12	89.87	
204	6.11		93.89	88.12	89.87	toBR
210	5.68		94.32	88.12	89.87	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Three Year SUMMARY							
Year	Cross-section	Bankfull Width	Bankfull Depth	Max Depth	Width: Depth Ratio	Flood-prone width	Entrenchment Ratio
1999	2	33.4	1.04	1.6	32.11	92.22	1.14
2001	2	35.10	1.00	1.67	35.10	59.90	1.70
2003	2	37.20	1.04	1.75	35.77	64.50	1.73


UTM X-coord = 707762.1
 UTM Y-coord = 4401321.6

Sulphur Cr

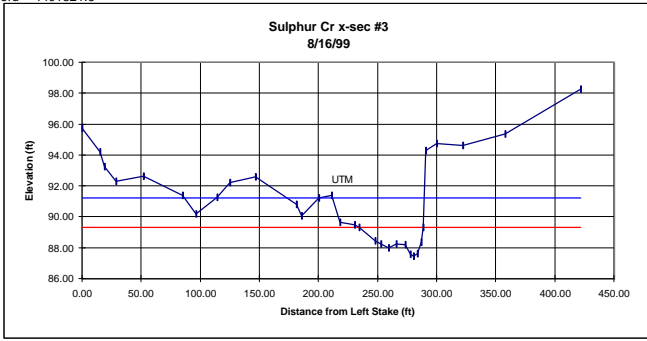

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section
 all measurements in feet

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	95.75	89.32	91.21
15.00	94.19	89.32	91.21
19.00	93.25	89.32	91.21
28.80	92.30	89.32	91.21
52.00	92.63	89.32	91.21
85.00	91.39	89.32	91.21
96.30	90.19	89.32	91.21
114.00	91.27	89.32	91.21
125.00	92.23	89.32	91.21
147.00	92.58	89.32	91.21
181.50	90.82	89.32	91.21
186.00	90.06	89.32	91.21
200.50	91.22	89.32	91.21
211.00	91.40	89.32	91.21
218.20	89.64	89.32	91.21
230.80	89.46	89.32	91.21
234.70	89.32	89.32	91.21
248.00	88.46	89.32	91.21
253.00	88.24	89.32	91.21
259.30	87.97	89.32	91.21
265.70	88.23	89.32	91.21
273.60	88.19	89.32	91.21
277.90	87.59	89.32	91.21
280.60	87.43	89.32	91.21
284.00	87.61	89.32	91.21
287.00	88.37	89.32	91.21
288.50	89.32	89.32	91.21
291.00	94.27	89.32	91.21
300.00	94.76	89.32	91.21
322.00	94.60	89.32	91.21
358.00	95.35	89.32	91.21
422.00	98.28	89.32	91.21

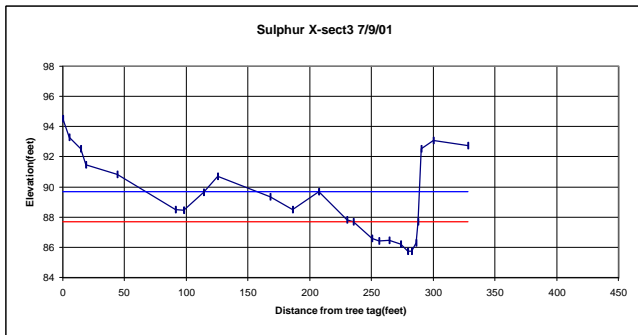

Sulphur Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	5.46	94.54	87.7	89.68	TBM-LB
5	6.71	93.29	87.7	89.68	
14.7	7.48	92.52	87.7	89.68	TOBL
18.6	8.52	91.48	87.7	89.68	
44	9.18	90.82	87.7	89.68	
91	11.5	88.5	87.7	89.68	
98	11.56	88.44	87.7	89.68	
114	10.36	89.64	87.7	89.68	
125.6	9.3	90.7	87.7	89.68	
168	10.64	89.36	87.7	89.68	
186	11.51	88.49	87.7	89.68	
207.6	10.31	89.69	87.7	89.68	
230	12.17	87.83	87.7	89.68	
235.6	12.3	87.7	87.7	89.68	BFL
250.5	13.41	86.59	87.7	89.68	LEW
256.2	13.57	86.43	87.7	89.68	
264.4	13.52	86.48	87.7	89.68	
273.7	13.81	86.19	87.7	89.68	
279.5	14.28	85.72	87.7	89.68	T
282.7	14.27	85.73	87.7	89.68	
286	13.71	86.29	87.7	89.68	REW
287.7	12.3	87.7	87.7	89.68	BFR
290.2	7.46	92.54	87.7	89.68	TOBR
300	6.92	93.08	87.7	89.68	
328	7.26	92.74	87.7	89.68	End




sulfur crossection-3 Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	6.07		93.93	87.41	89.54	tbl
5	7.33		92.67	87.41	89.54	
14.7	8.39		91.61	87.41	89.54	tbl
18.6	9.12		90.88	87.41	89.54	
44	9.61		90.39	87.41	89.54	
91	11.52		88.48	87.41	89.54	
98	11.64		88.36	87.41	89.54	
114	10.77		89.23	87.41	89.54	
125.6	10.47		89.53	87.41	89.54	
168	10.41		89.59	87.41	89.54	
186	11.27		88.73	87.41	89.54	
207.6	10.82		89.18	87.41	89.54	
230	11.39		88.61	87.41	89.54	
235.6	12.24		87.76	87.41	89.54	
238.8	12.59	0	87.41	87.41	89.54	bfl
251	13.66	1.07	86.34	87.41	89.54	wel
256.2	13.92	1.33	86.08	87.41	89.54	
264.4	14.18	1.59	85.82	87.41	89.54	
273.7	13.99	1.4	86.01	87.41	89.54	
279.5	14.23	1.64	85.77	87.41	89.54	
282.7	14.28	1.69	85.72	87.41	89.54	
286	14.27	1.68	85.73	87.41	89.54	
289.3	14.72	2.13	85.28	87.41	89.54	t
293	13.71	1.12	86.29	87.41	89.54	wer
294	12.59	0	87.41	87.41	89.54	bfr
295	7.91		92.09	87.41	89.54	
300	7.8		92.2	87.41	89.54	
328	7.3		92.7	87.41	89.54	

TO=Pipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOP=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Three Year SUMMARY						
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Max Depth	Flood-prone Ratio	Entrenchment Ratio
1999	3	53.8	1.31	1.89	41.07	202.76
2001	3	52.10	1.30	1.98	40.00	80.90
2003	3	55.20	1.37	2.13	40.44	218.60


UTM X-coord.= 698556
UTM Y-coord. = 4408237

All measurements in feet

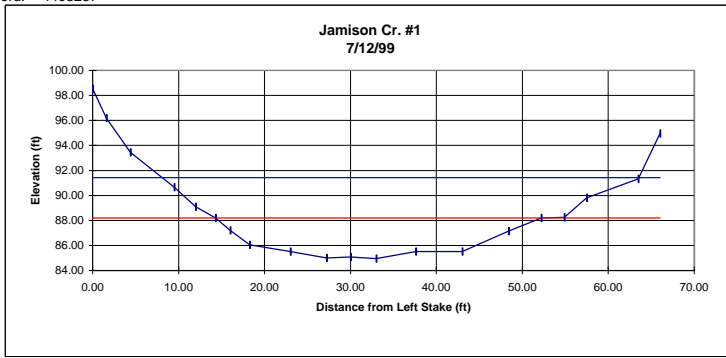


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	98.53	88.19	91.43
1.60	96.18	88.19	91.43
4.40	93.45	88.19	91.43
9.50	90.66	88.19	91.43
12.00	89.10	88.19	91.43
14.30	88.19	88.19	91.43
16.00	87.19	88.19	91.43
18.30	86.05	88.19	91.43
23.00	85.51	88.19	91.43
27.20	85.00	88.19	91.43
30.00	85.07	88.19	91.43
33.00	84.95	88.19	91.43
37.60	85.52	88.19	91.43
43.00	85.52	88.19	91.43
48.40	87.15	88.19	91.43
52.20	88.19	88.19	91.43
54.90	88.26	88.19	91.43
57.50	89.80	88.19	91.43
63.50	91.31	88.19	91.43
66.00	94.95	88.19	91.43

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

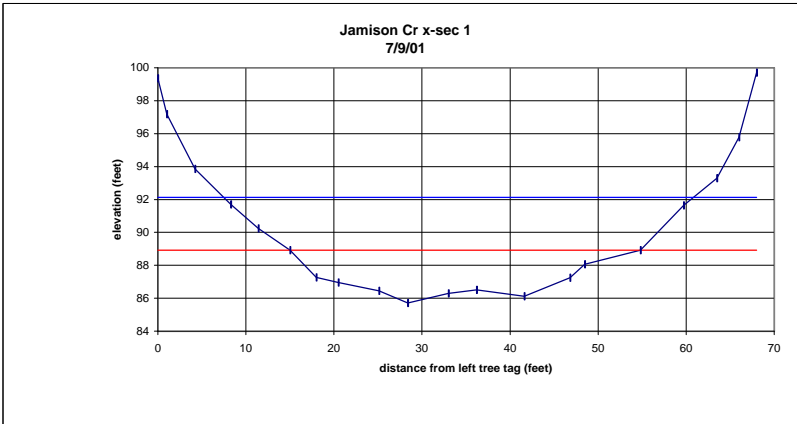

Survey 7/9/01

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2XBankfull Elevation	Notes
0	0.64	99.36	88.92	92.13	TBM-LB
1	2.82	97.18	88.92	92.13	
4.2	6.15	93.85	88.92	92.13	
8.3	8.31	91.69	88.92	92.13	
11.4	9.75	90.25	88.92	92.13	
15	11.08	88.92	88.92	92.13	BFL
18	12.74	87.26	88.92	92.13	LEW
20.5	13.05	86.95	88.92	92.13	
25.1	13.55	86.45	88.92	92.13	
28.4	14.29	85.71	88.92	92.13	T
33	13.71	86.29	88.92	92.13	
36.2	13.5	86.5	88.92	92.13	
41.6	13.89	86.11	88.92	92.13	
46.8	12.76	87.24	88.92	92.13	REW
48.5	11.94	88.06	88.92	92.13	
54.8	11.08	88.92	88.92	92.13	BFR
59.7	8.35	91.65	88.92	92.13	
63.5	6.71	93.29	88.92	92.13	
66	4.22	95.78	88.92	92.13	
68	0.3	99.7	88.92	92.13	End

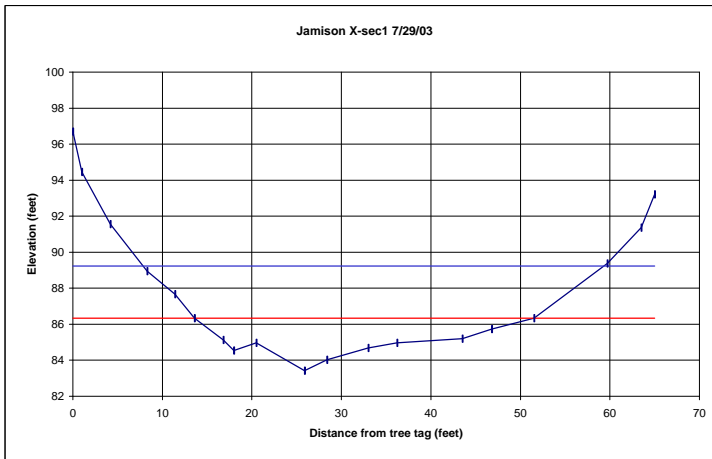

Jamison cross-section-1
7/29/03


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	3.3		96.7	86.33	89.23	tbml
1	5.55		94.45	86.33	89.23	
4.2	8.44		91.56	86.33	89.23	
8.3	11.05		88.95	86.33	89.23	
11.4	12.33		87.67	86.33	89.23	
13.6	13.67	0	86.33	86.33	89.23	bfl
16.8	14.88	1.21	85.12	86.33	89.23	wel
18	15.46	1.79	84.54	86.33	89.23	
20.5	15.04	1.37	84.96	86.33	89.23	
25.9	16.57	2.9	83.43	86.33	89.23	t
28.4	15.97	2.3	84.03	86.33	89.23	
33	15.32	1.65	84.68	86.33	89.23	
36.2	15.04	1.37	84.96	86.33	89.23	
43.5	14.8	1.13	85.2	86.33	89.23	wer
46.8	14.26	0.59	85.74	86.33	89.23	
51.5	13.67	0	86.33	86.33	89.23	bfr
59.7	10.63		89.37	86.33	89.23	
63.5	8.64		91.36	86.33	89.23	
65	6.79		93.21	86.33	89.23	

TOPipe=Top of pipe/bench mark
LEW=Left edge of water
REW=Right edge of water
MPD=Maximum pool depth
TBM=Temporary bench mark
PCT=Pool tail crest
TP=Turning point
TOPool=Top of pool
S-MAX=Max. depth sediment lense
LB=Left bank
RB=Right bank
TOB=Top of bank
BF=Bankfull
T=Thalweg

Three Year SUMMARY							
Year	Cross-section	Bankfull Width	Mean Bankfull Depth	Max Bankfull Depth	Width: Depth Ratio	Flood-prone width	Entrenchment Ratio
1999	1	37.90	2.42	3.24	15.68	55.49	1.46
2001	1	39.80	1.97	3.21	20.20	52.40	1.31
2003	1	37.90	1.43	2.90	26.50	50.80	1.34

UTM X-coord. = 698580
 UTM Y-coord. = 4408212


all measurements in feet

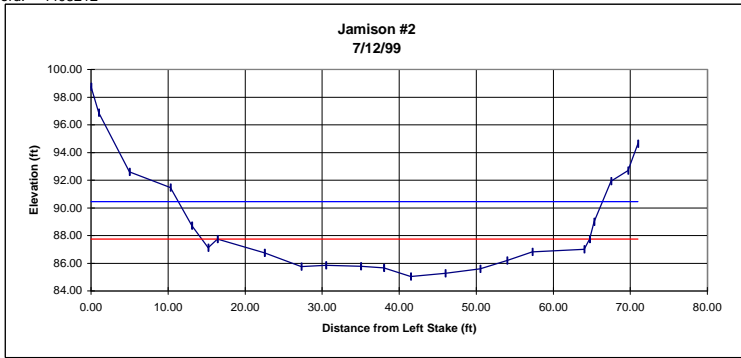


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	98.76	87.75	90.46
1.00	96.87	87.75	90.46
5.00	92.60	87.75	90.46
10.30	91.47	87.75	90.46
13.10	88.72	87.75	90.46
15.20	87.12	87.75	90.46
16.40	87.75	87.75	90.46
22.50	86.75	87.75	90.46
27.30	85.76	87.75	90.46
30.50	85.86	87.75	90.46
35.00	85.78	87.75	90.46
38.00	85.66	87.75	90.46
41.50	85.04	87.75	90.46
46.00	85.28	87.75	90.46
50.50	85.60	87.75	90.46
54.00	86.20	87.75	90.46
57.30	86.81	87.75	90.46
64.00	87.01	87.75	90.46
64.70	87.75	87.75	90.46
65.30	88.99	87.75	90.46
67.50	91.92	87.75	90.46
69.70	92.70	87.75	90.46
71.00	94.63	87.75	90.46

Blue Line=2x Bankfull Elev

Dark Blue Line w/Markers=Basic Cross Section

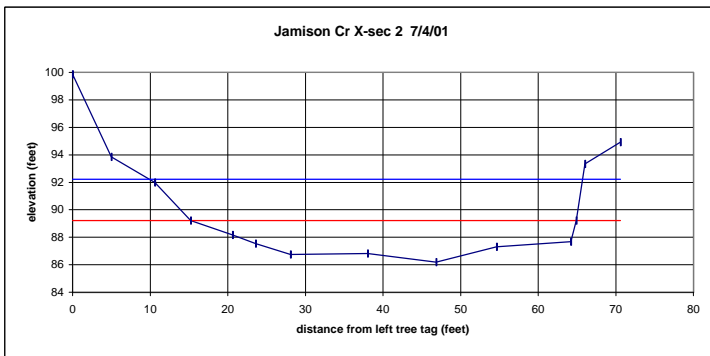

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	0.14	99.86	89.21	92.23	TBM-LB
5	6.14	93.86	89.21	92.23	
10.6	8.02	91.98	89.21	92.23	
15.2	10.79	89.21	89.21	92.23	BFL
20.6	11.83	88.17	89.21	92.23	
23.6	12.45	87.55	89.21	92.23	LEW
28.1	13.25	86.75	89.21	92.23	
38	13.18	86.82	89.21	92.23	
46.85	13.81	86.19	89.21	92.23	T
54.65	12.7	87.3	89.21	92.23	REW
64.2	12.32	87.68	89.21	92.23	
64.9	10.79	89.21	89.21	92.23	BFR
66	6.66	93.34	89.21	92.23	
70.6	5.08	94.92	89.21	92.23	TBM-RB

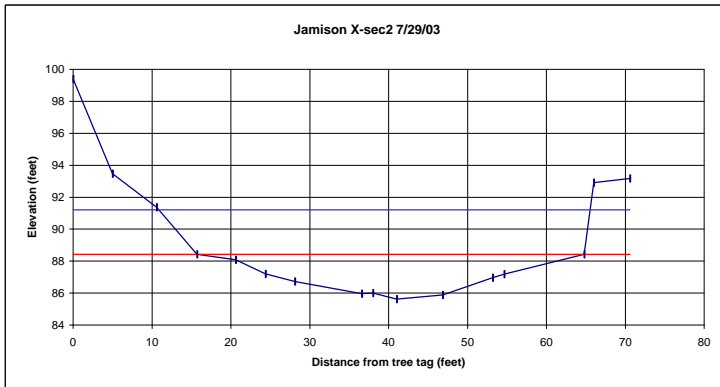


Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	0.6		99.4	88.42	91.21	tbml
5	6.52		93.48	88.42	91.21	
10.6	8.64		91.36	88.42	91.21	
15.7	11.58	0	88.42	88.42	91.21	bfl
20.6	11.92	0.34	88.08	88.42	91.21	
24.4	12.79	1.21	87.21	88.42	91.21	wel
28.1	13.28	1.7	86.72	88.42	91.21	
36.6	14.04	2.46	85.96	88.42	91.21	
38	13.99	2.41	86.01	88.42	91.21	
41	14.37	2.79	85.63	88.42	91.21	t
46.85	14.12	2.54	85.88	88.42	91.21	
53.2	13.03	1.45	86.97	88.42	91.21	wer
54.65	12.81	1.23	87.19	88.42	91.21	
64.8	11.58	0	88.42	88.42	91.21	bfr
66	7.09		92.91	88.42	91.21	
70.6	6.83		93.17	88.42	91.21	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg


Three Year SUMMARY							
Year	Cross-section	Bankfull Width	Bankfull Depth	Max Bankfull Depth	Width: Depth Ratio	Flood-prone width	Entrenchment Ratio
1999	2	48.30	1.77	2.71	27.25	55.08	1.14
2001	2	49.70	1.75	3.02	28.40	54.85	1.10
2003	2	49.10	1.61	2.79	30.44	54.00	1.10

UTM X-coord. = 698613 all measurements in feet
 UTM Y-coord. = 4408161

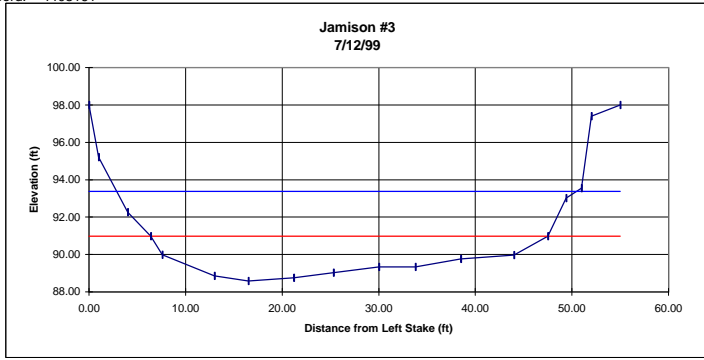


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	98.00	90.98	93.37
1.00	95.20	90.98	93.37
4.00	92.26	90.98	93.37
6.40	90.98	90.98	93.37
7.60	89.98	90.98	93.37
13.00	88.85	90.98	93.37
16.50	88.59	90.98	93.37
21.20	88.75	90.98	93.37
25.30	89.03	90.98	93.37
30.00	89.33	90.98	93.37
33.80	89.33	90.98	93.37
38.50	89.76	90.98	93.37
44.00	89.97	90.98	93.37
47.50	90.98	90.98	93.37
49.40	93.01	90.98	93.37
51.00	93.55	90.98	93.37
52.00	97.39	90.98	93.37
55.00	98.00	90.98	93.37

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

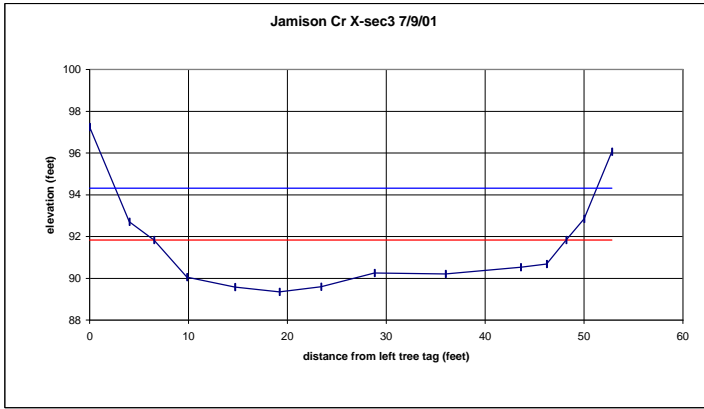

Jamison left stake	7/9/01 Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	2.76	97.24	91.83	94.31	TBM-LB
4	7.3	92.7	91.83	94.31	
6.5	8.17	91.83	91.83	94.31	BFL
9.85	9.94	90.06	91.83	94.31	LEW
14.7	10.42	89.58	91.83	94.31	
19.2	10.65	89.35	91.83	94.31	T
23.4	10.41	89.59	91.83	94.31	
28.8	9.75	90.25	91.83	94.31	
36	9.79	90.21	91.83	94.31	REW
43.6	9.47	90.53	91.83	94.31	
46.2	9.32	90.68	91.83	94.31	
48.2	8.17	91.83	91.83	94.31	BFR
50	7.16	92.84	91.83	94.31	
52.8	3.94	96.06	91.83	94.31	TBM-RB

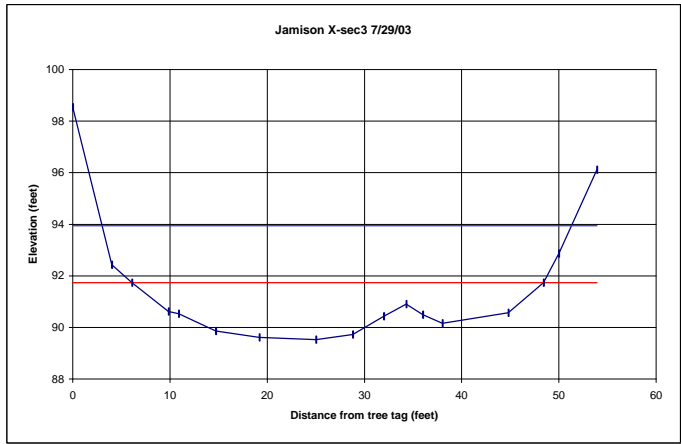


Dist from left stake	Total Depth	Bankfull depth	Total elevation	bankfull elevation	2x Bankfull elevation	Notes
0	1.46		98.54	91.74	93.95	lbrml
4	7.57		92.43	91.74	93.95	
6.1	8.26	0	91.74	91.74	93.95	bfl
9.85	9.38	1.12	90.62	91.74	93.95	
10.9	9.47	1.21	90.53	91.74	93.95	wel
14.7	10.14	1.88	89.86	91.74	93.95	
19.2	10.39	2.13	89.61	91.74	93.95	
25	10.47	2.21	89.53	91.74	93.95	t
28.8	10.27	2.01	89.73	91.74	93.95	
32	9.57	1.31	90.43	91.74	93.95	gbr
34.3	9.1	0.84	90.9	91.74	93.95	gbr
36	9.5	1.24	90.5	91.74	93.95	gbr
38	9.84	1.58	90.16	91.74	93.95	
44.8	9.43	1.17	90.57	91.74	93.95	wer
48.4	8.26	0	91.74	91.74	93.95	bfr
50	7.13		92.87	91.74	93.95	
53.9	3.88		96.12	91.74	93.95	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Three Year SUMMARY							
Year	Cross-section	Bankfull Width	Mean Bankfull Depth	Max Bankfull Depth	Width: Depth Ratio	Flood-prone width	Entrenchment Ratio
1999	3	41.10	1.69	2.39	24.29	47.60	1.16
2001	3	41.70	1.59	2.48	26.22	48.30	1.15
2003	3	42.30	1.39	2.21	30.40	47.90	1.13


UTM X-coord. = 683463
 UTM Y-coord. = 4414247

All measurements are in feet

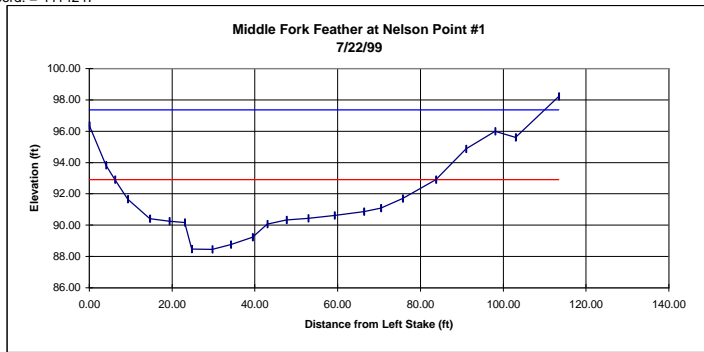


Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	96.36	92.91	97.37
4.00	93.82	92.91	97.37
6.20	92.91	92.91	97.37
9.30	91.66	92.91	97.37
14.60	90.41	92.91	97.37
19.30	90.25	92.91	97.37
23.00	90.16	92.91	97.37
24.70	88.48	92.91	97.37
29.70	88.45	92.91	97.37
34.20	88.76	92.91	97.37
39.40	89.22	92.91	97.37
43.00	90.07	92.91	97.37
47.60	90.34	92.91	97.37
52.90	90.44	92.91	97.37
59.20	90.62	92.91	97.37
66.30	90.86	92.91	97.37
70.40	91.09	92.91	97.37
75.70	91.70	92.91	97.37
83.70	92.91	92.91	97.37
91.00	94.88	92.91	97.37
98.00	96.00	92.91	97.37
103.00	95.60	92.91	97.37
113.40	98.22	92.91	97.37

Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

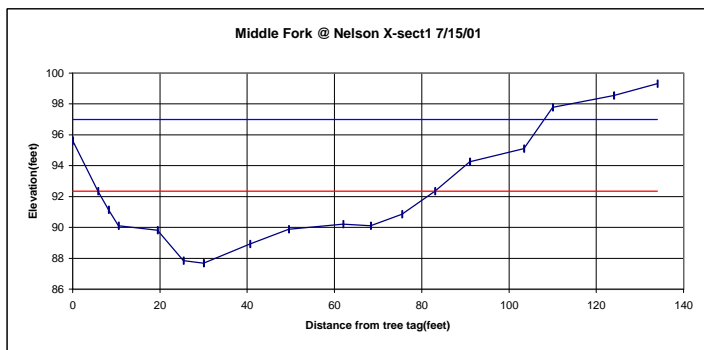

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	4.38	95.62	92.34	96.99	TBM-LB
5.8	7.66	92.34	92.34	96.99	BFL
8.2	8.86	91.14	92.34	96.99	
10.5	9.89	90.11	92.34	96.99	LEW
19.4	10.19	89.81	92.34	96.99	
25.4	12.16	87.84	92.34	96.99	
30	12.31	87.69	92.34	96.99	T
40.6	11.08	88.92	92.34	96.99	
49.5	10.13	89.87	92.34	96.99	
62	9.8	90.2	92.34	96.99	
68.3	9.9	90.1	92.34	96.99	REW
75.5	9.14	90.86	92.34	96.99	
83	7.66	92.34	92.34	96.99	BFR
91	5.75	94.25	92.34	96.99	
103.4	4.89	95.11	92.34	96.99	
110	2.21	97.79	92.34	96.99	
124	1.45	98.55	92.34	96.99	
134	0.68	99.32	92.34	96.99	TBM-RB

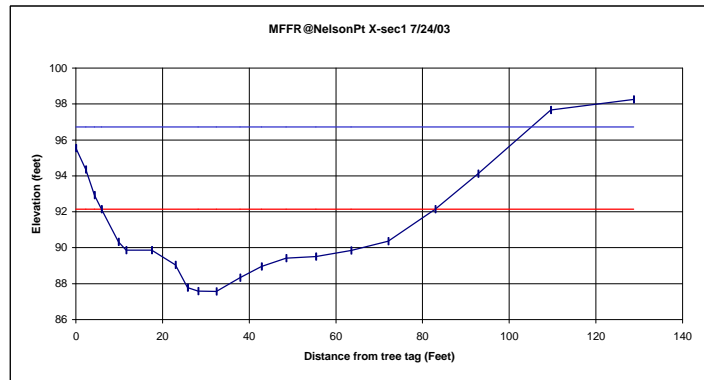

Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	4.45		95.55	92.14	96.72	tbml
2.3	5.64		94.36	92.14	96.72	
4.3	7.08		92.92	92.14	96.72	
5.9	7.86	0	92.14	92.14	96.72	bfi
9.8	9.68	1.82	90.32	92.14	96.72	wel
11.6	10.13	2.27	89.87	92.14	96.72	
17.5	10.13	2.27	89.87	92.14	96.72	
23	10.95	3.09	89.05	92.14	96.72	
25.8	12.21	4.35	87.79	92.14	96.72	
28.2	12.42	4.56	87.58	92.14	96.72	
32.4	12.44	4.58	87.56	92.14	96.72	t
37.9	11.66	3.8	88.34	92.14	96.72	
42.8	11.05	3.19	88.95	92.14	96.72	
48.5	10.58	2.72	89.42	92.14	96.72	
55.4	10.49	2.63	89.51	92.14	96.72	
63.5	10.16	2.3	89.84	92.14	96.72	
72.1	9.63	1.77	90.37	92.14	96.72	wer
82.9	7.86	0	92.14	92.14	96.72	bfr
92.8	5.87		94.13	92.14	96.72	
109.6	2.34		97.66	92.14	96.72	
128.7	1.74		98.26	92.14	96.72	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg


Three Year SUMMARY		Mean	Max	Width:	Flood-	Entrench-	
Year	Cross-section	Bankfull Width	Bankfull Depth	Bankfull Depth	Ratio	ment Ratio	
1999	1	77.50	2.74	4.46	28.26	110.03	1.42
2001	1	77.20	2.44	4.65	31.63	108.00	1.40
2003	1	77.00	2.81	4.58	27.40	113.70	1.48

2003 ENTRENCHMENT
 bankfull width 77
 max bankfull depth 4.58 floodprone width
 2x max bankfull depth 9.16 right bank left bank
 width at c 113.7 108.3 5.4
 entrenchment ratio=D/. 1.48

2003 WIDTH TO DEPTH RATIO


mean bank 2.81
 width: dept 27.40

UTM X-coord. = 683461
 UTM Y-coord. = 4414485

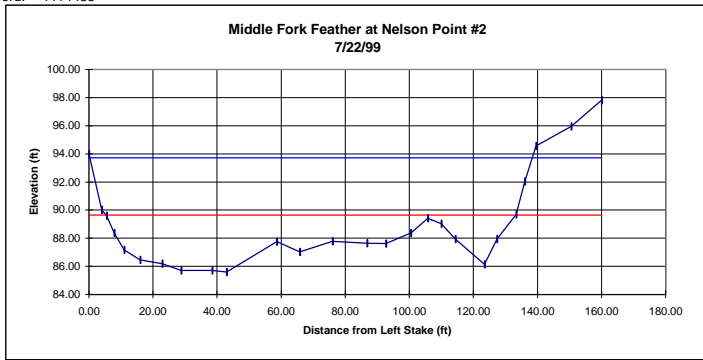


Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Left Stake	Total Elevation	Bankfull Elevation	2xBankfull Elevation
0.00	94.00	89.655	93.71
4.00	90.00	89.655	93.71
5.50	89.61	89.655	93.71
7.90	88.36	89.655	93.71
11.00	87.16	89.655	93.71
16.00	86.46	89.655	93.71
22.90	86.18	89.655	93.71
28.80	85.70	89.655	93.71
38.50	85.71	89.655	93.71
43.00	85.60	89.655	93.71
58.60	87.76	89.655	93.71
65.80	87.03	89.655	93.71
76.00	87.78	89.655	93.71
86.80	87.64	89.655	93.71
92.70	87.61	89.655	93.71
100.50	88.37	89.655	93.71
105.80	89.42	89.655	93.71
110.00	89.02	89.655	93.71
114.40	87.93	89.66	93.71
123.50	86.15	89.655	93.71
127.40	87.93	89.655	93.71
133.40	89.70	89.655	93.71
136.00	92.03	89.655	93.71
139.50	94.57	89.655	93.71
150.50	95.95	89.655	93.71
160.00	97.82	89.655	93.71

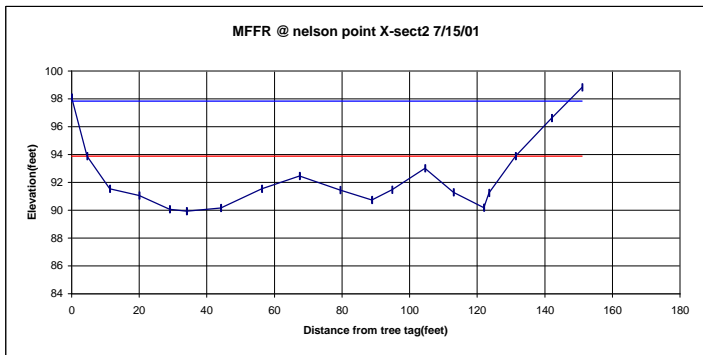

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	1.91	98.09	93.89	97.85	TBM-LB
4.5	6.11	93.89	93.89	97.85	BFL
11.3	8.46	91.54	93.89	97.85	LEW
20	8.94	91.06	93.89	97.85	
29	9.93	90.07	93.89	97.85	
34	10.07	89.93	93.89	97.85	T
44.1	9.84	90.16	93.89	97.85	
56.2	8.45	91.55	93.89	97.85	REW
67.4	7.53	92.47	93.89	97.85	
79.4	8.56	91.44	93.89	97.85	LEW
88.8	9.27	90.73	93.89	97.85	
94.8	8.52	91.48	93.89	97.85	REW
104.5	6.98	93.02	93.89	97.85	
113	8.71	91.29	93.89	97.85	LEW
122	9.81	90.19	93.89	97.85	
123.5	8.75	91.25	93.89	97.85	REW
131.3	6.11	93.89	93.89	97.85	BFR
142	3.37	96.63	93.89	97.85	
151	1.18	98.82	93.89	97.85	

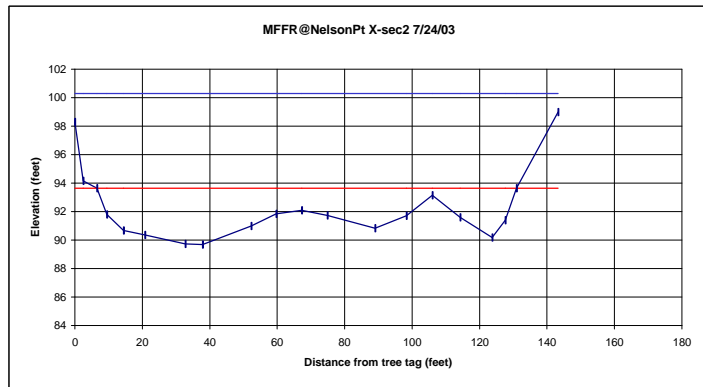

Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	2x Bankfull elevation	Notes
0	1.7		98.3	93.64	100.3	tblml
2.5	5.85		94.15	93.64	100.3	
6.5	6.36	0	93.64	93.64	100.3	bfl
9.5	8.2	1.84	91.8	93.64	100.3	wel
14.4	9.33	2.97	90.67	93.64	100.3	
20.8	9.63	3.27	90.37	93.64	100.3	
32.7	10.26	3.9	89.74	93.64	100.3	
37.9	10.32	3.96	89.68	93.64	100.3	t
52.3	9.02	2.66	90.98	93.64	100.3	
59.7	8.16	1.8	91.84	93.64	100.3	wel mid ch bar
67.3	7.91	1.55	92.09	93.64	100.3	
74.9	8.26	1.9	91.74	93.64	100.3	wel mid ch bar
89	9.17	2.81	90.83	93.64	100.3	
98.3	8.29	1.93	91.71	93.64	100.3	wel mid ch bar
106	6.85	0.49	93.15	93.64	100.3	
114.2	8.4	2.04	91.6	93.64	100.3	wel mid ch bar
123.7	9.82	3.46	90.18	93.64	100.3	
127.6	8.6	2.24	91.4	93.64	100.3	wel
130.9	6.36	0	93.64	93.64	100.3	bfr
143.3	1.02		98.98	93.64	100.3	endr


TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Three Year SUMMARY						
Year	Cross-section	Bankfull Width	Bankfull Depth	Max Bankfull Depth	Flood-prone width Ratio	Entrenchment Ratio
1999	2	127.90	2.28	4.01	55.99	138.02
2001	2	126.80	2.55	3.96	49.70	145.00
2003	2	124.40	2.30	3.96	54.06	138.60

UTM X-coord. = 683697
 UTM Y-coord. = 4414529


All measurements are in feet

Dist. From Total UTM X-coord. = 683698
 Left Stake Elevation UTM Y-coord. = 4414530

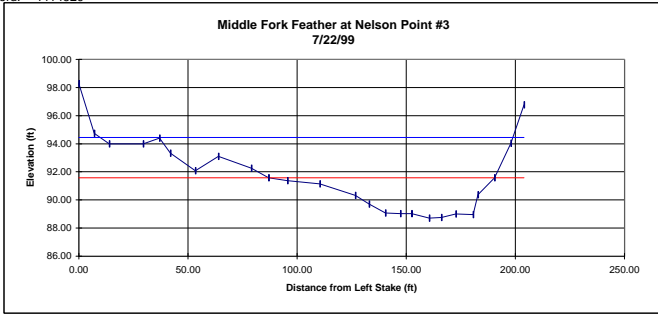


Blue Line=2x Bankfull Elev Red Line=Mean Bankfull Elev Dark Blue Line w/Markers=Basic Cross Section

Dist. From Left Stake	Total Elevation	UTM X-coord.	UTM Y-coord.
0.00	98.26	683698	4414530
7.00	94.75		
14.00	94.00		
29.40	93.98		
37.00	94.41		
42.00	93.32		
53.40	92.08		
64.00	93.10		
79.00	92.26		
87.00	91.57		
95.60	91.38		
110.40	91.14		
126.70	90.32		
133.00	89.71		
140.50	89.07		
147.30	89.02		
152.50	89.03		
160.50	88.70		
166.20	88.75		
172.70	89.00		
180.60	88.95		
182.90	90.36		
190.50	91.57		

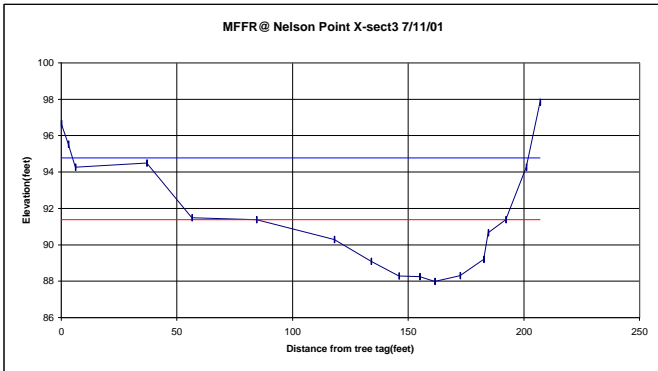

MFFR Nelson 7/15/01

Dist. From left stake	Total depth	Total Elevation	Bankfull Elevation	2xBankfull Elevation	Notes
0	3.35	96.65	91.38	94.78	TBM-LB
3	4.46	95.54	91.38	94.78	
6.1	5.74	94.26	91.38	94.78	
37	5.5	94.5	91.38	94.78	
56.4	8.52	91.48	91.38	94.78	
84.4	8.62	91.38	91.38	94.78	BFL
118	9.7	90.3	91.38	94.78	
133.9	10.9	89.1	91.38	94.78	LEW
146	11.72	88.28	91.38	94.78	
154.9	11.74	88.26	91.38	94.78	
161.5	12.02	87.98	91.38	94.78	T
172.4	11.69	88.31	91.38	94.78	
182.6	10.8	89.2	91.38	94.78	REW
184.5	9.34	90.66	91.38	94.78	
192.15	8.62	91.38	91.38	94.78	BFR
201	5.74	94.26	91.38	94.78	
207	2.16	97.84	91.38	94.78	TBM-RB

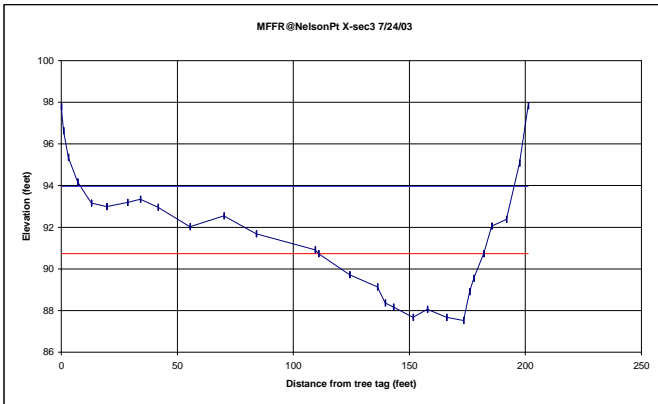

mffr at nelson crossection-3 7/24/03

Dist from left stake	Total Depth	Bankfull depth	Total elevation	Bankfull elevation	Bankfull elevation	Notes
0	2.21		97.79	90.74	93.96	tbrml
0.9	3.36		96.64	90.74	93.96	
3	4.64		95.36	90.74	93.96	
7	5.82		94.18	90.74	93.96	tbl
13	6.84		93.16	90.74	93.96	
19.6	7		93	90.74	93.96	
28.5	6.81		93.19	90.74	93.96	
34	6.65		93.35	90.74	93.96	
41.7	7.04		92.96	90.74	93.96	
55.5	7.97		92.03	90.74	93.96	
70	7.46		92.54	90.74	93.96	A
84	8.32		91.68	90.74	93.96	B
109.3	9.09		90.91	90.74	93.96	C
110.8	9.26	0	90.74	90.74	93.96	bfl
124.2	10.28	1.02	89.72	90.74	93.96	
136.2	10.86	1.6	89.14	90.74	93.96	wel
139.5	11.63	2.37	88.37	90.74	93.96	
143.2	11.83	2.57	88.17	90.74	93.96	A
151.5	12.32	3.06	87.68	90.74	93.96	B
157.8	11.94	2.68	88.06	90.74	93.96	
166	12.33	3.07	87.67	90.74	93.96	
173.3	12.48	3.22	87.52	90.74	93.96	t
176	11.09	1.83	88.91	90.74	93.96	wer
177.8	10.45	1.19	89.55	90.74	93.96	
182	9.26	0	90.74	90.74	93.96	bfr
185.5	7.94		92.06	90.74	93.96	
191.8	7.62		92.38	90.74	93.96	
197.5	4.92		95.08	90.74	93.96	
201.2	2.16		97.84	90.74	93.96	endr

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max depth sediment lens
 LB=Left bank
 RB=Right bank
 TOB=Top of bank
 BF=Bankfull
 T=Thalweg

Three Year SUMMARY							
Year	Cross-section	Bankfull Width	Bankfull Depth	Mean Bankfull Depth	Width: Depth Ratio	Flood-prone width	Entrenchment Ratio
1999	3	103.50	1.95	2.87	53.05	189.01	1.83
2001	3	107.75	2.10	3.40	51.30	197.90	1.83
2003	3	71.20	2.06	3.22	34.64	185.10	2.60

2003 ENTRENCHMENT
 bankfull width 71.2
 max bankfull depth 3.22 floodprone width
 2x max bankfull depth 6.44 right bank left bank
 width at c 185.1 195.1 10
 entrenchment ratio=D/. 2.60

2003 WIDTH TO DEPTH RATIO
 Bankfull width 71.2
 mean bankfull depth 2.06
 width: depthratio=A/B 34.64

APPENDIX D – PEBBLE COUNT ANALYSIS
Stream Condition Inventory
Sediment Data Analysis
12/8/03

Background:

The Feather River Coordinated Resource Management (FRCRM) group, under a variety of funding programs, has been conducting watershed trend monitoring since 1999. This monitoring has utilized a variety of metrics at multiple spatial and temporal scales. The purpose of this monitoring is to ascertain change (trends) in watershed function. Utilization of multiple metrics over a range of time and space scales allows for analyses that incorporate both qualitative and quantitative data and observations. The following is a draft analysis of quantified sediment data buttressed with qualitative observation of sediment related inputs (discharge and sediment supply) at the watershed (spatial) scale over the previous decade (temporal) scale.

Flow Regime/Sediment Input Discussion:

The Feather River watershed has experienced two (2) distinct climatic regimes over the last decade. Water year (WY) 1992-3 was the first year of a six-year period (WY92-WY98) of much above normal precipitation. WY93-4 was the only dry year in the period. This period was characterized by frequent moderate to large flood events culminating in the 1997 flood of record.

WY1999-0 ushered in a four-year period (WY99-0 to present) of below normal precipitation with no flood* events. WY 2002-3 was the only year with normal precipitation, largely due to a very wet spring, which maintained an extended period of elevated in-channel flows.

Significant Flood Dates: Jan. '93, Jan. '95, Mar. '95, May '95, Jan. '97

Table #1- Total Annual Precipitation (inches of water); (Wilcox data, 1995-03, Genesee, Ca.).

WY 95-96	WY 96-97	WY 97-98	WY 98-99	WY 99-00	WY 00-01	WY 01-02	WY 02-03	WY Ave.
54.55	58.90	60.70	47.80	43.65	23.60	33.60	49.60	46.55

Typically, large floods deliver significant sediment and debris inputs to the channel system throughout the watershed. Depending on magnitude and frequency these inputs result in a dynamic channel response of interrelated processes. The 1997 flood of record (~48,000 cfs./Indian Cr. @ Crescent Mills) affected each subwatershed differently. However, the net result was locally catastrophic delivery of sediments and debris from tributaries to the mainstem channels (Indian Creek, Spanish Creek, NFFR and MFFR). The more frequent, longer duration low flows begin a process of re-working the deposited materials concurrent with ongoing vegetation recovery.

*Flood as used in this context means no flows exceeding a 2-year event at the watershed scale.

Sampling Methodologies:

The FRCRM has used two (2) distinct methodologies to sample sediment composition. The first is bulk sampling of bar and bed materials using a sieve analysis to derive compositional attributes of fully mobilized sediments by size/weight. The second is to conduct pebble counts to derive compositional attributes of channel bed surfaces by size (median diameter). The initial sampling conducted in 1999 collected bulk samples, still being analyzed. The 2001 and 2003 sampling consisted of pebble counts.

The above differentiation is done for two (2) reasons. Bulk sampling is very expensive. While the data derived is detailed and accurate, subsequent sampling is only useful if the intervening flow regime has resulted in significant mobilization of the bed and substrate. Significant bed mobilizing flows have not occurred since 1998.

Pebble counts are inherently skewed toward the larger particles that resist movement at flows less than bankfull. However, as the watershed responds to, and processes, the inputs from the preceding wet period trends in the distribution of sediments on the surface can be discerned in the ongoing below normal flow regime.

Analysis Methodology:

Sediment analyses typically use metrics that represent median particle sizes by size class and annotated as D_* . D_* expresses the percent of particles in the sample that are less than D value (i.e. D_{35} expresses that 35% of the particles are finer than this size or size class. Stream Condition Inventory protocols have typically looked at D_{50} value as the analysis metric. This value is also used frequently in stream classification systems to characterize the physical bed surface (e.g. sand, gravel, cobble, etc.). While the D_{50} absolute value may change slightly (e.g. 39 mm to 48 mm) it is still a gravel bed channel. A D_{50} change that reflects a gross bed character change (e.g., from a gravel bed to sand bed channel) indicates a major perturbation in watershed condition. A change on this scale would likely be detected with other monitoring metrics.

When analyzing trend changes in watershed condition and its effects on water quality and biological processes other size thresholds are more sensitive indicators of condition change. This analysis explores the changes represented by three size thresholds: D_{35} , D_{50} , D_{84} . The D_{35} values characterize the response of the finer sediments that can be mobilized at most elevated flows. High percentages of fine sediments have been linked to watershed disturbance as a source and as a biological stressor in the aquatic environment.

The D_{84} threshold has been determined to be the portion of the bed mobilized most frequently at the bankfull discharge. These are the materials that determine channel bed form. The frequency of mobilization also determines the optimum habitat opportunities of a particular channel reach (i.e., macro-invertebrates, spawning, etc.).

Analysis Summary:

The purpose of this analysis is to tentatively posit which stream reaches are improving, static or declining based on sediment size. Alternatively, these data should still be considered as baseline conditions. The data sets are limited (2 samples) over a three-year period 2000-2003. The criteria used to evaluate the data sets compared three size thresholds (D_{35} , D_{50} , D_{84}) between the 2001 and 2003 samples. The underlying inferences are: 1.) a coarsening of fine sediments indicate a reduction in supply/deposition of damaging silts and sands; 2.) a static trend in the median sizes indicates no major perturbations in the watershed; and, 3.) a fining of the coarser sediments would indicate effective re-working of bed pavements deposited by the previous floods, which provides cleansing and aeration for aquatic organisms.

The composite trend that would indicate improvement would be a coarsening of the fine sediments, static or coarsening of median size and a fining of the larger particles. If the data showed improvement in 2 of 3 threshold values, the channel was improving. If there was improvement in only one threshold and no significant decline in the others the trend was considered static. If there was

decline in 2 or more thresholds the reach is in decline. The following Table #2 gives the threshold values for each reach and the trend determination.

Table #2- D* Values for Analysis (in millimeters)

Reach Name	Data Year- 2001			Data Year- 2003			Trend
	D ₃₅	D ₅₀	D ₈₄	D ₃₅	D ₅₀	D ₈₄	
Last Chance below Murdoch	8.3	18	38	15.5	20	35	+
Indian Cr. @ Flournoy Br.	24	30	53	21	27	45	=
Indian Cr. below T-ville	22.5	35	69	31	36	60	+
Lights Creek	15	18	33	14.5	16	26	=
Wolf Creek	9.8	15.5	32	16.5	18.5	33	+
Indian Cr. above Spanish Cr.**	42	102	330	62	104	270	+
Rock Creek @ Spanish Cr.	19	22	79	27	37	100	+
Spanish Cr. above Greenhorn	7.8	11	23	14	17	28	+
Greenhorn Cr. above Spanish	17	21.5	37	15	18	29.5	-
Spanish Cr. above Indian	20	29.5	73	18.5	28.5	73	=
EBNFFR above NFFR**	74	102	110	53	95	105	+
NFFR above Lk. Almanor**	14	60	220	16	110	340	-
Butt Creek	18	29	75	22	27	52	+
NFFR above EBNFFR	41	55	93	19.5	30	130	-
MFFR @ Beckwourth	3.4	4.9	14	13	15	22	+
Sulphur Creek	19.5	31	73	25	39	92	+
Jamison Creek @ MFFR	21.5	34	75	23	32	75	=
MFFR @ Nelson Creek**	70	92	160	55	73	150	+
	Data Year- 1995			Data Year- 2003			
	D ₃₅	D ₅₀	D ₈₄	D ₃₅	D ₅₀	D ₈₄	
Red Clover below Chase Br.	4.7	15	74	17	22.5	560	+
Hungry Creek	24	46	165	15	19.5	46	-

The comparison indicates that 12 reaches are in an improving trend, 4 reaches are static and four reaches are showing decline (Greenhorn abv Spanish, NFFR abv Almanor, NFFR abv EBNFFR, and Hungry Creek). It must be noted that some of the improvements may be attributable to several low flow years followed by a sustained spring flushing flow just before 2003 sampling.


BUTT CREEK

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	0	4	0	4
2-4mm	3	0	4	0	0
4-8mm	6	9	6	9	2
8-16mm	12	26	10	17	4
16-32mm	24	43	42	17	32
32-64mm	48	70	81	27	39
64-128mm	96	90	97	20	16
128-256mm	192	98	100	8	3
256-512mm	384	100	100	2	0
512-1024mm	768	100	100	0	0
				100	100

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

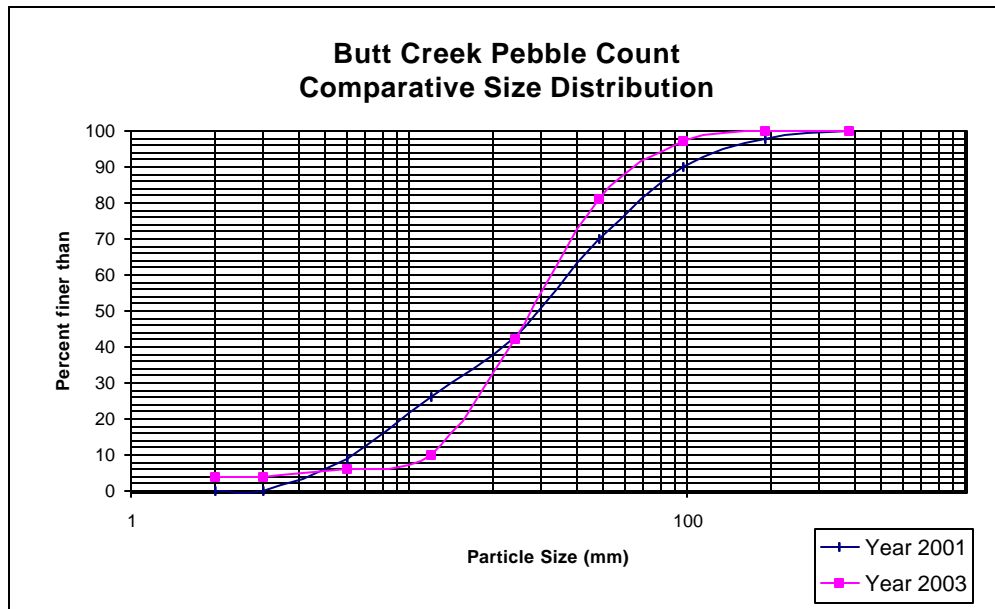

<u>YEAR</u>	<u>D₅₀ (mm)</u>
2001	29.5
2003	27


NFFR abv Almanor

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	1	18	1	18
2-4mm	3	1	18	0	0
4-8mm	6	4	18	3	0
8-16mm	12	19	18	15	0
16-32mm	24	35	34	16	16
32-64mm	48	46	40	11	6
64-128mm	96	59	47	13	7
128-256mm	192	82	73	23	26
256-512mm	384	88	86	6	13
512-1024mm	768	100	100	12	14
				100	100

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

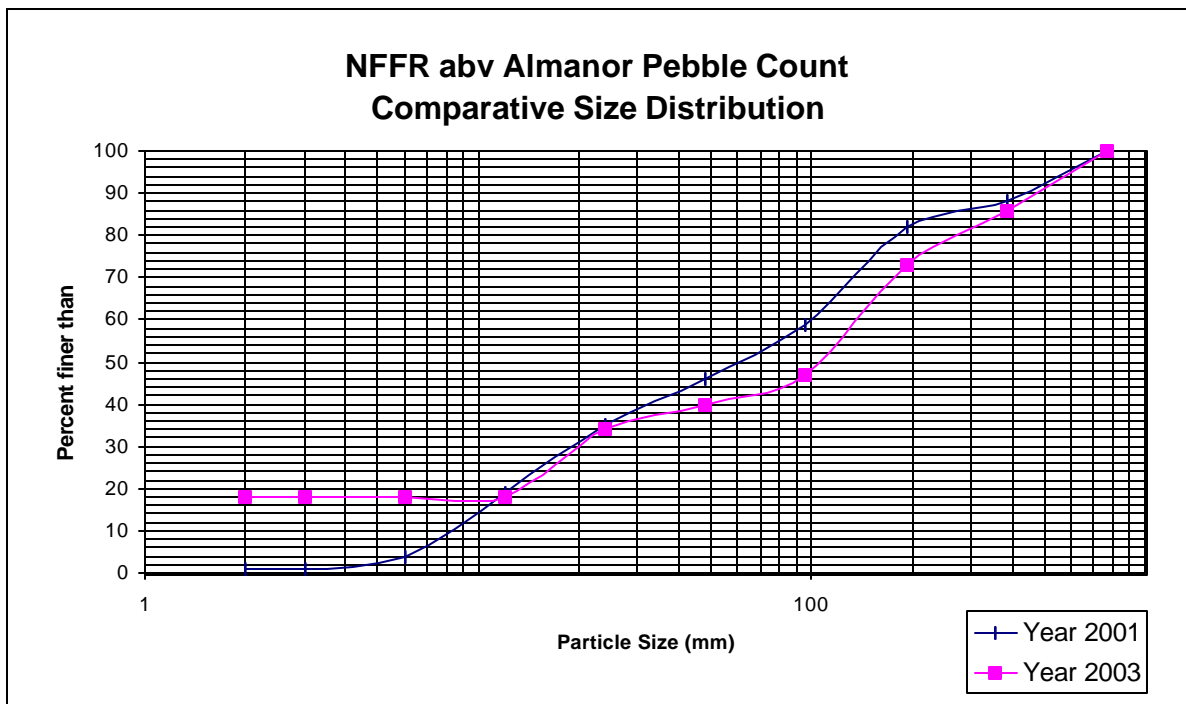

<u>YEAR</u>	<u>D₅₀ (mm)</u>
2001	50
2003	103


NFFR abv EBNFFR

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	0	2	0	2
2-4mm	3	1	7	1	5
4-8mm	6	1	8	0	1
8-16mm	12	10	16	9	8
16-32mm	24	20	44	10	28
32-64mm	48	42	59	22	15
64-128mm	96	85	78	43	19
128-256mm	192	98	96	13	18
256-512mm	384	100	100	2	4
512-1024mm	768	100	100	0	0
				100	100

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

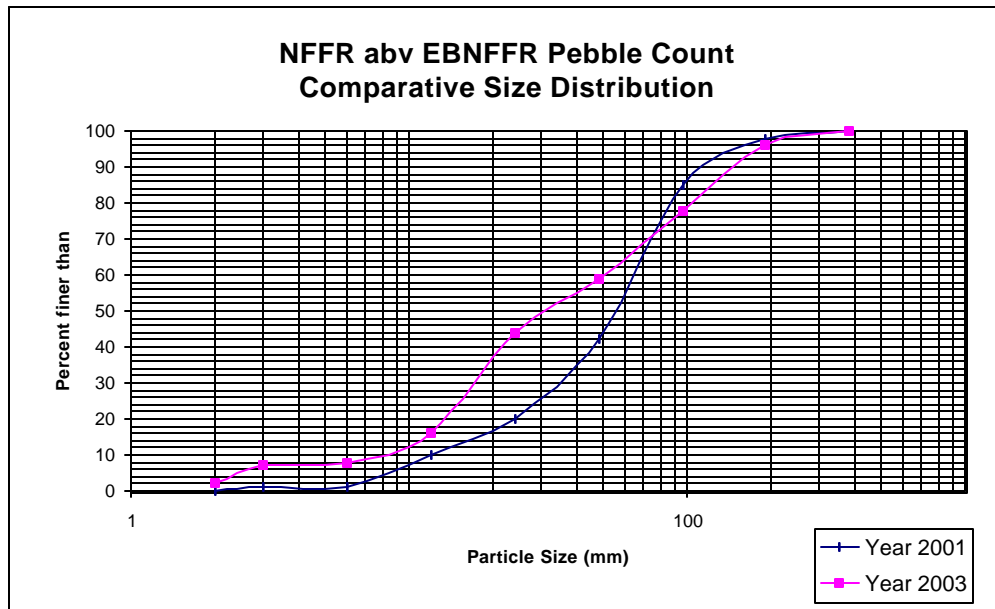

<u>YEAR</u>	<u>D₅₀ (mm)</u>
2001	55
2003	30


Last Chance blw Murdoch X-ing

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	31	15	32	15
2-4mm	3	31	16	0	1
4-8mm	6	32	19	1	3
8-16mm	12	41	23	9	4
16-32mm	24	58	61	18	38
32-64mm	48	95	99	38	38
64-128mm	96	100	100	5	1
128-256mm	192	100	100	0	0
256-512mm	384	100	100	0	0
512-1024mm	768	100	100	0	0
				103	100

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

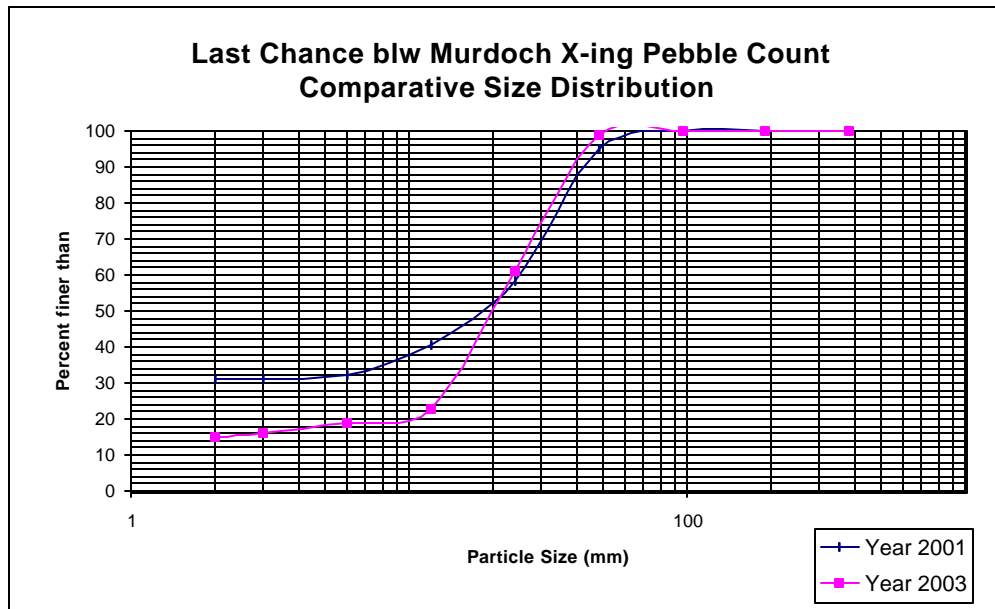

<u>YEAR</u>	<u>D₅₀ (mm)</u>
2001	18
2003	21


Red Clover blw Chase Bridge

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 1995	PERCENT, 2003	SIZE CT., 1995	SIZE CT., 2003
<2mm	2	29	9	30	9
2-4mm	3	29	11	0	2
4-8mm	6	39	14	10	3
8-16mm	12	48	19	9	5
16-32mm	24	57	53	10	34
32-64mm	48	67	62	10	9
64-128mm	96	93	66	27	4
128-256mm	192	98	68	5	2
256-512mm	384	98	68	0	0
512-1024mm	768	100	100	2	32
				103	100

**NOTE: The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

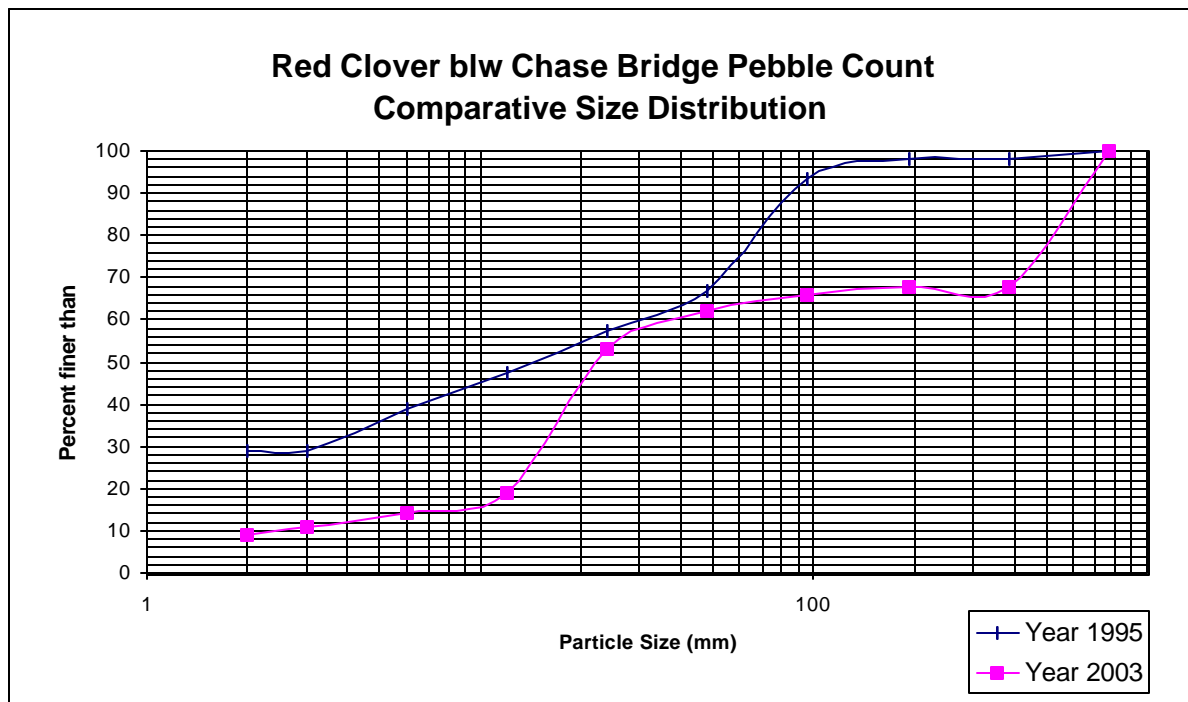

<u>YEAR</u>	<u>D₅₀ (mm)</u>
1995	15
2001	23


Indian Creek abv Flournoy Bridge

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	1	13	1	13
2-4mm	3	3	13	2	0
4-8mm	6	5	13	2	0
8-16mm	12	12	14	7	1
16-32mm	24	36	43	24	29
32-64mm	48	80	87	44	44
64-128mm	96	100	99	20	12
128-256mm	192	100	100	0	1
256-512mm	384	100	100	0	0
512-1024mm	768	100	100	0	0
				100	100

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

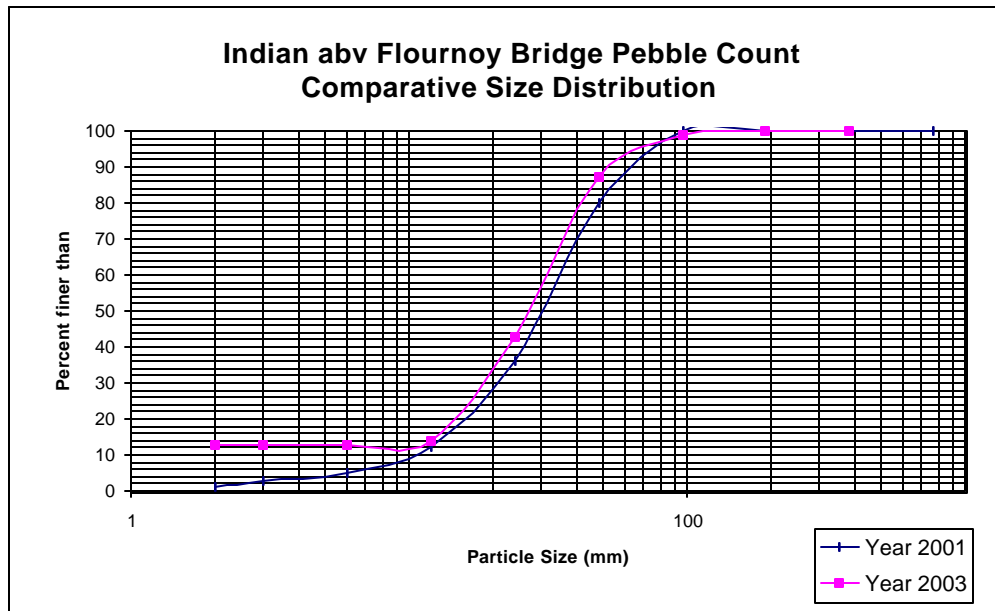

<u>YEAR</u>	<u>D₅₀ (mm)</u>
2001	30
2003	27


Indian Creek abv Flournoy Bridge

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	1	13	1	13
2-4mm	3	3	13	2	0
4-8mm	6	5	13	2	0
8-16mm	12	12	14	7	1
16-32mm	24	36	43	24	29
32-64mm	48	80	87	44	44
64-128mm	96	100	99	20	12
128-256mm	192	100	100	0	1
256-512mm	384	100	100	0	0
512-1024mm	768	100	100	0	0
				100	100

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

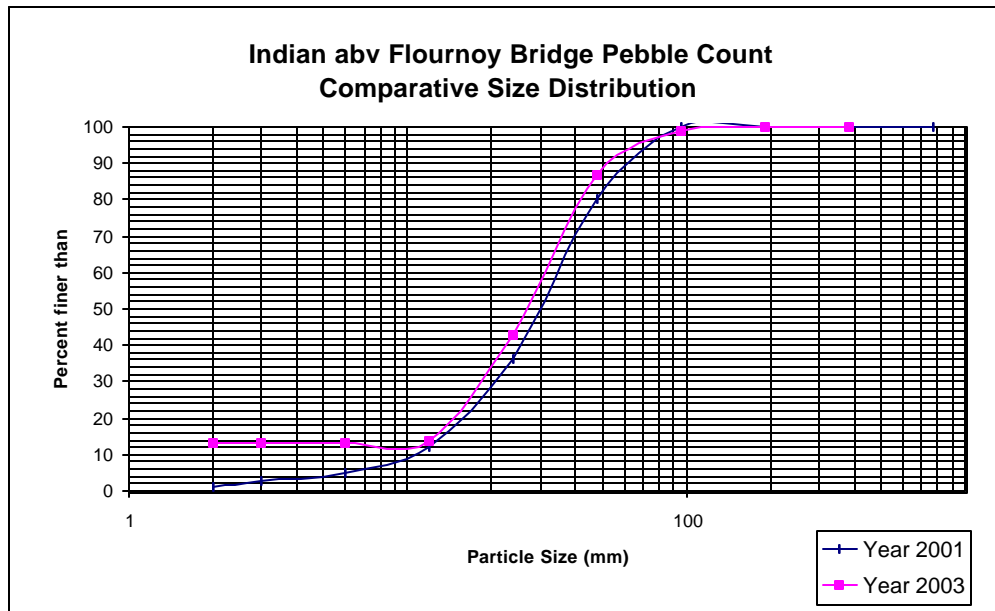

<u>YEAR</u>	<u>D₅₀ (mm)</u>
2001	30
2003	27


Indian Creek blw Taylorsville Bridge

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	22	6	22	6
2-4mm	3	22	6	0	0
4-8mm	6	23	6	1	0
8-16mm	12	29	6	6	0
16-32mm	24	37	18	8	12
32-64mm	48	64	73	27	55
64-128mm	96	99	96	35	23
128-256mm	192	100	100	1	4
256-512mm	384	100	100	0	0
512-1024mm	768	100	100	0	0
				100	100

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

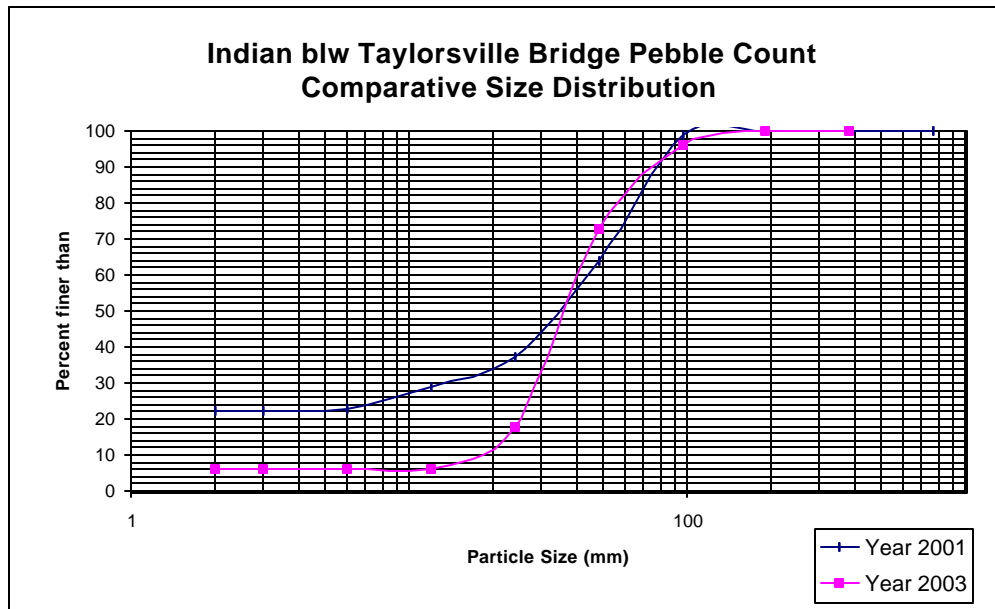

<u>YEAR</u>	<u>D₅₀ (mm)</u>
2001	35
2003	36


Lights Creek

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	13	17	13	17
2-4mm	3	13	17	0	0
4-8mm	6	16	19	3	2
8-16mm	12	26	26	10	7
16-32mm	24	67	80	41	54
32-64mm	48	99	100	32	20
64-128mm	96	100	100	1	0
128-256mm	192	100	100	0	0
256-512mm	384	100	100	0	0
512-1024mm	768	100	100	0	0
				100	100

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

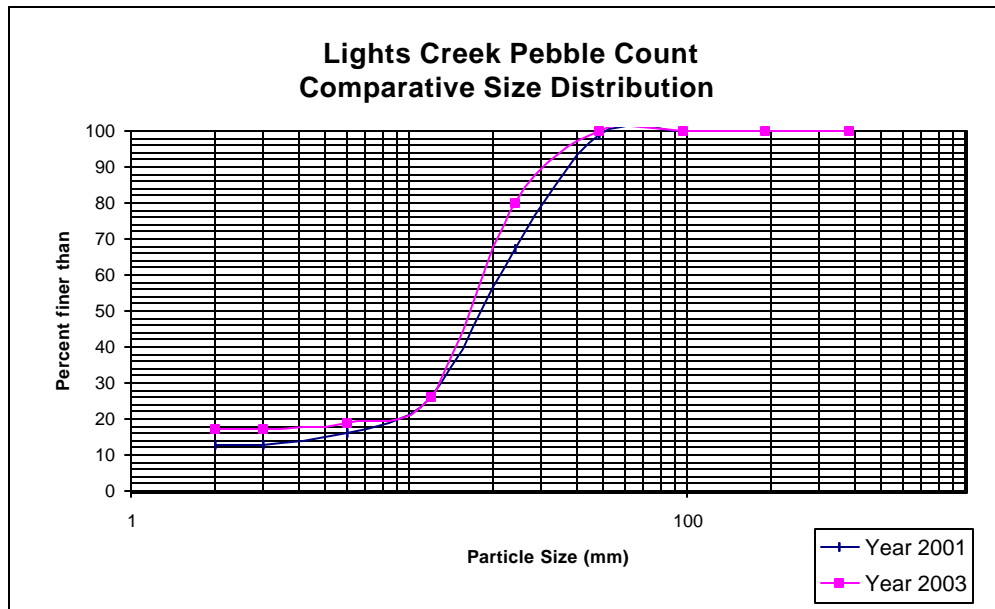

<u>YEAR</u>	<u>D₅₀ (mm)</u>
2001	18
2003	16.5


WOLF CREEK

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	28	6	28	6
2-4mm	3	28	7	0	1
4-8mm	6	28	8	0	1
8-16mm	12	41	19	13	11
16-32mm	24	74	69	33	50
32-64mm	48	96	97	22	28
64-128mm	96	100	99	4	2
128-256mm	192	100	100	0	1
256-512mm	384	100	100	0	0
512-1024mm	768	100	100	0	0
				100	100

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

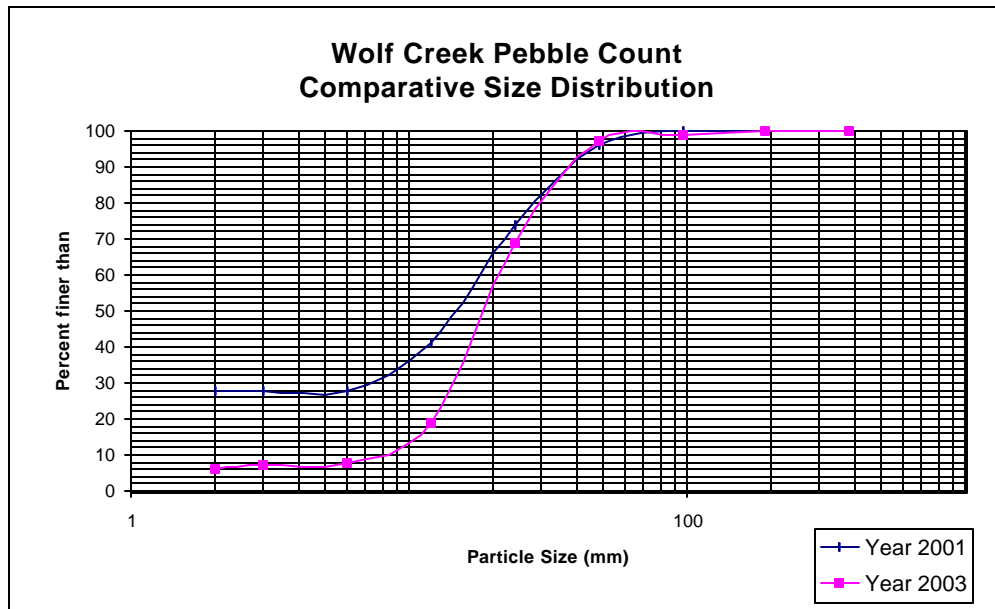

<u>YEAR</u>	<u>D₅₀ (mm)</u>
2001	15.5
2003	18.5


Indian Creek abv Spanish

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	24	5	24	5
2-4mm	3	25	5	1	0
4-8mm	6	27	5	2	0
8-16mm	12	29	7	2	2
16-32mm	24	29	18	0	11
32-64mm	48	37	31	8	13
64-128mm	96	47	43	10	12
128-256mm	192	69	67	22	24
256-512mm	384	81	98	12	31
512-1024mm	768	100	100	19	2
				100	100

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

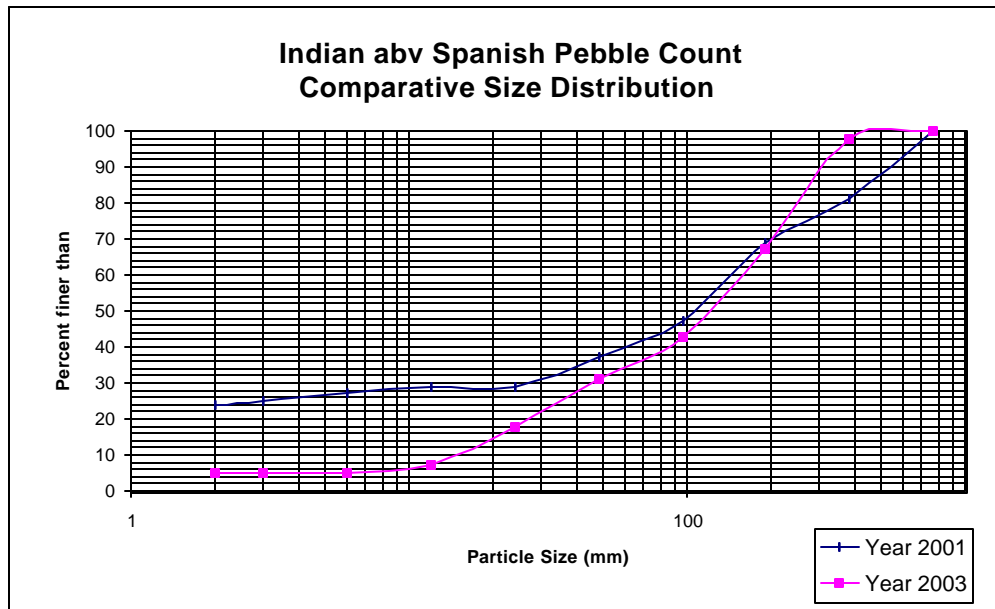

<u>YEAR</u>	<u>D₅₀ (mm)</u>
2001	102
2003	104


ROCK CREEK

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	4	4	4	4
2-4mm	3	7	4	3	0
4-8mm	6	14	4	7	0
8-16mm	12	26	5	12	1
16-32mm	24	41	29	15	24
32-64mm	48	64	61	23	32
64-128mm	96	90	83	26	22
128-256mm	192	95	95	5	12
256-512mm	384	98	100	3	5
512-1024mm	768	100	100	2	0
				100	100

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

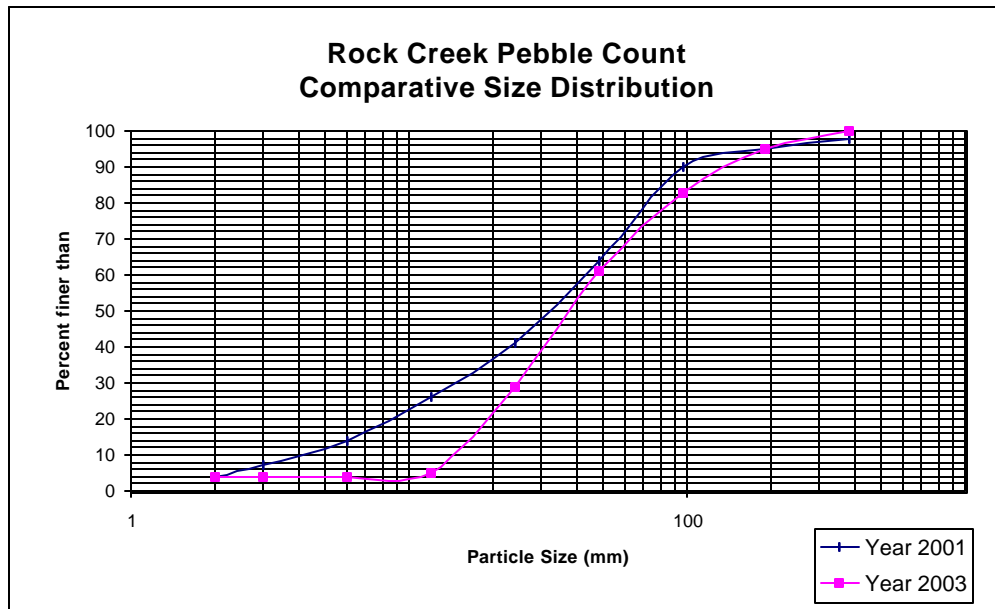

<u>YEAR</u>	<u>D₅₀ (mm)</u>
2001	33
2003	38


GREENHORN CREEK

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	2	7	2	7
2-4mm	3	2	10	0	3
4-8mm	6	3	14	1	4
8-16mm	12	19	26	16	11
16-32mm	24	58	74	39	48
32-64mm	48	95	100	37	25
64-128mm	96	100	100	5	0
128-256mm	192	100	100	0	0
256-512mm	384	100	100	0	0
512-1024mm	768	100	100	0	0
				100	98

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

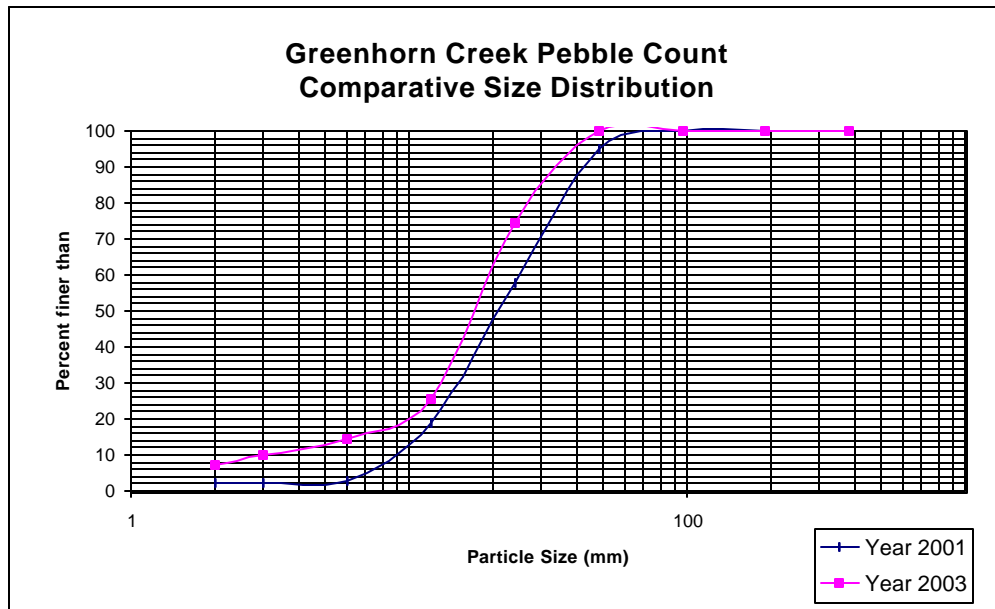

<u>YEAR</u>	<u>D₅₀ (mm)</u>
2001	17.5
2003	22

SPANISH abv GREENHORN


Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	2	9	2	9
2-4mm	3	12	11	10	2
4-8mm	6	25	14	13	3
8-16mm	12	56	30	31	16
16-32mm	24	87	78	31	48
32-64mm	48	100	100	13	22
64-128mm	96	100	100	0	0
128-256mm	192	100	100	0	0
256-512mm	384	100	100	0	0
512-1024mm	768	100	100	0	0
				100	100

	Cobbles	Boulders	Bedrock	
	64 to 128	128 to 256	>256	
	Class 7	Class 8	Class 9	Class 10
	0	0	0	0
	0	0	0	0
	0	0	0	0
	0	0	0	0
	0	0	0	0

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

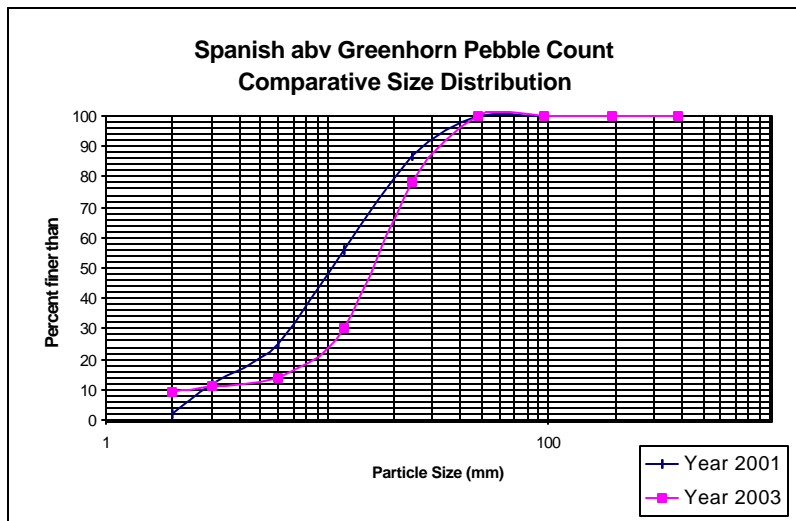

YEAR	D ₅₀ (mm)
2001	11
2003	16.5


SPANISH abv INDIAN

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	1	9	1	9
2-4mm	3	5	9	4	0
4-8mm	6	9	12	4	3
8-16mm	12	19	19	10	7
16-32mm	24	42	45	23	26
32-64mm	48	70	61	28	16
64-128mm	96	91	73	21	12
128-256mm	192	100	89	9	16
256-512mm	384	100	100	0	11
512-1024mm	768	100	100	0	0
				100	100

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

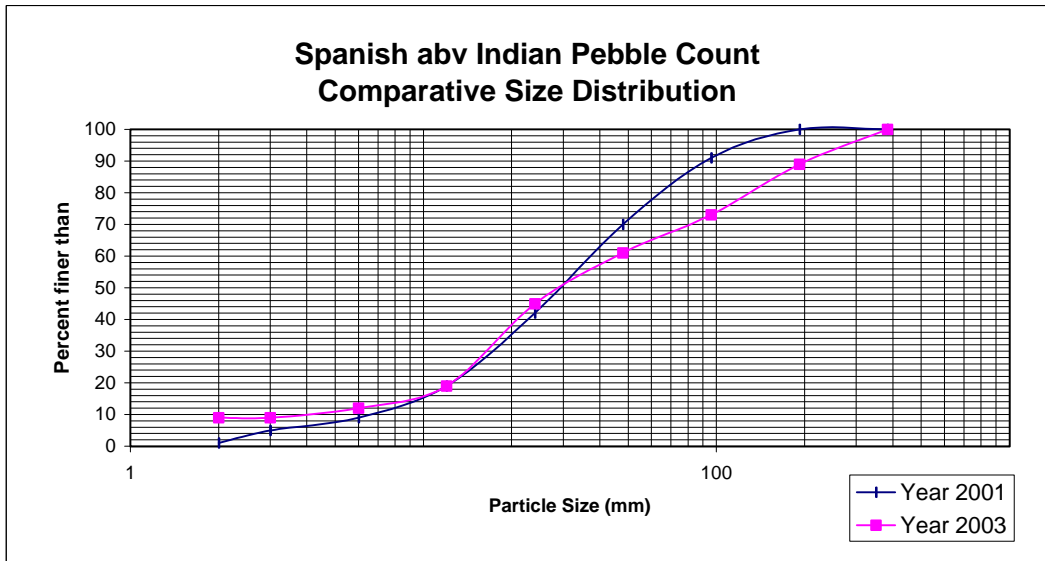

YEAR	D ₅₀ (mm)
2001	29
2003	28.5


EBNFFR abv NFFR

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	18	4	18	4
2-4mm	3	19	4	1	0
4-8mm	6	19	6	0	2
8-16mm	12	22	8	3	2
16-32mm	24	24	19	2	11
32-64mm	48	28	32	4	13
64-128mm	96	43	62	15	29
128-256mm	192	83	96	40	34
256-512mm	384	95	100	12	4
512-1024mm	768	100	100	5	0
				100	99

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

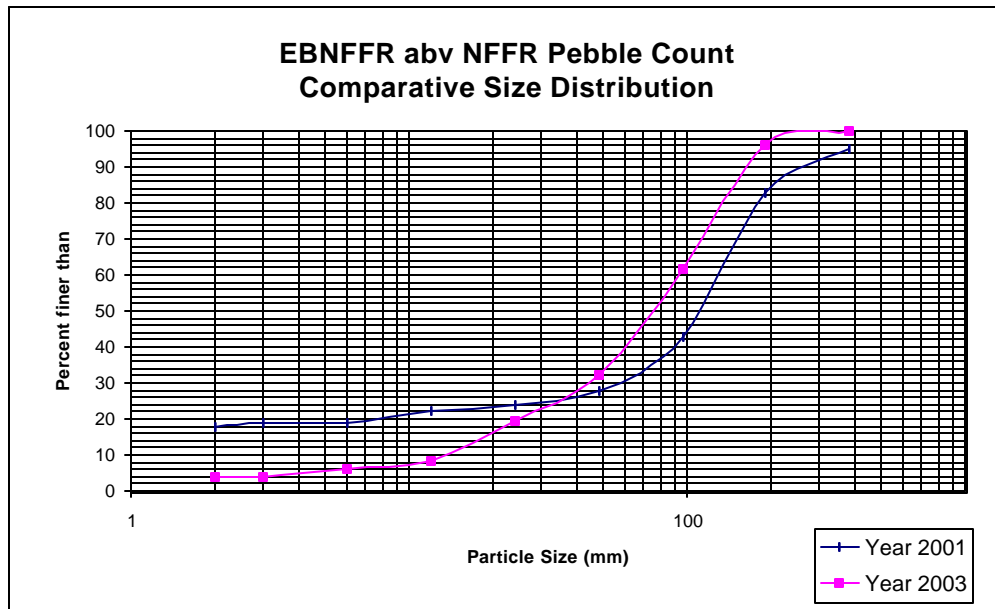

<u>YEAR</u>	<u>D₅₀ (mm)</u>
2001	102
2003	74


MFFR @ Beckwourth

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	19	18	19	18
2-4mm	3	31	19	12	1
4-8mm	6	58	26	27	7
8-16mm	12	82	36	24	10
16-32mm	24	92	91	10	55
32-64mm	48	100	100	8	9
64-128mm	96	100	100	0	0
128-256mm	192	100	100	0	0
256-512mm	384	100	100	0	0
512-1024mm	768	100	100	0	0
				100	100

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

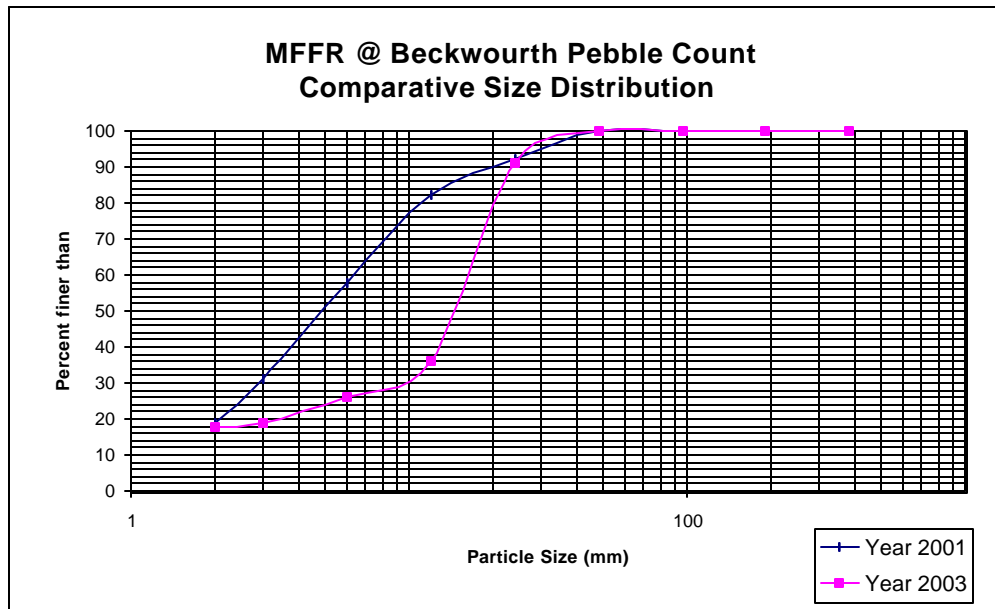

<u>YEAR</u>	<u>D₅₀ (mm)</u>
2001	5
2003	15


Sulphur Creek

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	0	9	0	9
2-4mm	3	0	11	0	2
4-8mm	6	4	14	4	3
8-16mm	12	21	15	17	1
16-32mm	24	42	34	21	19
32-64mm	48	65	57	23	23
64-128mm	96	94	85	29	28
128-256mm	192	100	99	6	14
256-512mm	384	100	100	0	1
512-1024mm	768	100	100	0	0
				100	100

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

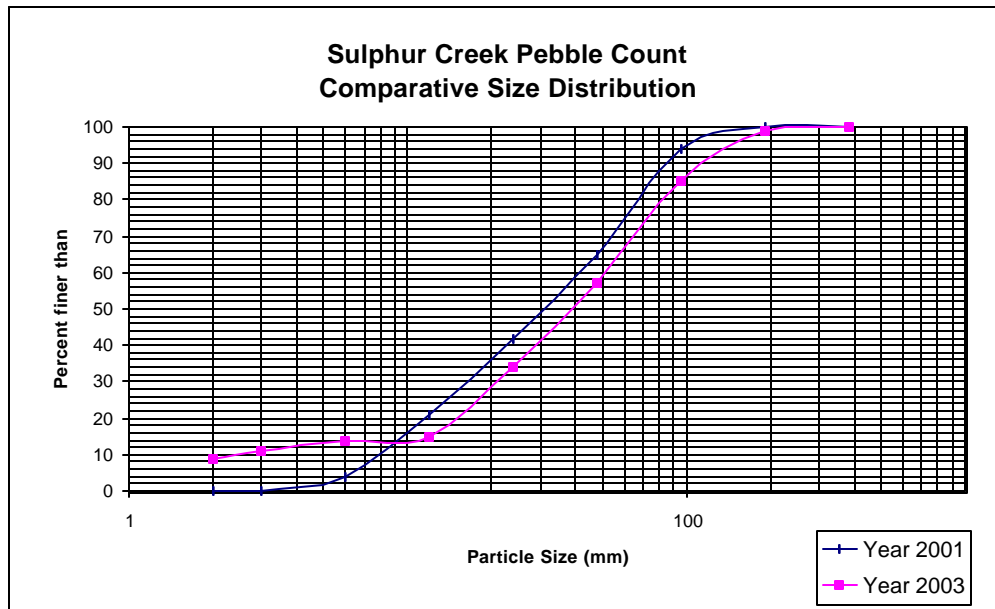

<u>YEAR</u>	<u>D₅₀ (mm)</u>
2001	30
2003	40


JAMISON CREEK

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	0	2	0	2
2-4mm	3	1	4	1	2
4-8mm	6	1	6	0	2
8-16mm	12	15	8	14	2
16-32mm	24	40	38	25	30
32-64mm	48	61	66	22	28
64-128mm	96	94	91	33	25
128-256mm	192	98	99	4	8
256-512mm	384	100	99	2	0
512-1024mm	768	100	100	0	1
				101	100

****NOTE:** The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

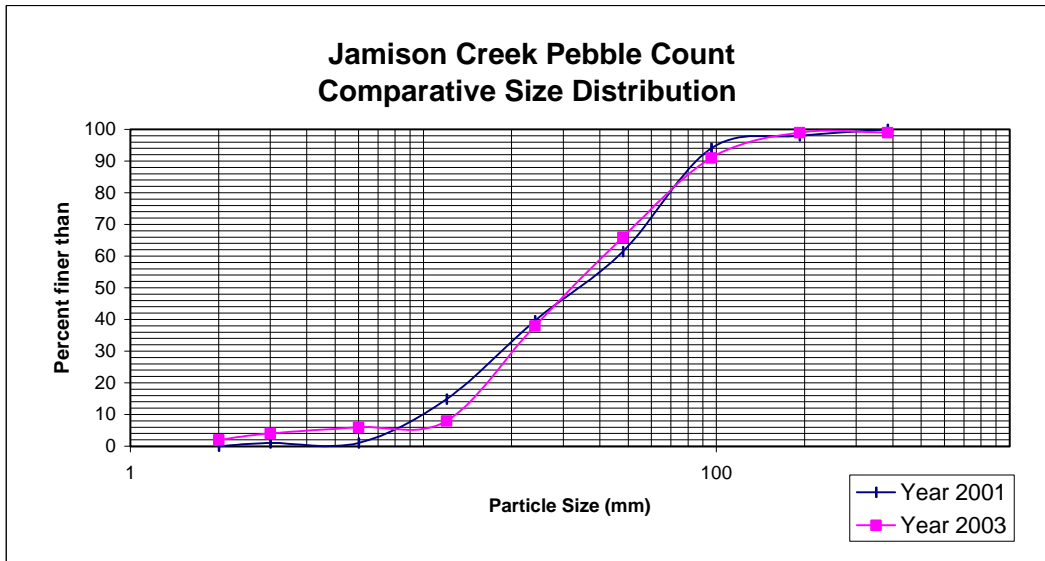

YEAR	D ₅₀ (mm)
2001	34
2003	32


MFFR @ Nelson Cr.

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 2001	PERCENT, 2003	SIZE CT., 2001	SIZE CT., 2003
<2mm	2	0	0	0	0
2-4mm	3	1	1	1	1
4-8mm	6	1	3	0	2
8-16mm	12	3	5	2	2
16-32mm	24	12	19	9	14
32-64mm	48	19	30	7	11
64-128mm	96	52	64	33	34
128-256mm	192	95	94	43	30
256-512mm	384	97	100	2	6
512-1024mm	768	100	100	3	0
				100	100

****NOTE:** The above values are the median size for the sampled size classess.

All samples were derived from riffles closest to the cross-sections.

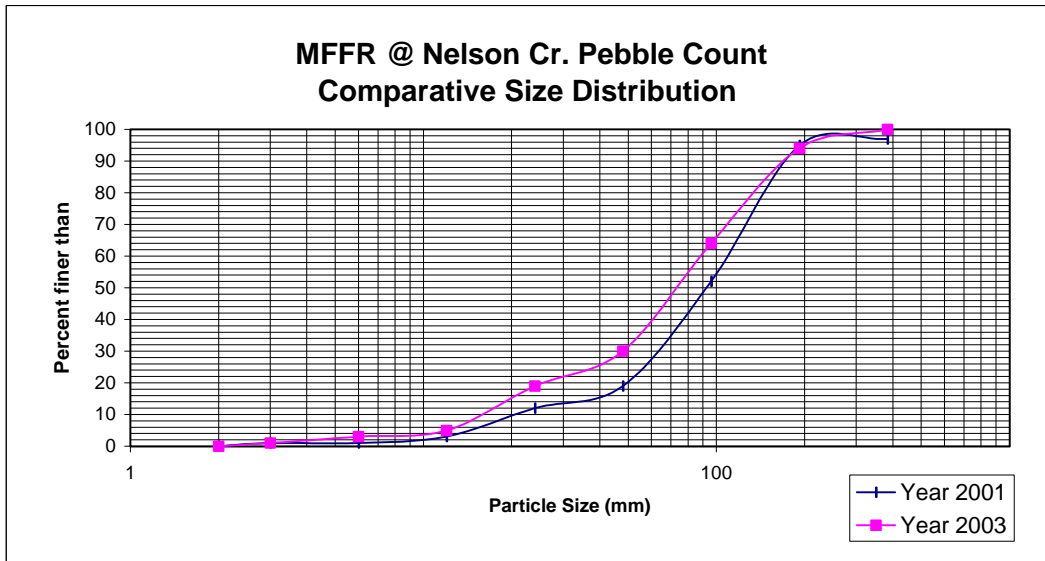

YEAR	D ₅₀ (mm)
2001	93
2003	74


Hungry Creek

Pebble Count Comparative Particle Size Distributions-- Yr 01-03

SIZE CLASSES	**SIZE(mm)	PERCENT, 1995	PERCENT, 2001	SIZE CT., 1995	SIZE CT., 2001
<2mm	2	13	0	13	0
2-4mm	3	15	0	2	0
4-8mm	6	19	10	4	9
8-16mm	12	25	27	6	16
16-32mm	24	35	59	10	30
32-64mm	48	51	85	16	24
64-128mm	96	65	95	14	9
128-256mm	192	89	97	24	2
256-512mm	384	100	99	11	2
512-1024mm	768	100	100	0	1
				100	93

**NOTE: The above values are the median size for the sampled size classes.

All samples were derived from riffles closest to the cross-sections.

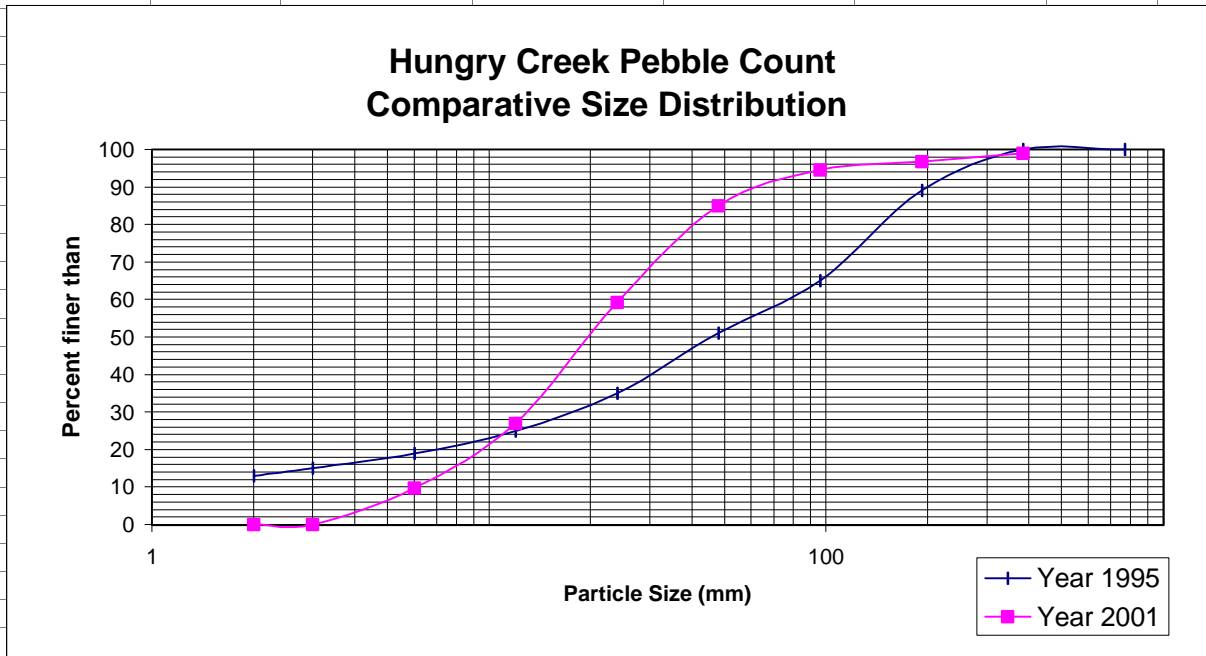

YEAR	D ₅₀ (mm)
1995	46
2001	19.5

APPENDIX E


CHANNEL PROFILES

Butt Cr Longitudinal Profiles, Water Surface Edits

6/30/99

Station	Elevation	Notes
1030	91.09	LEW
857	91.41	TOPool
817	92.35	
618	92.61	TOPool
437	94.03	
353	95.2	
280	95.65	
245	95.79	
187	95.86	
0	97.52	REW


slope = 0.62%

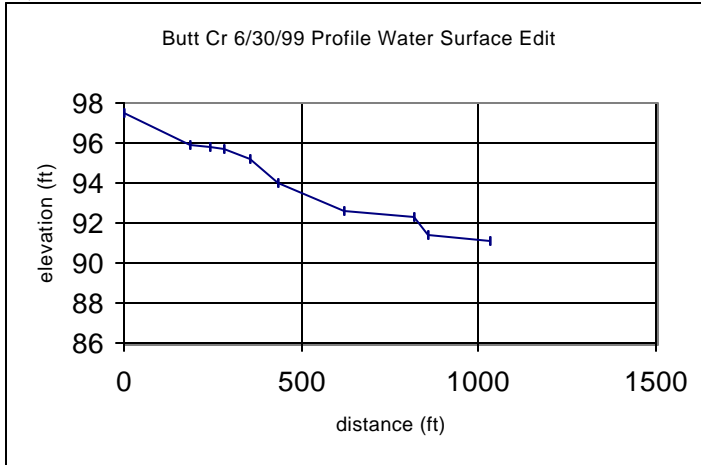

7/23/01

Station	Elevation	Notes
20	90.72	REW
49	90.65	REW
122	89.69	TOPool
177	89.51	REW
203	89.15	TOPool
273	88.96	REW
332	88.82	TOPool
399	88.65	LEW
400	88.56	LEW
405	88.32	TOPool
437	88.39	LEW
500	87.74	TOPool
556	87.63	REW
618	86.84	TOPool
650	86.68	REW
675	86.18	TOPool
753	86.1	REW
890	84.87	TOPool
1104	84.86	LEW


slope = 0.54%

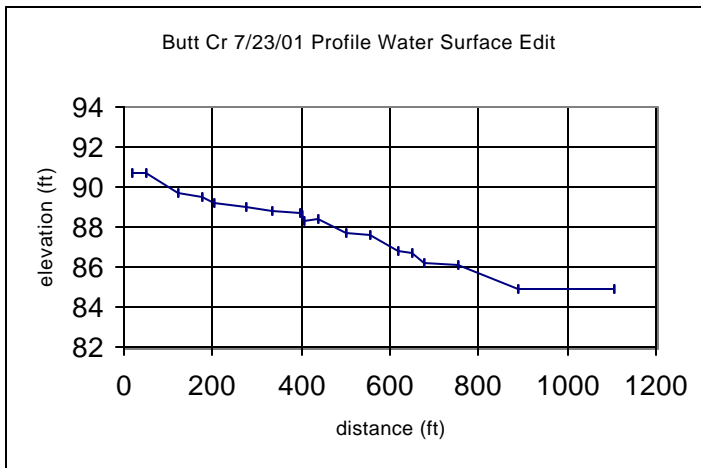

7/21/03

Station (ft)	ELEV	Notes
0	90.82	wer
190	89.4	wer/top
294	89.22	wer
372	88.83	wel/top
438	88.2	wel
488	87.84	wer/top/tp
552	85.83	wel
745	84.45	toptp
815	81.33	wel
881	80.49	wer/top
1084	80.48	wer/tp
1093	80.39	wel

slope = 0.95%

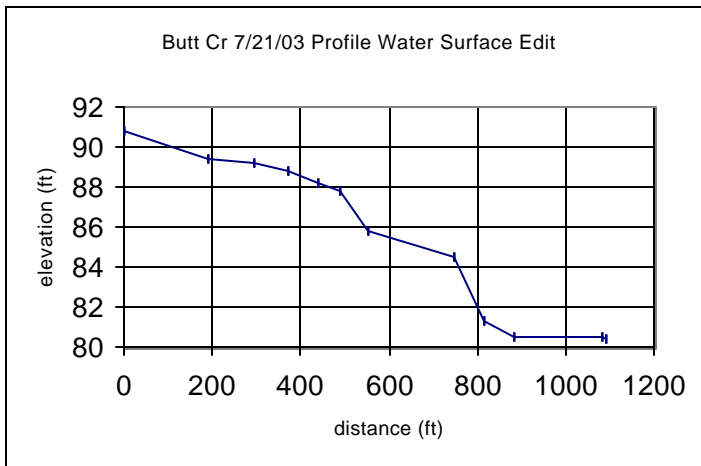

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lens
 LB=Left bank
 RB=Right bank


Note: All elevations are water surface except MPD & PCT

North Fork Feather River above Lake Almanor (near Domingo Springs) Longitudinal Profiles, Water Surface Edits

7/28/99

Station	Elevation	Notes
0	97.53	LEW
24	97.51	
140	96.07	
186	94.17	
238	92.29	
284	92.33	
365	91.66	
386	90.41	TOPool
414	90.24	
425	88.82	
444	88.49	
527	87.33	TOPool
600	87.04	
691	85.87	
756	84.51	TOPool
896	84.31	
993	84.14	

slope = 1.34%

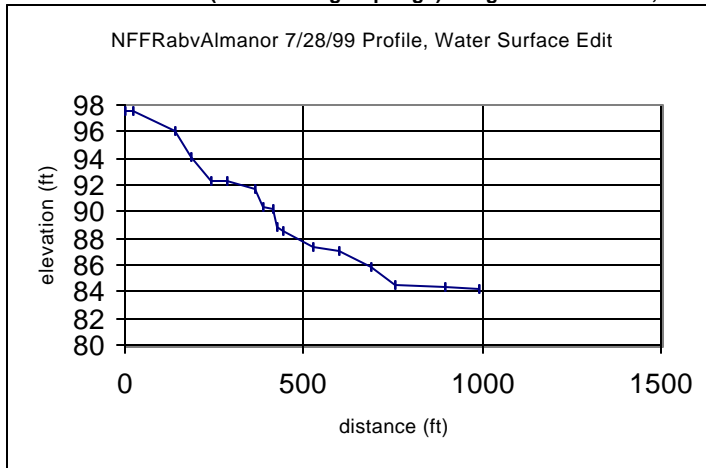


7/31/01 slope = 1.70% string machine error - no chart

7/23/03

Station (ft)	ELEV	Notes
0	97.6	wel
24	97.4	wel
120	96.18	wel
220	92.73	wel
296	92.21	wel/top
359	91.7	wer
384	90.56	wel/top/tp
400	90.1	wer
515	87.48	wel/top
580	87.5	wer/tp
727	82.56	wer/top
984	81.98	wer

slope = 1.59%

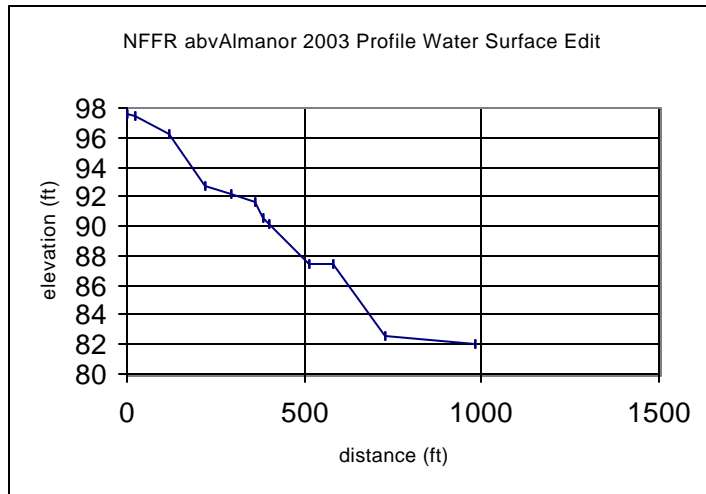


TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 Note: All elevations are water surface except MPD & PCT

North Fork Feather River abv East Branch, Longitudinal Profiles, Water Surface Edits

8/11/99

Station	Elevation	Notes
0	98.03	LEW
66	97.72	
93	97.13	
164	96.27	
282	93.88	
476	93.26	
590	92.99	
747	91.52	
884	88.73	
964	87.16	
1024	86.82	
1050	86.66	


slope = 1.08%

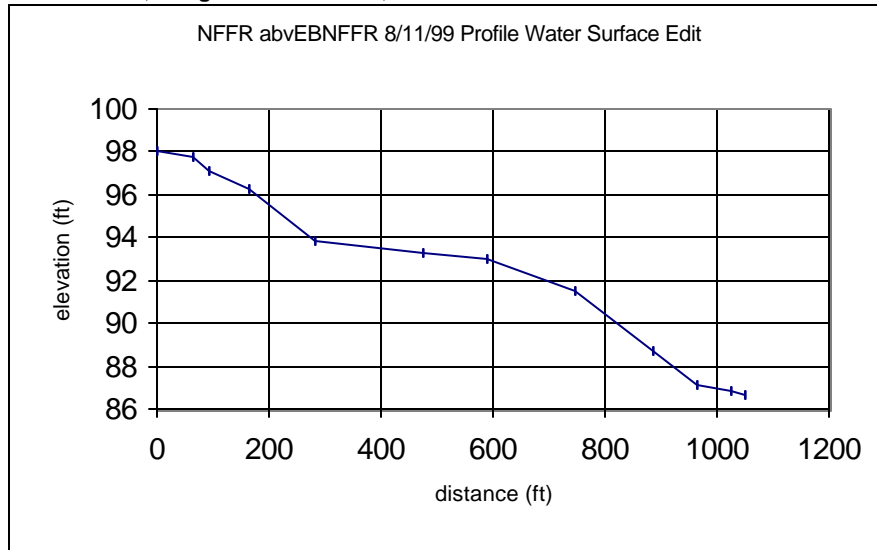

7/19/01

Station	Elevation	Notes
0	98.18	REW
86	96.96	TOPool
141	96.33	LEW
391	92.95	TOPool
515	93.01	LEW
600	92.81	LEW


slope = 0.90%

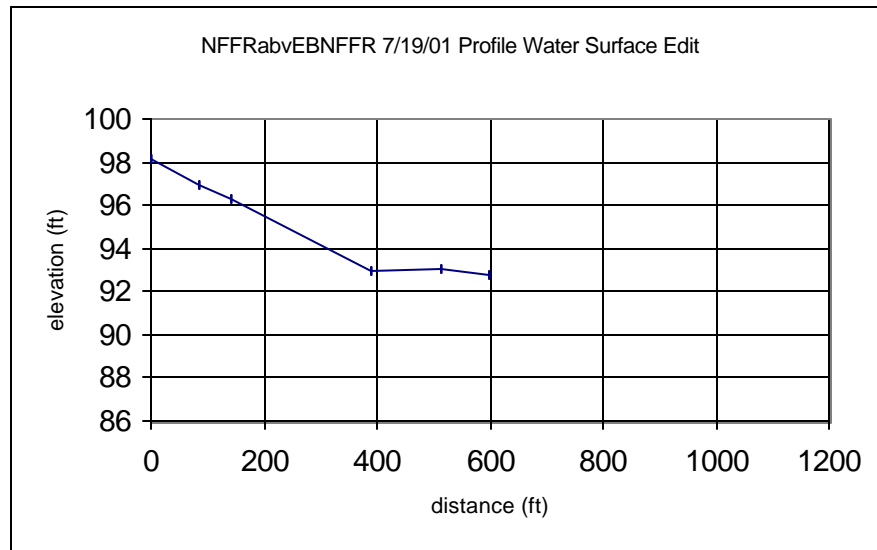

7/17/03

Station (ft)	ELEV	Notes
0	98.26	wel
122	96.64	top
155	96.56	we
210	95.46	tp
370	92.22	top
610	92	wel

slope = 1.03%

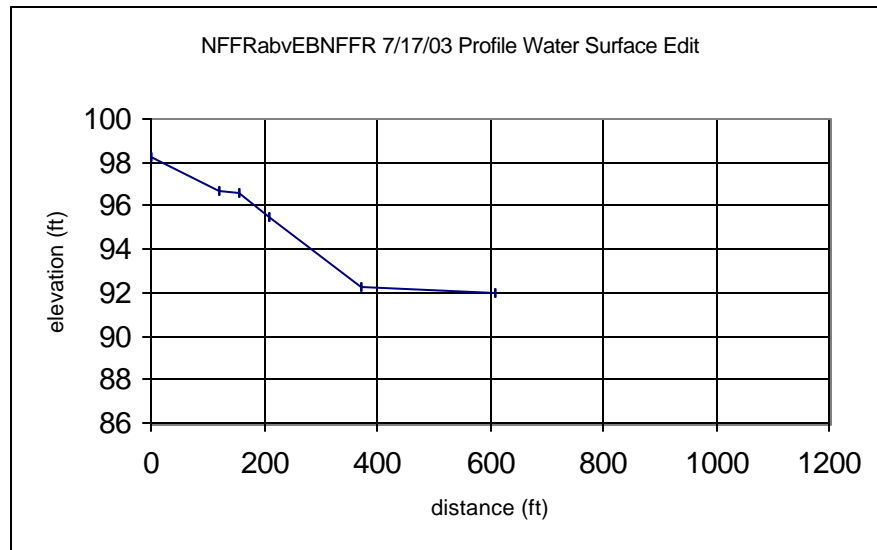


- TOPipe=Top of pipe/bench mark
- LEW=Left edge of water
- REW=Right edge of water
- MPD=Maximum pool depth
- TBM=Temporary bench mark
- PCT=Pool tail crest
- TP=Turning point
- TOPool=Top of pool
- S-MAX=Max. depth sediment lens
- LB=Left bank

LastChance Cr blw Murdock Crossing Longitudinal Profile with Max Pool Depth Edits

8/3/99	Water Surface Elevation	Max Pool Depth Elev
0	88.22	
9	88.14	
42	88.14	
147	87.49	
1066	87.39	
1093	86.8	
1171	86.67	
1256	85.94	
1365	85.9	
1458	85.82	
1547	84.87	
1749	84.9	
1942	84.84	
15		86.1
226		84.7
1147		84.96
1396		83.24
1687		82.69


slope = 0.17%

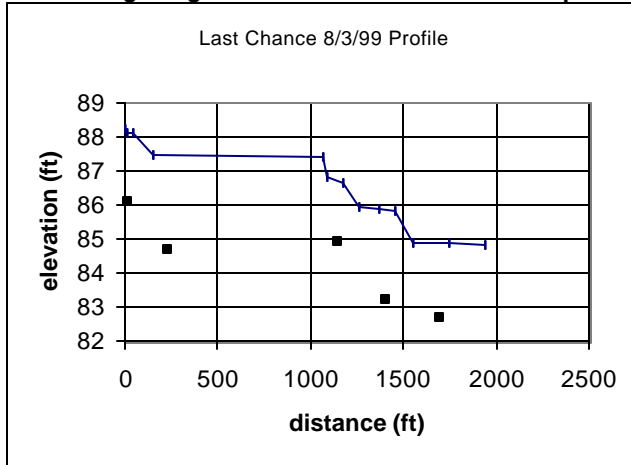

7/24/01

0	88	
8	87.99	
42	87.94	
80	87.24	
456	87.21	
1028	87.12	
1064	86.56	
1148	86.55	
1216	85.7	
1429	85.55	
1435	85.45	
1493	85.34	
1508	84.74	
1671	84.73	
1739	84.74	
1970	84.72	
17		86.08
205		84.65
1102		84.88
1440		83.71
1532		82.88
1795		82.36


slope = 0.17%

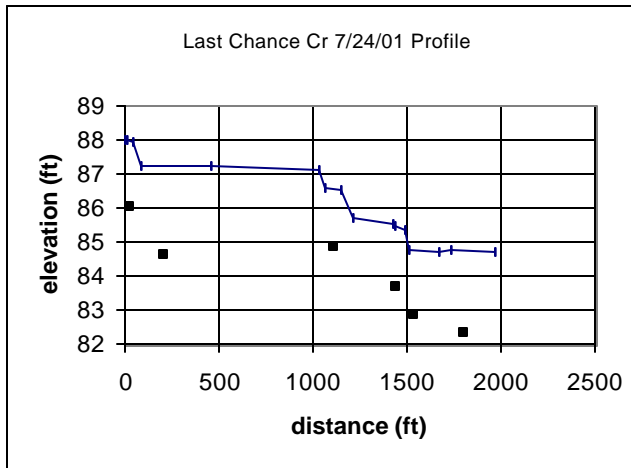

9/12/03

0	88.06	
70	87.32	
1001	87.36	
1086	86.77	
1179	86.71	
1198	86.51	
1224	86.27	
1241	86.02	
1434	85.91	
1448	85.56	
1502	85.56	
1520	85.08	
1906	85.15	
10		86.15
212		84.62
1127		84.93
1204		85.6
1383		83.93
1454		83.52
1599		82.6

slope = 0.15%

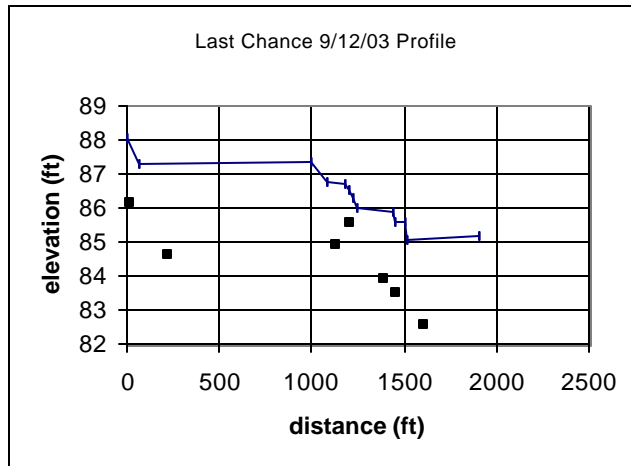


top line is water surface
bottom squares are max pool depths

Red Clover Cr Below Chase Bridge Longitudinal Profile, Water Surface and Max Pool Depth Edits


8/2/01 Station	Water Surface Elevation	Max Pool Depth Elev
0	89.97	
121	90.03	
183	89.93	
372	89.91	
1005	89.87	
1440	88.83	
1840	87.2	
2089	87.13	
15		87.04
335		86.34
2041		85.74

slope = 0.14%

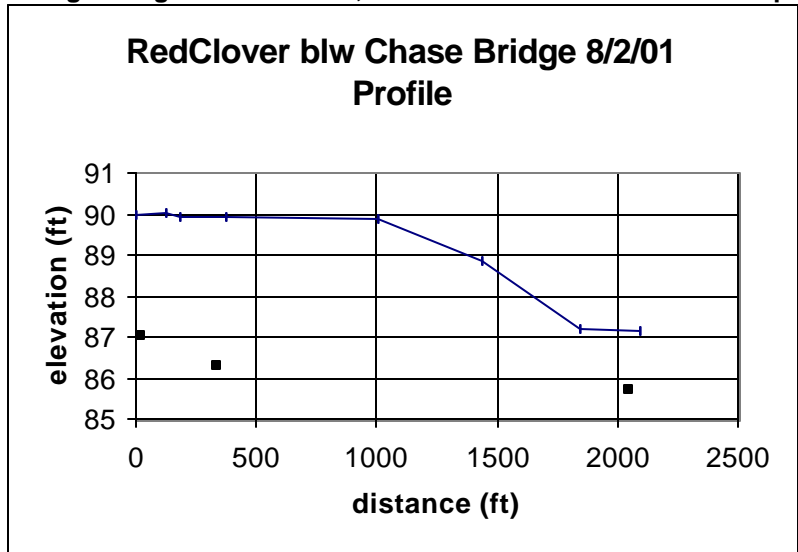

8/5/03 Station	Water Surface Elevation	Max Pool Depth Elev
0	90.34	
189	90.25	
208	90.15	
770	90.06	
1129	90.04	
1516	89.02	
1683	87.99	
1768	87.97	
1869	87.37	
2137	87.34	
2256	86.25	
33		86.99
348		86.29
1714		86.98
2079		85.88

slope = 0.18%

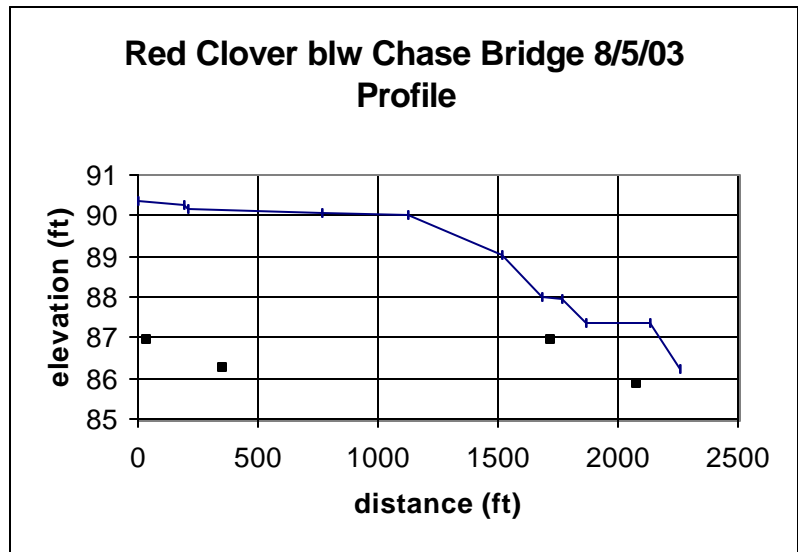


top line is water surface
bottom squares are max pool depths

Red Clover Cr abv Indian Cr Profile, Water Surface with Max Pool Depths Edits

Station	Water Surface Elevation	Max Pool Depth Elev
7/20/99	slope = 6.4%	

Station	Water Surface Elevation	Max Pool Depth Elev
6/20/01		
12	89.24	
59	89	
173	82.08	
195	81.71	
246	79.66	
435	70.98	
483	70.77	
725	59.07	
776	58.72	
801	58.16	
1004	45.46	
1188	38.86	
1220	37.57	
1331	28.01	
1436	27.79	
1526	19.48	
14		84.78
177		77.81
444		53.67
755		56.56
1198		35.07 top line is water surface
1345		23.48 bottom squares are max pool depths

slope = 4.6%

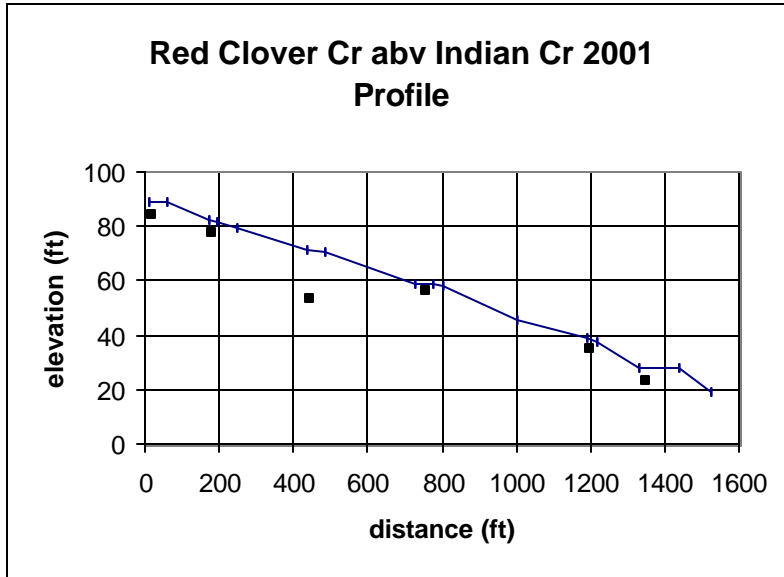


Possible string matching error in 1999 survey. No survey in 2003.
 1999 slope calculated by dividing the 1999 elevational difference by the length in 2003.

Indian above Flournoy Br Longitudinal Profile, Water Surface with Max Pool Depth Edits


8/24/99 Station	Water Surface Elevation	Max Pool Depth Elev
0	88.58	
263	88.52	
426	88.04	
757	87.88	
923	87.42	
1055	87.16	
1216	86.05	
1318	85.99	
117		83.22
434		83.01
923		84.98
1259		82.47

slope = 0.20%

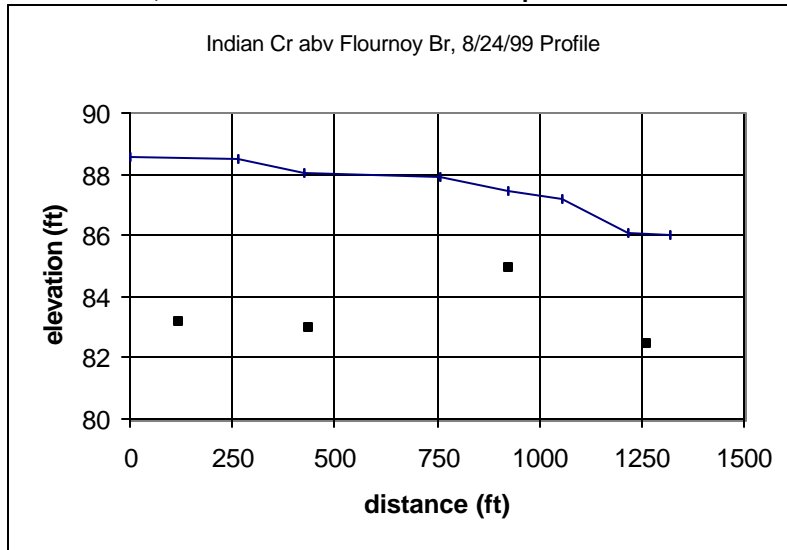


7/2/01 Station	Water Surface Elevation	Max Pool Depth Elev
0	100	
72	100	
155	99.79	
255	99.78	
342	99.46	
701	99.25	
818	98.76	
947	98.62	
1084	97.91	
1201	97.41	
203		97.09
368		93.88
837		96.68
1151		94.3

slope = 0.22%

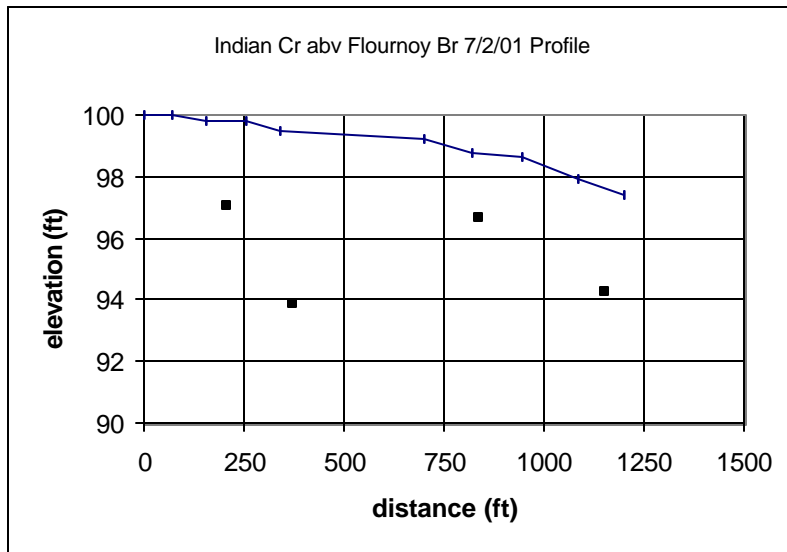

7/9/03 Station	Water Surface Elevation	Max Pool Depth Elev
0	88.54	
70	88.51	
176	88.31	
254	88.12	
290	87.9	
438	87.86	
534	87.85	
660	87.54	
778	87.23	
918	87.05	
1076	86.15	
1169	85.81	
200		85.62
361		82.02
804		84.95
1159		81.92


slope = 0.23%

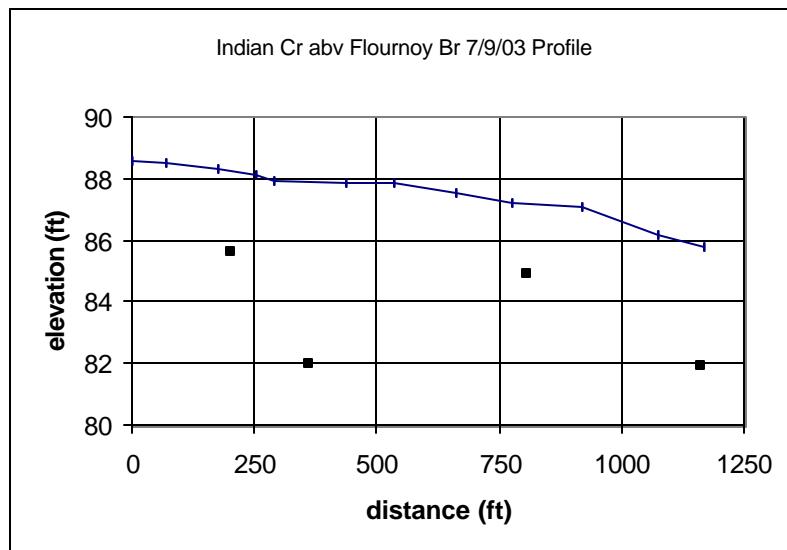

Lights Cr Longitudinal Profile, Water Surface with Max Pool Depth Edits


6/24/99 Station	Water Surface Elevation	Max Pool Depth Elev
0	89.2	
96	88.9	
146	88.74	
202	88.5	
297	88.34	
357	88.19	
811	88	
842	87.95	
904	87.94	
1124	87.55	
1422	87.53	
1656	86.26	
1825	85.61	
110		86.13
242		85.71
451		82.64
876		81.81
1211		81.31

slope = 0.20%

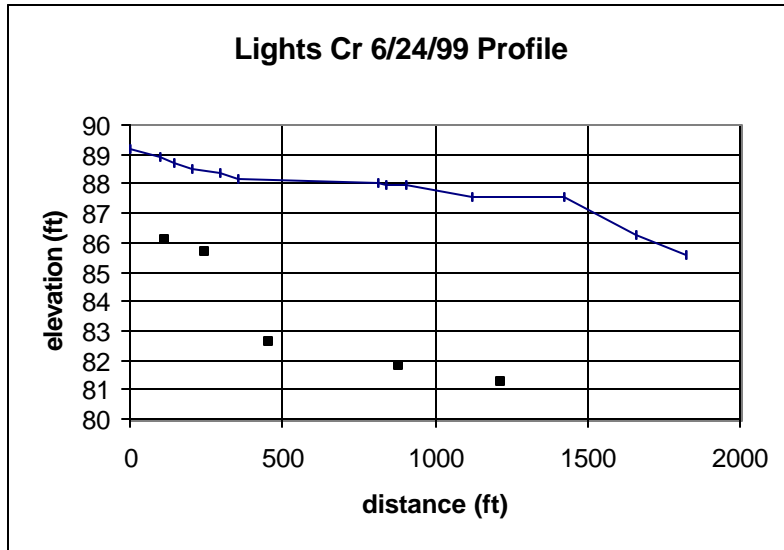


6/14/01 Station	Water Surface Elevation	Max Pool Depth Elev
1547	86.89	
1197	87.04	
1172	87.75	
1107	87.64	
1077	87.97	
864	87.97	
847	88.32	
257	88.3	
155	88.38	
109	89.1	
10	89.11	
0	89.56	
1305		81.89
1117		85.85
944		81.87
466		83.98
209		86.42
69		86.58

slope = 0.17%

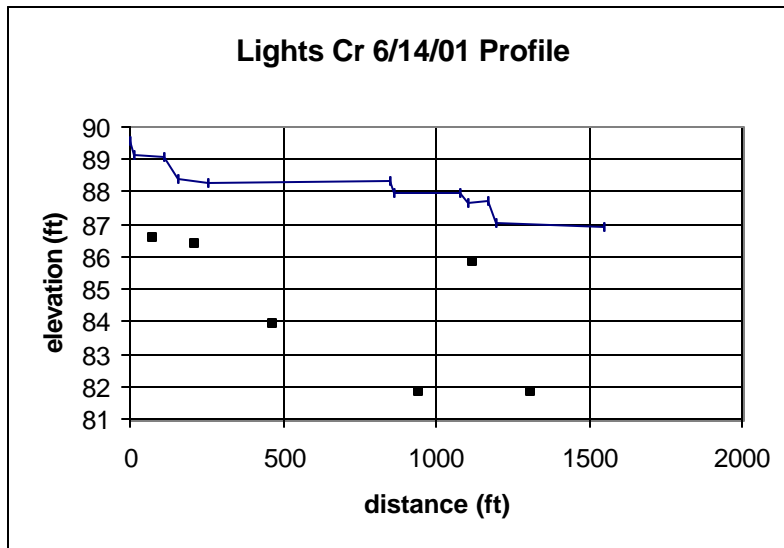

7/10/03 Station	Water Surface Elevation	Max Pool Depth Elev
0	89.41	
9	89.05	
86	89.03	
638	89.01	
673	88.35	
884	88.39	
998	87.81	
1291	87.64	
54		86.65
286		83.84
721		82.15
1100		82.99


slope = 0.14%

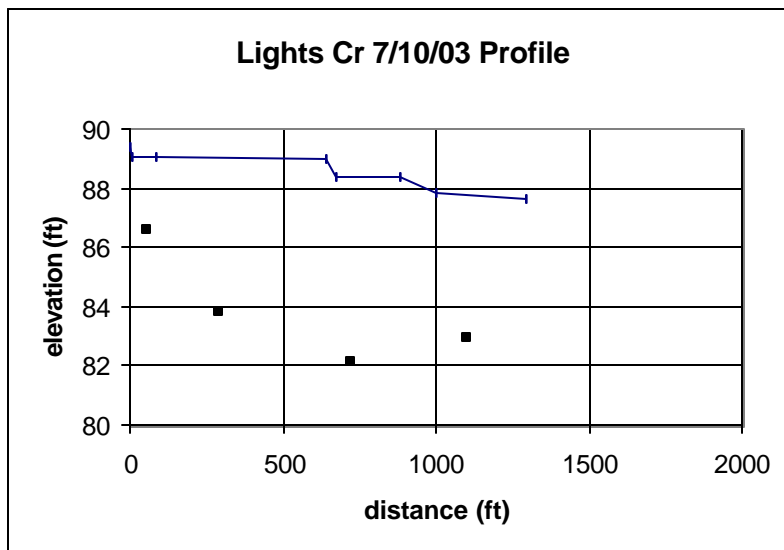

Wolf Cr Longitudinal Profile, Water Surface with Max Pool Depth Edits


6/22/99 Station	Water Surface Elevation	Max Pool Depth Elev
0	77.42	
28	77.2	
79	76.99	
91	76.48	
117	76.41	
150	76.12	
274	76	
360	75.82	
477	74.85	
633	74.59	
720	74.42	
744	74.32	
927	74.14	
1134	73.45	
1272	73.45	
37		73.99
94		73.27
164		73.62
279		72.39
607		71.68
765		70.71
1141		70.46

slope = 0.31%

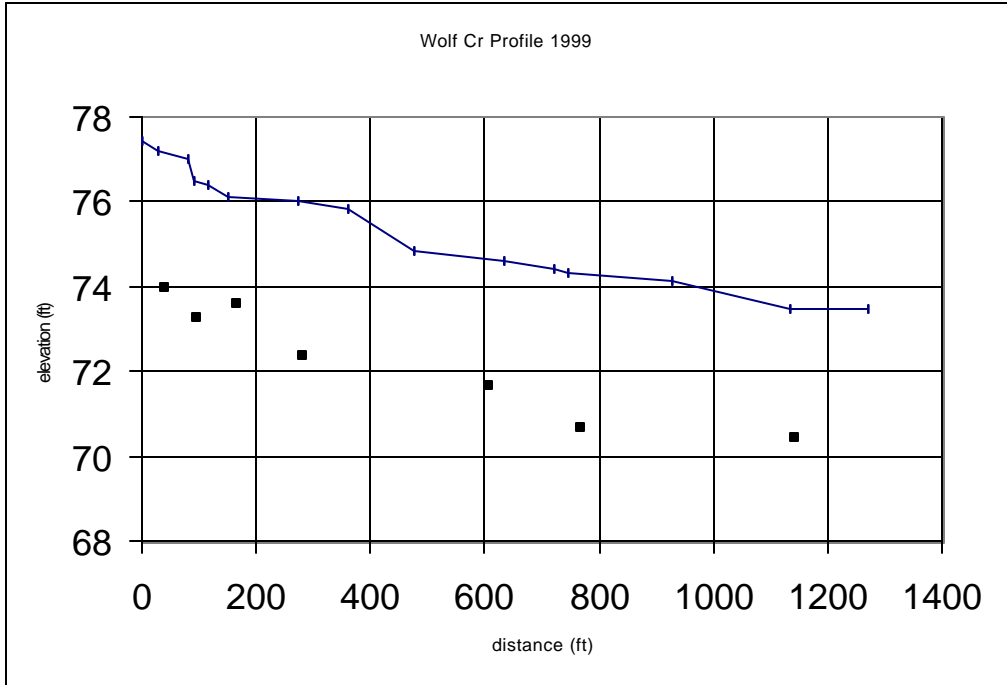

7/4/01 Station	Water Surface Elevation	Max Pool Depth Elev
0	77.18	
14	76.74	
65	76.7	
99	76.23	
124	76.17	
159	75.94	
285	75.88	
297	75.6	
388	75.53	
494	74.7	
559	74.68	
589	74.62	
617	74.63	
644	74.53	
674	74.53	
736	74.3	
765	74.26	
788	74.15	
976	73.88	
1032	73.28	
1161	73.18	
1171	73.18	
1226	73.06	
22		74.57
109		73.81
241		73.66
302		72.71
517		72.43
595		72.01
651		71.91
745		72.55
806		70.71
1024		71.96
1124		70.2
1182		70.54

slope = 0.33%

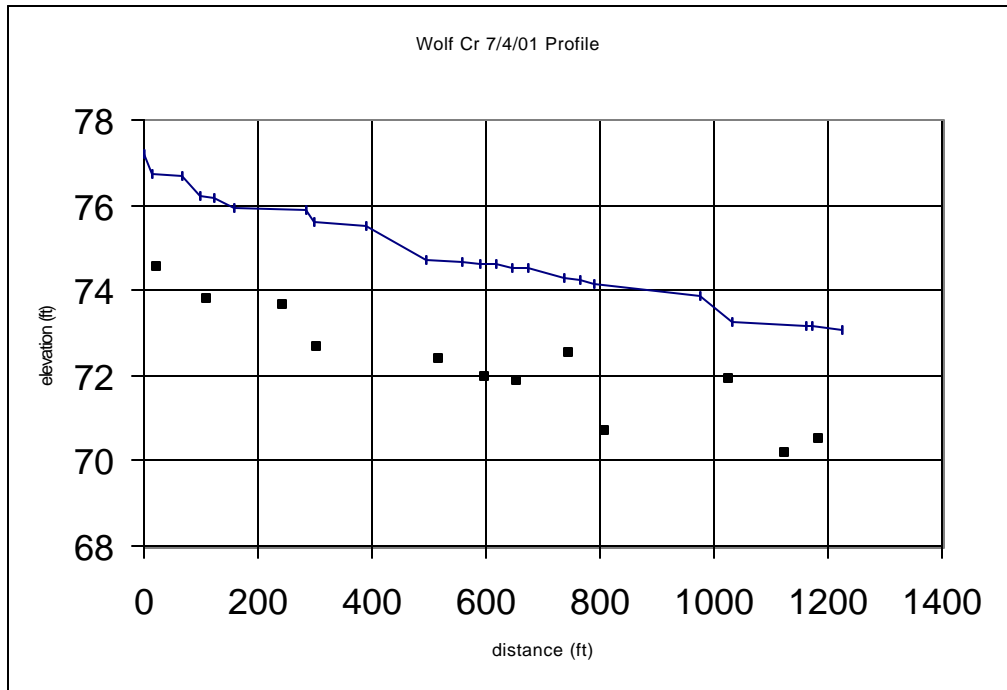


6/26/03 slope = 0.46% no chart- string machine error Slope calculated using '03 elevation difference with an average of profiles lengths.

top line is water surface; bottom squares are max pool depths

Indian above Spanish(Dawn) Longitudinal Profile, Water Surface with Max Pool Depth Edits


7/14/99 Station	Water Surface Elevation	Max Pool Depth Elev
1111	90.81	
981	91.05	
852	92.65	
815	93.16	
794	93.56	
734	98.19	
621	101.06	
191	101.75	
73	102.08	
0	102.59	
1003		82.72
827		88.15
437		95.88

slope = 1.06%

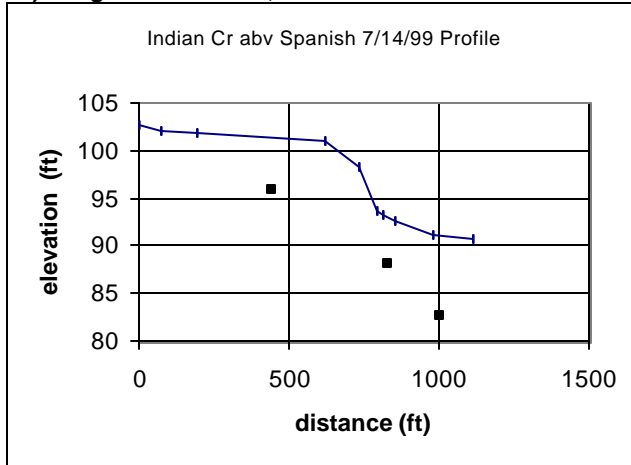


6/20/01 Station	Water Surface Elevation	Max Pool Depth Elev
0	90.52	
72	89.63	
279	89.4	
602	89.18	
843	85.78	
1096	78.81	
1223	78.71	
99		85.23
317		84.12
1113		71.53

slope = 0.96%

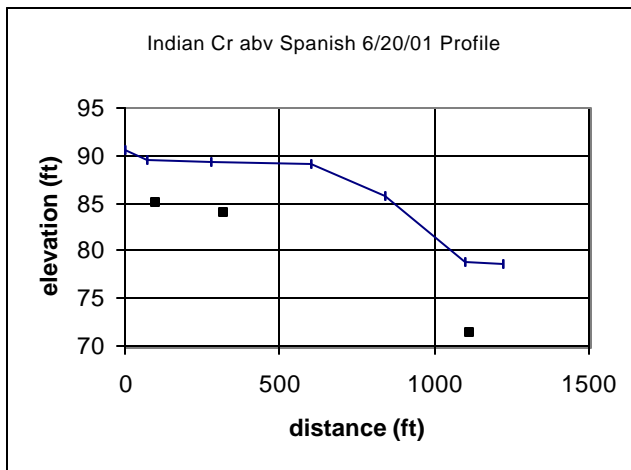

7/2/03 Station	Water Surface Elevation	Max Pool Depth Elev
0	90.86	
38	90.33	
279	89.91	
298	89.91	
661	89.73	
742	87.8	
816	83.51	
855	81.66	
994	79.46	
1071	79.3	
1109	79.16	
98		84.79
578		83.45
1010		71.47

slope = 1.05%

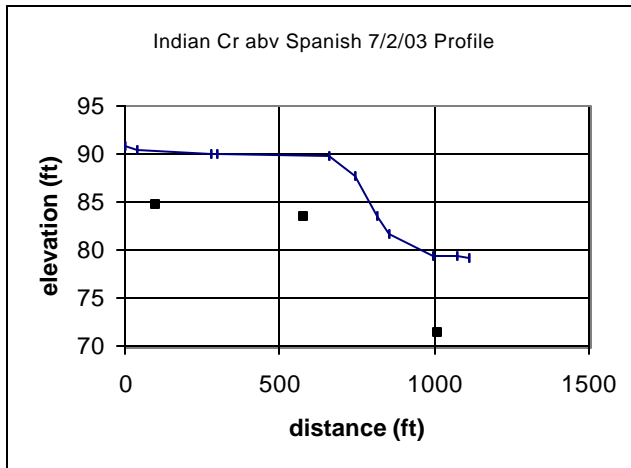


top line is water surface
bottom squares are max pool depths

Rock Creek Longitudinal Profiles, Water Surface Edits & Max Pool Depths


Station	Water Surface Elevation	Max Pool Depth
1585	93.41	
1412	93.85	
1304	94.42	
1227	96.67	
1164	96.75	
1128	98.47	
1006	100.64	
886	100.73	
550	105.18	
357	105.22	
0	108.06	
1399		90.26
1204		93.36
959		96.73
377		102.12

slope = 0.92%

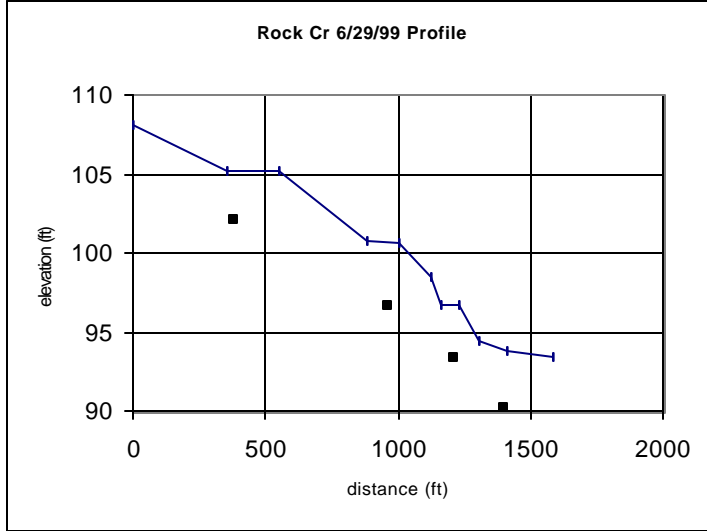


6/13/01		
1842	93.19	
1798	93.29	
1694	93.32	
1659	93.6	
1617	93.85	
1567	93.96	
1529	95.12	
1512	95.55	
1471	96.51	
1391	96.43	
1255	100.84	
1014	100.81	
934	101.65	
820	102.32	
670	105.05	
375	105.17	
292	106.18	
245	107.41	
0	107.99	
1684		90.18
1596		91.62
1516		93.61
1424		93.68
1137		96.64
450		101.75

slope = 0.80%

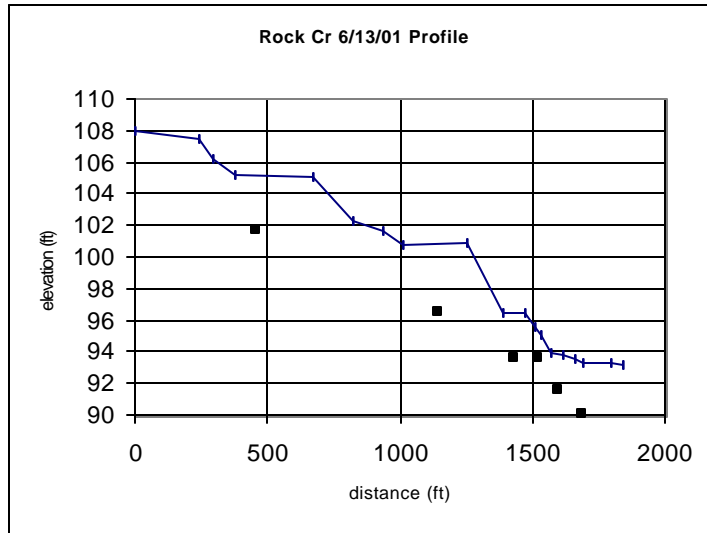

6/25/03		
0	90.74	
62	90.67	
311	88.58	
421	88	
663	87.52	
852	85.21	
1046	83.85	
1216	83.7	
1360	79.51	
1444	79.62	
1526	77.59	
1631	76.86	
1651	76.53	
1657	76.5	
1706	76.47	
1714	76.39	
1771	76.43	
1837	76.22	
460		84.49
1126		79.38
1419		75.98
1575		74.2
1637		73.24
1659		72.92
1717		73.41

slope = 0.79%

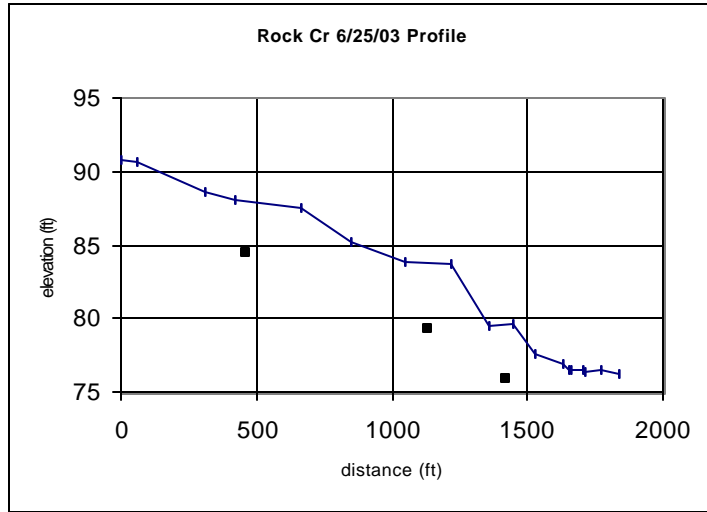


top line is water surface elevations; lower squares are max pool depths

Greenhorn Cr Longitudinal Profiles, Water Surface Edits


Greenhorn 1999		
station for graph		
Station	Elevation	
672	60	97.88
572	160	97.95
503	229	97.98
433	299	98.05
358	374	98.16
290	442	98.47
124	608	98.49
0	732	98.49

slope = 0.09%

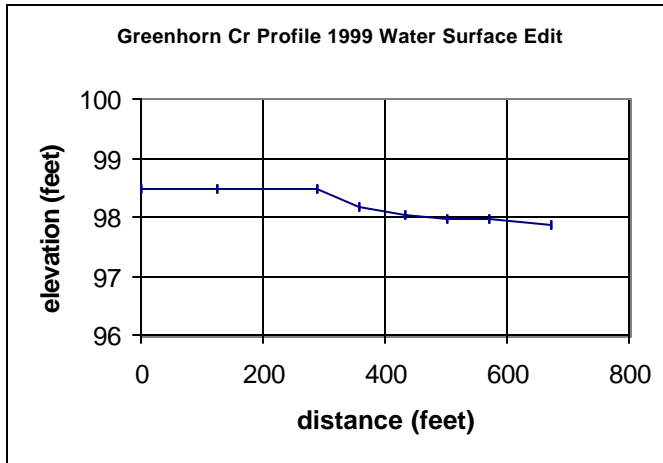

6/12/01		
Station	Elevation	Notes
796	100	TBM X-Sect#1
796	91.87	
717	92.03	
736	91.95	TOPool
692	92.07	TOPool
614	92.3	TOPool
574	92.54	TOPool
535	92.55	TOPool
490	93.03	TOPool
473	93.16	REW
376	93.56	TOPool
294	94.11	PCT
0	94.32	TOPool

slope = 0.31%

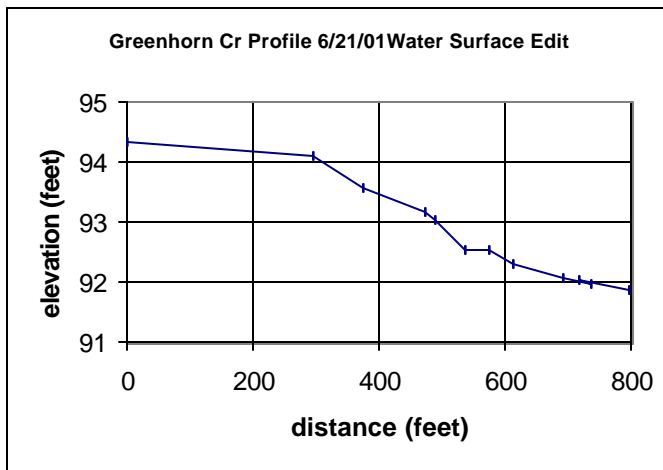


6/17/03		
Station (ft)	ELEV	Notes
0	100	lew
302	99.87	ptc,lew
383	99.01	rwe,top
454	98.82	lew,pct
552	97.92	rew,top
786	97.54	

slope = 0.31%

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank


Note: All elevations are water surface except MPD & PCT

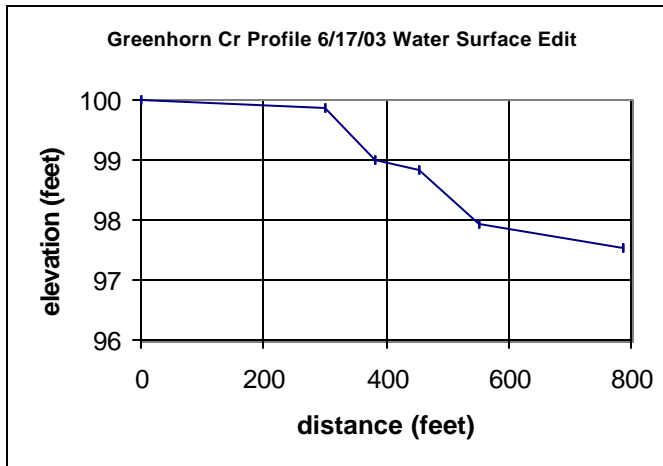

Spanish Cr abv Greenhorn Longitudinal Profile, Water Surface Edits & Max Pool Depths


6/28/99 Station	Water Surface Elevation	Max Pool Depth Elev
1418	92.66	
1142	93.01	
1035	93.09	
666	93.07	
320	93.33	
92	93.31	
62	93.93	
0	94.07	
1211		87.99
950		88.5
183		86.05
22		84.04

slope = 0.10%

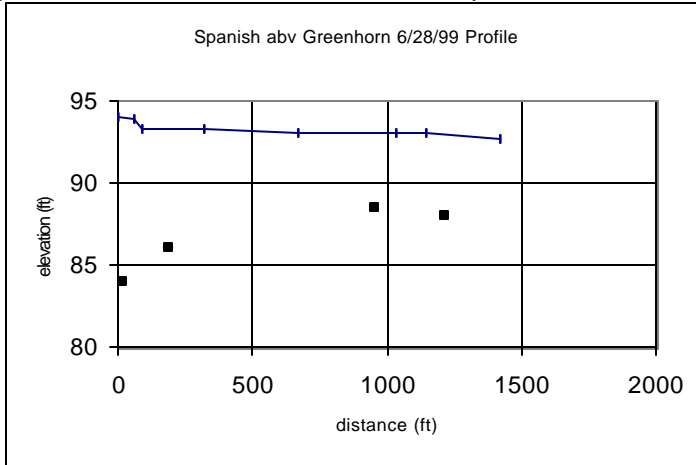


6/28/01 Station	Water Surface Elevation	Max Pool Depth Elev
0	91.63	
64	91.6	
149	91.47	
247	91.44	
266	91.1	
306	91.08	
351	91.06	
523	90.95	
680	90.73	
942	90.71	
1116	90.72	
1133	89.74	
1488	90.49	
1498	90.67	
19		83.2
152		84.72
274		87.4
469		87.94
786		86.24
1245		85.21

slope = 0.06%

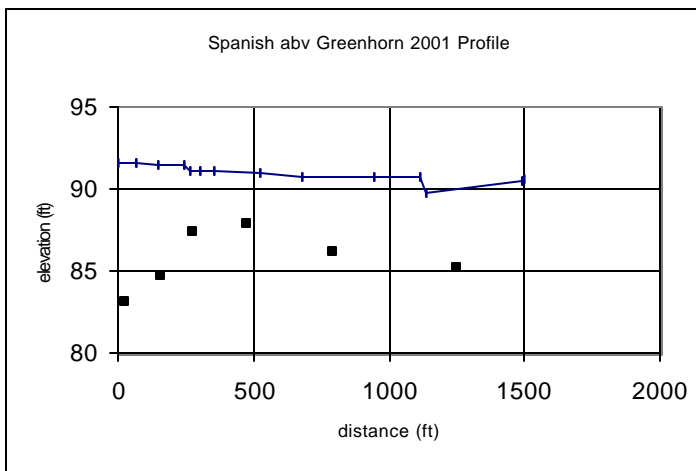

6/19/03 Station	Water Surface Elevation	Max Pool Depth Elev
5	92.51	
102	92.37	
150	92.23	
241	92.2	
355	91.62	
651	91.63	
748	91.4	
1103	91.26	
1162	91.19	
1470	90.94	
31		80.98
160		86.01
417		87.49
774		82.61
1222		84.82

slope = 0.11%

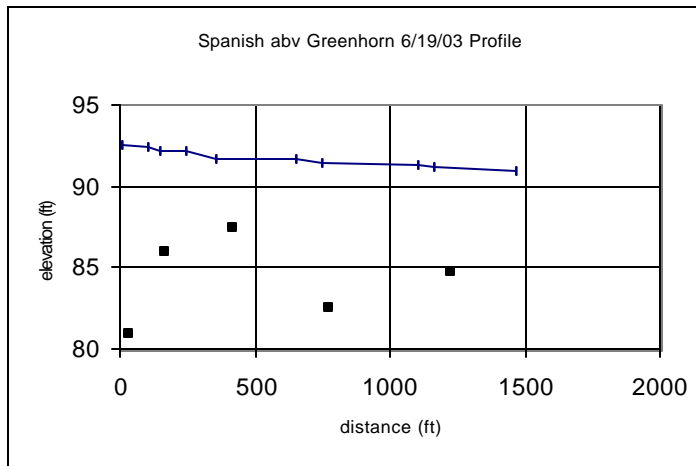


TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lens
 LB=Left bank
 RB=Right bank
 Note: All elevations are water surface except MPD & PCT
 Top line on each graph is water surface elevation
 Bottom square symbols are maximum pool depths

Spanish Cr. abv Indian Cr Longitudinal Profile, Water Surface Edits & Max Pool depths


7/19/99 Station	Water Surface Elevation	Max Pool Depth Elev
1550	97.6	
1327	97.62	
1285	97.79	
1215	97.91	
1102	101.78	
747	101.9	
567	104.93	
466	105.09	
452	105.1	
403	105.08	
39	105.34	
0	105.46	
1377		86.61
1245		90.38
958		95.75
536		101.41
100		100.49

slope = 0.51%

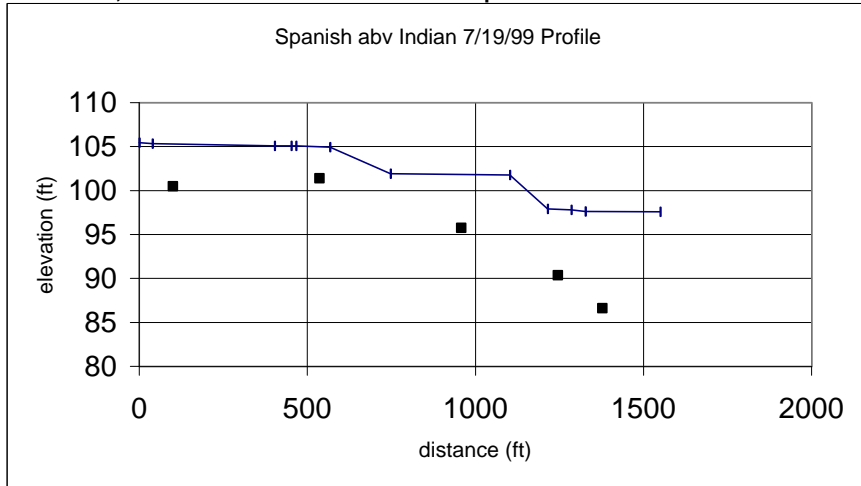


1680	95.66	
1500	97.26	
1191	101.03	
906	101.26	
808	101.25	
625	103.39	
419	103.68	
66	104.99	
53	104.97	
0	105.02	
1500		87.06
1001		95.62
611		101.9
144		99.64

slope = 0.56%

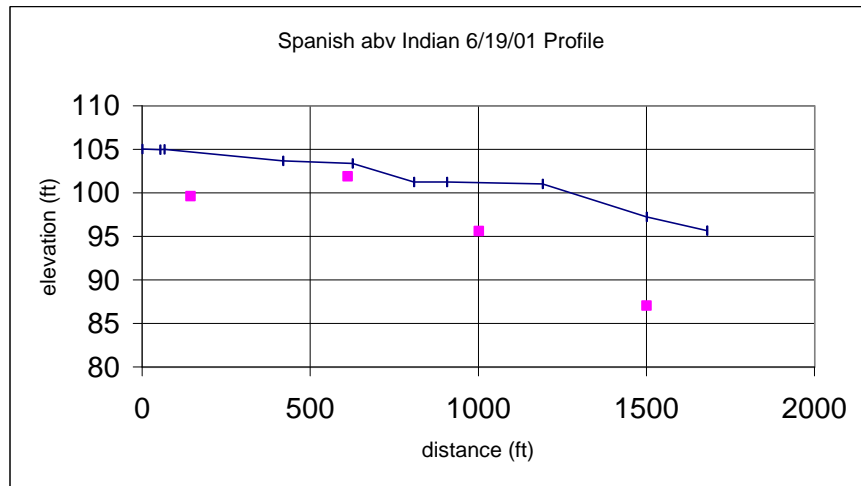

0	90.18	
432	90.01	
478	89.82	
535	89.57	
713	86.15	
974	86.14	
1143	82.22	
1416	81.93	
85		84.12
508		83.88
809		79.6
1308		69.33

slope = 0.58%

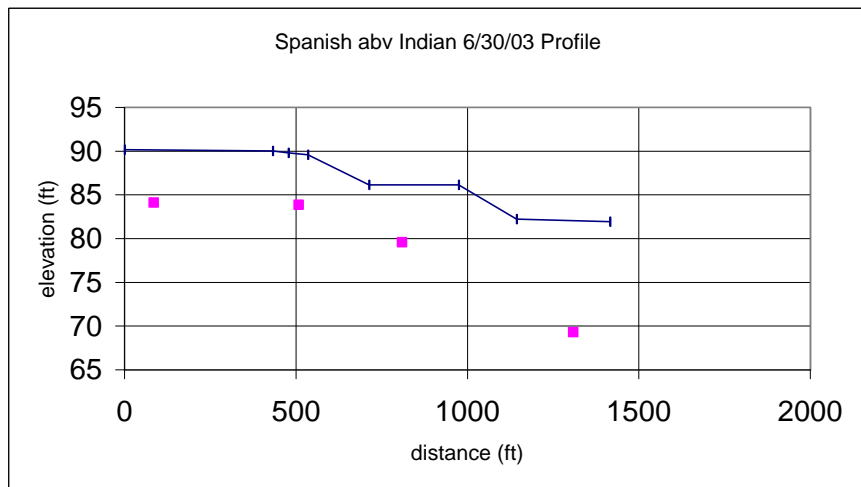


TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lens
 LB=Left bank
 RB=Right bank
 Top line on each graph is water surface elevation
 Bottom square symbols are maximum pool depths

East Branch North Fork Feather River Longitudinal Profiles, Water Surface Edits

8/4/99

Station	Elevation	Notes
2529	89.04	LEW
2429	89.93	
2379	89.99	
2310	90.26	TOPool
2156	90.8	
2069	91.3	
1733	91.23	TOPool
1557	96.81	
1446	97.06	
1344	103.21	
1220	103.21	
851	103.2	
669	103.25	
439	103.25	
282	103.27	TOPool
143	103.84	
0	109.13	End

slope = 0.79%

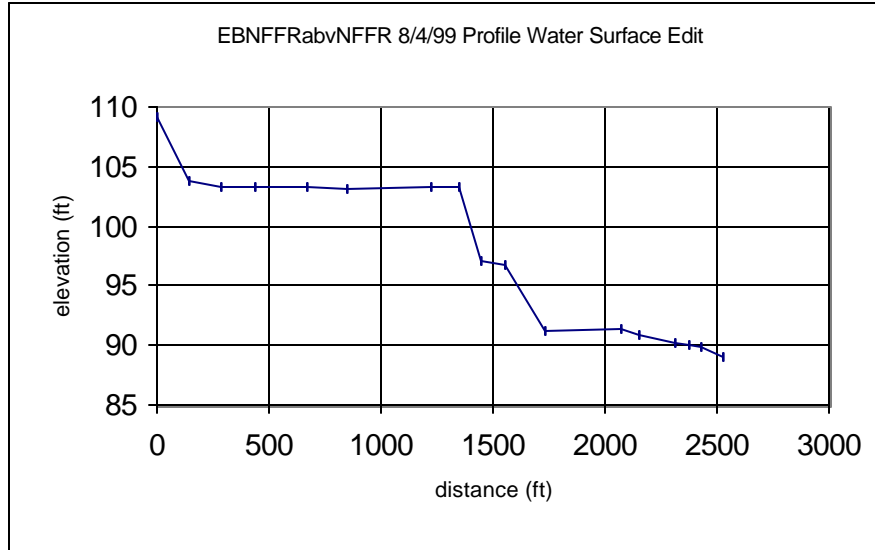

7/16/01


slope = 0.78%

string machine error- no chart. Slope calculated using avg of profile length for '99 and '03.

7/15/03

Station (ft)	ELEV	Notes
0	88.26	wer
195	82.87	wer
332	82.2	wer/top
670	82.16	wer/tp
1447	82.2	wer
1553	77.72	wer/top
1655	76.25	wer
1762	71.95	wer
1860	70.55	wer/top
2247	70.31	wer
2416	69.32	wer/top
2577	68.58	wel
2588	68.63	tp/wel

slope = 0.76%

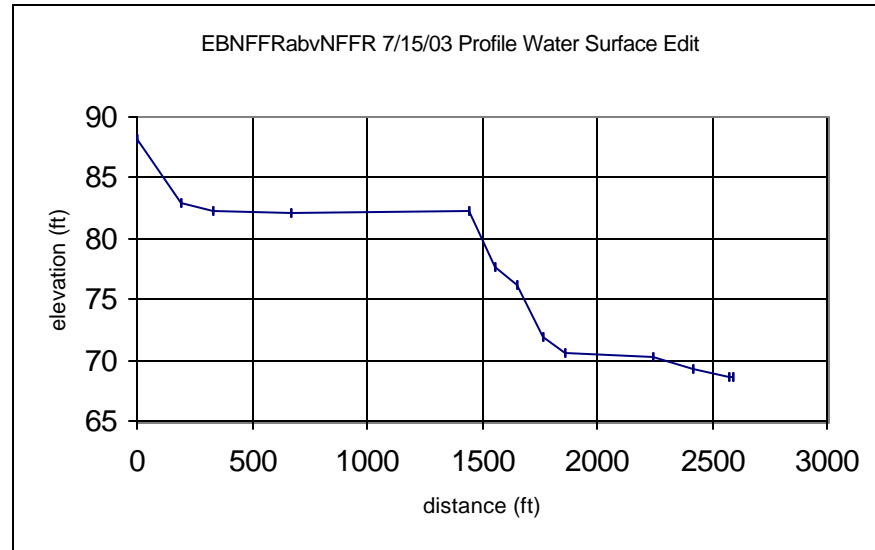


TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 Note: All elevations are water surface except MPD & PCT

Middle Fork Feather River at Beckwourth Longitudinal Profiles, Water Surface Edits

8/19/99

Station	Elevation	Notes
0	100	TBM_TOPipe
0	95.13	LEW
31	95.1	TOPool
291	95.03	
476	95.01	
617	94.98	TOPool
1210	94.9	
1554	94.85	
1641	94.53	REW End

slope = 0.04%

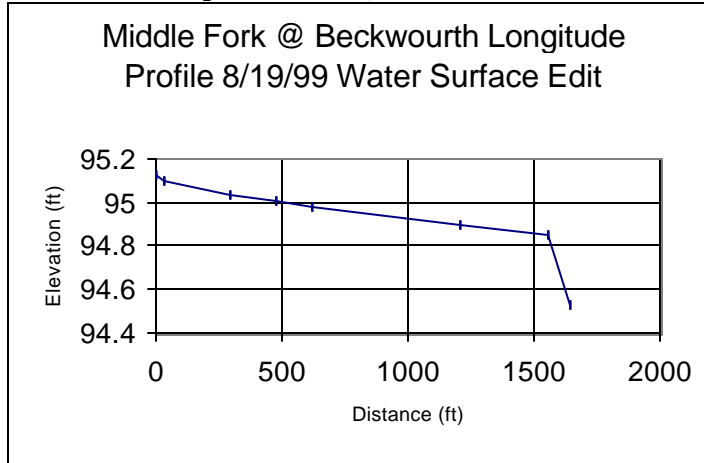

2001 & 2003 Water Surface Profiles are invalid due to lack of continuous flow in the channel.

TOPipe=Top of pipe/bench mark

LEW=Left edge of water

REW=Right edge of water

MPD=Maximum pool depth

TBM=Temporary bench mark

PCT=Pool tail crest

TP=Turning point

TOPool=Top of pool

S-MAX=Max. depth sediment lense

LB=Left bank

RB=Right bank


Note: All elevations are water surface except MPD & PCT

Sulphur Cr Longitudinal Profile, Water Surface Edits

8/17/99

Station	Elevation	Notes
0	100	TBM Top
0	88.43	LEW
84	87.88	TOPool
164	87.72	
450	86.08	TOPool
644	85.95	
670	85.47	TOPool
785	85.28	
1057	83.03	TOPool
1313	82.74	
1336	82.31	TOPool
1415	82.14	
1476	81.42	LEW
1476	87.91	TBM


slope = 0.47%

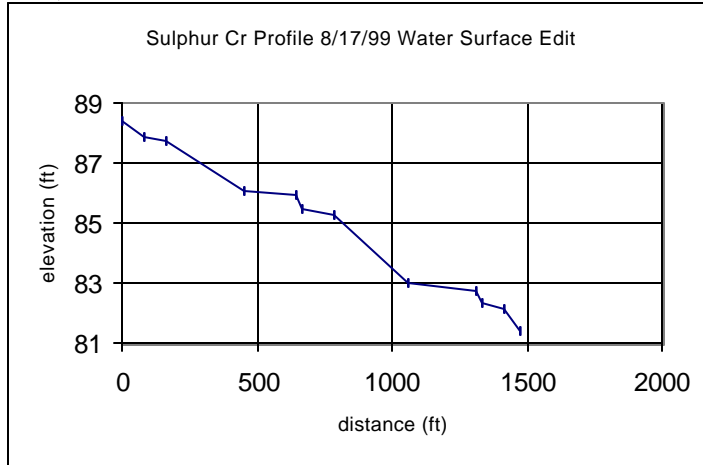

7/9/01

Station	Elevation	Notes
67	99.43	TOPool
142	99.48	REW
219	98.19	TOPool
246	98.13	REW
303	97.76	TOPool
334	97.7	REW
407	97.48	TOPool
583	97.31	REW
662	96.65	TOPool
762	96.57	REW
1031	94.52	TOPool
1228	94.14	REW
1310	93.58	TOPool
1365	93.04	REW
1397	93.11	REW
1468	92.87	REW


slope = 0.47%

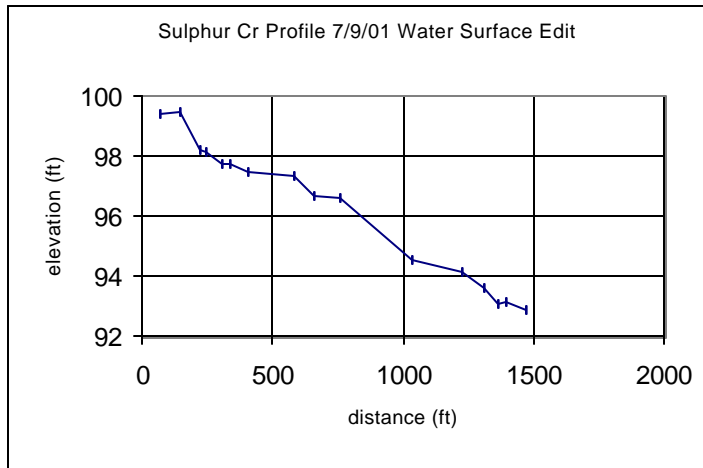

9/3/03

Station	Elevation	Notes
0	110.45	REW
55	109.92	REW
164	109.86	REW
245	108.67	TOPool WE
283	108.55	LEW
335	108.18	TOPool WE
377	108.16	LEW
424	107.73	TOPool WE
650	107.81	LEW
693	107.2	TOPool LEW
811	107	LEW
1072	104.88	TP & TOPool
1275	104.62	REW
1368	104.08	TP & TOPool
1434	103.89	LEW
1507	103.06	LEW end reach

slope = 0.49%

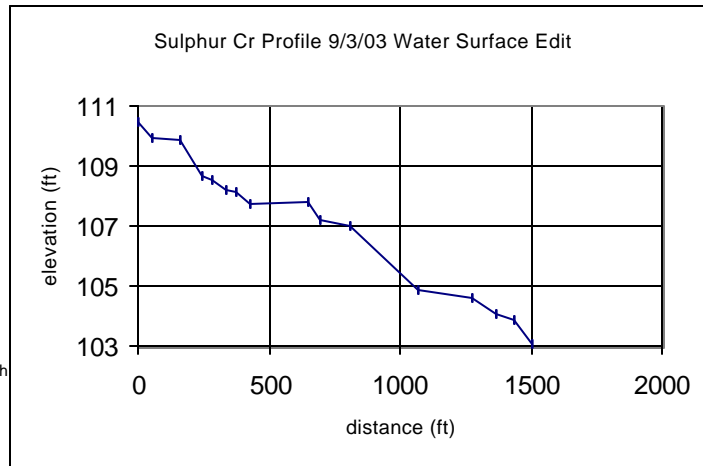


TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank

Jamison Creek Longitudinal Profile, Water Surface Edits

7/8/99

Station	Elevation	Notes
0	100	TBM
0	93.21	WER
160	87.91	
293	84.65	
343	83.1	
543	78.1	X-Sect-3
598	77.45	
697	76.13	TOPool
729	75.41	
752	75.04	TOPool
765	74.52	
784	74.35	X-Sect-2
844	72.22	
885	71.58	TOPool
921	71.21	
960	70.85	TOPool
977	69.32	X-Sect-1
1030	69.02	
1056	67.85	
1070	67.07	TOPool
1109	66.42	


slope = 2.4%

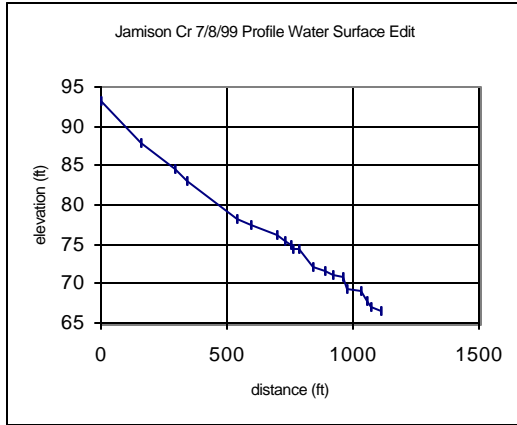

7/8/01

Station	Elevation	Notes
0	92.77	WER
262	84.15	WER
423	79.22	TOPool
465	78.88	WER
469	78.73	TOPool
513	77.81	WER
685	75.06	TOPool
714	74.91	WER
732	74.31	TOPool
758	73.95	WER
832	71.57	TOPool
868	70.99	WER
878	70.76	TOPool
923	70.61	WER
951	69.73	TOPool
978	68.4	WER
1101	65.85	WER


slope = 2.4%

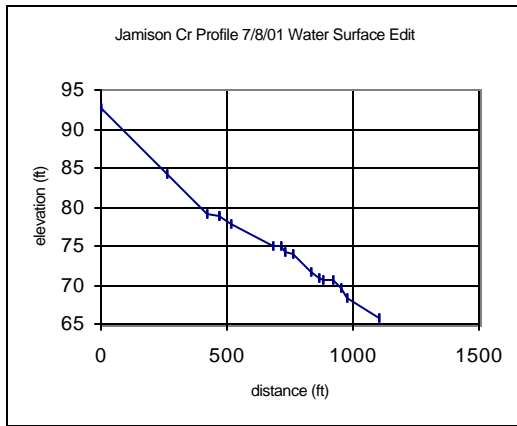

7/28/03

Station (ft)	ELEV	Notes
0	92.16	wel/tp
51	88.56	wel/top
107	88.32	wel
274	83.59	wel/tp
411	80.08	wel
417	79.27	wel
507	78.36	wel
633	76.94	wel
684	75.54	wel/top
713	75.48	wel
719	75.2	wel/tp
731	74.71	wel/top
749	74.33	wel
867	71.01	wel
915	70.72	wel
939	69.29	wel/top
960	69.08	wel
1044	66.55	wel/top
1095	66.24	

slope = 2.4%

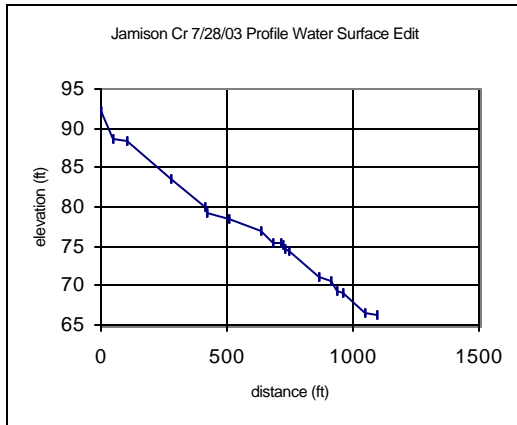


TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 REW=Right edge of water
 MPD=Maximum pool depth
 TBM=Temporary bench mark
 PCT=Pool tail crest
 TP=Turning point
 TOPool=Top of pool
 S-MAX=Max. depth sediment lense
 LB=Left bank
 RB=Right bank
 Note: All elevations are water surface except MPD & PCT

Middle Fork Feather River at Nelson Pt. Longitudinal Profile, Water Surface Edits

Clifton et al All units in Ft.
7/26/99

Station	Elevation	Notes
1806	98.18	LEW
1663	98.42	TOPool
1574	101.13	REW
1347	101.23	TOPool
1162	103.39	REW
974	103.39	TOPool
867	104.06	REW
680	104.27	REW
608	104.29	TOPool
562	106.89	REW
396	107.3	TOPool
297	110.33	LEW
109	111.6	LEW
0	113.43	Top of reach


slope = 0.84%

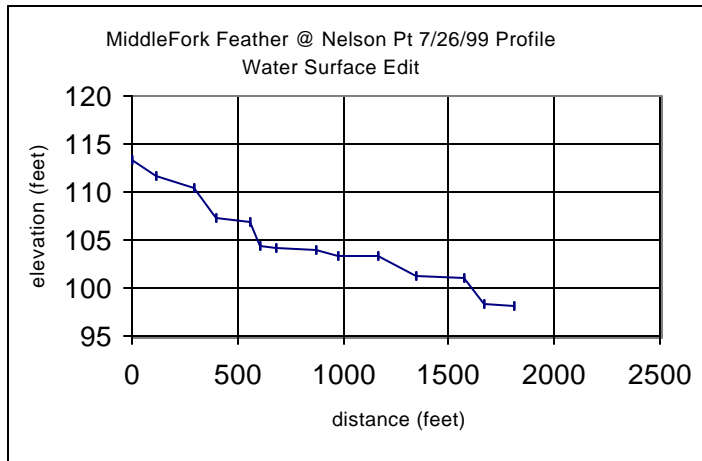

7/15/01

Station	Elevation	Notes
0	100	TBM X-Sect#3
0	91.19	LEW
196	88.5	TOPool
317	88.45	LEW
557	84.8	TOPool
686	84.78	LEW
776	81.83	TOPool
1117	81.74	LEW
1133	80.87	LEW
1187	80.86	TOPool
1404	80.99	LEW
1429	80.67	LEW
1551	78.81	TOPool
1644	78.73	LEW
1788	75.68	TOPool
1875	75.75	LEW


slope = 0.84%

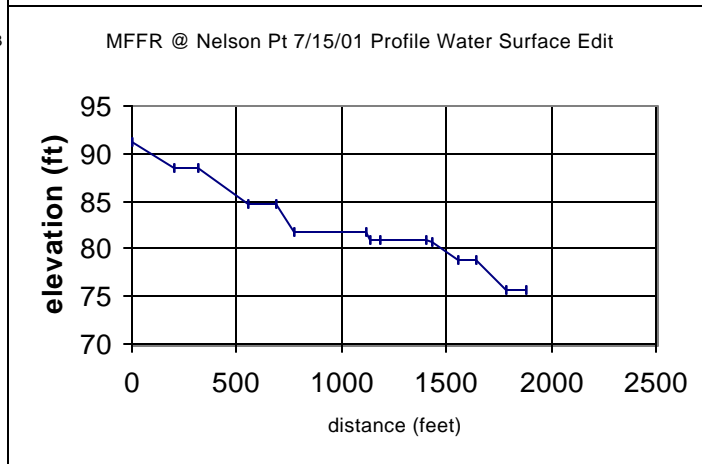

7/24/03

Station (ft)	ELEV	Notes
0	91.38	wel
186	88.7	wel/top
316	88.71	wel
569	82.72	wel/top
704	82.52	wel
800	80.28	wel/tp
838	79.8	wel/top
1167	79.49	wel
1219	78.92	wel/top
1478	78.93	wel/tp
1633	76.76	wel/top
1795	76.46	wel/tp
1939	74.19	wel/top
2089	73.53	wel
2130	73.43	wel

slope = 0.84%

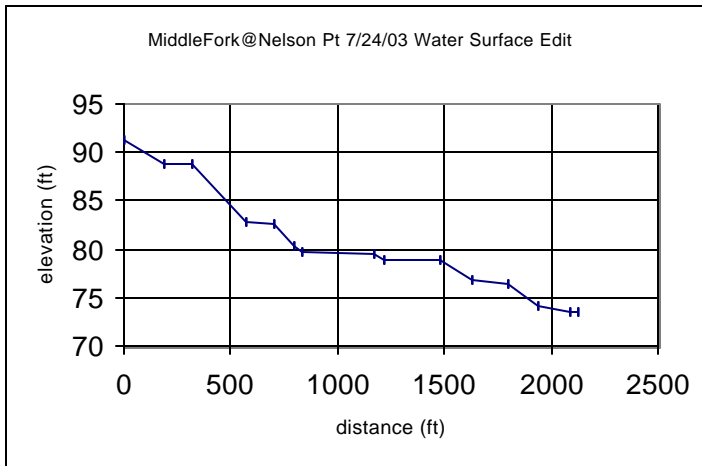

TOPipe=Top of pipe/bench mark
 LEW=Left edge of water
 MPD=Maximum pool depth
 PCT=Pool tail crest
 TP=Turning point
 LB=Left bank
 RB=Right bank

RB=Right bank

Note: All elevations are water surface except MPD & PCT

Profile shortened in '01 and '03 for safety

APPENDIX F


DISCHARGE

AND


PRECIPITATION

GRAPHS


Indian Cr @ Genesee; Monthly Precipitation Totals (Wilcox data)

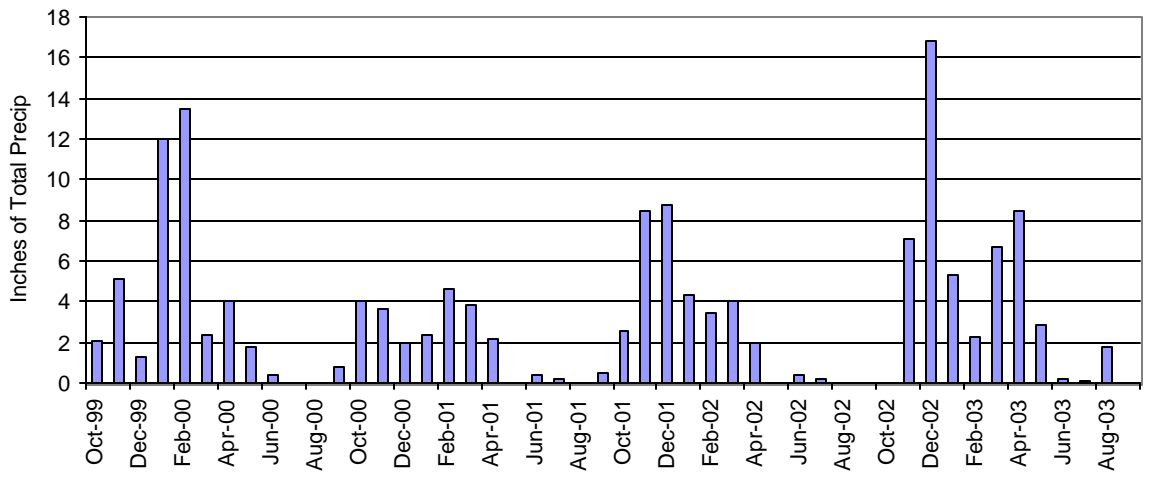


Last Chance Cr@Doyle x-ing; Monthly Summaries of Avg Daily Flow

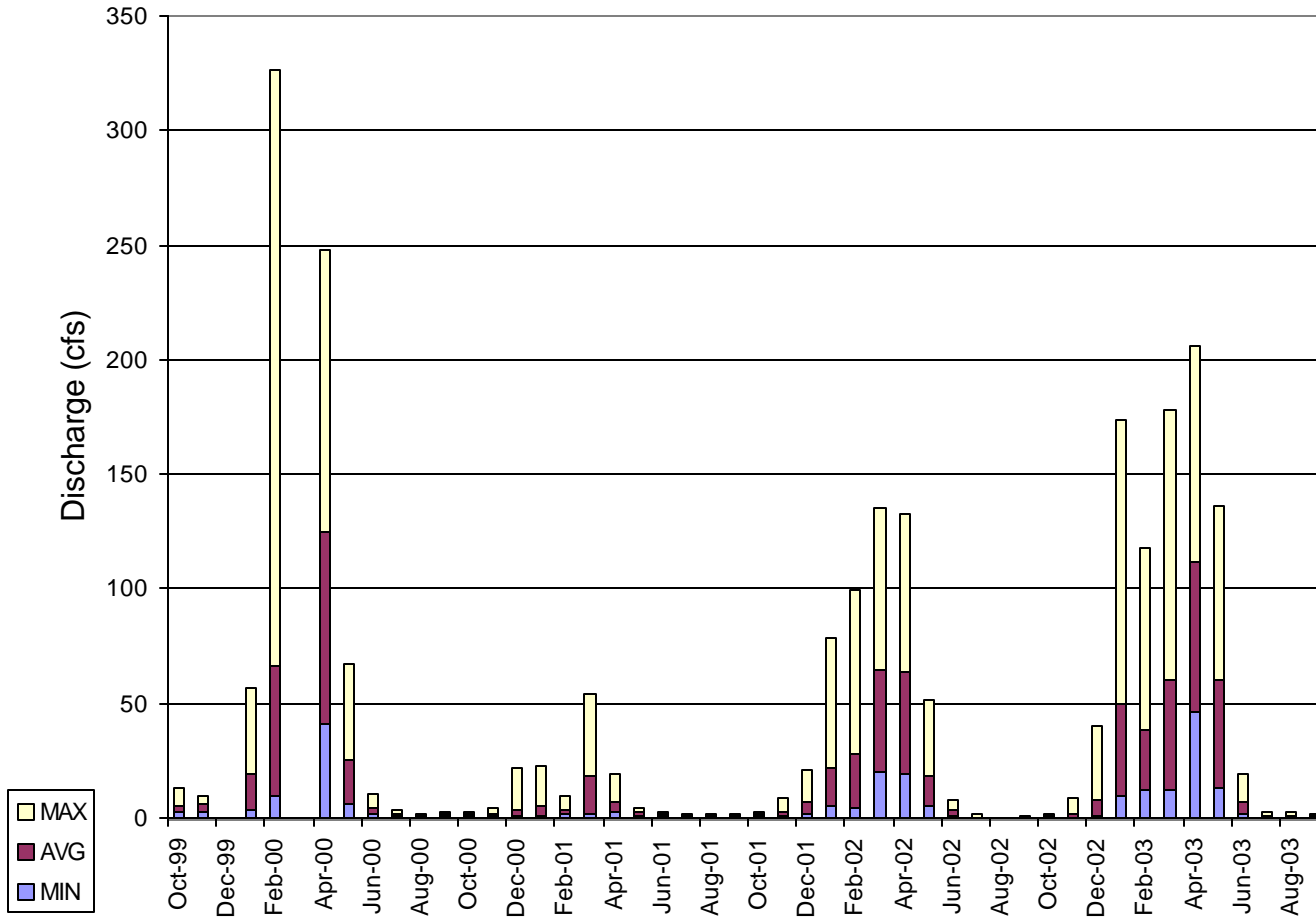


Last Chance Creek Daily Average Flow and Precipitation at Genesee - Water Year 2001

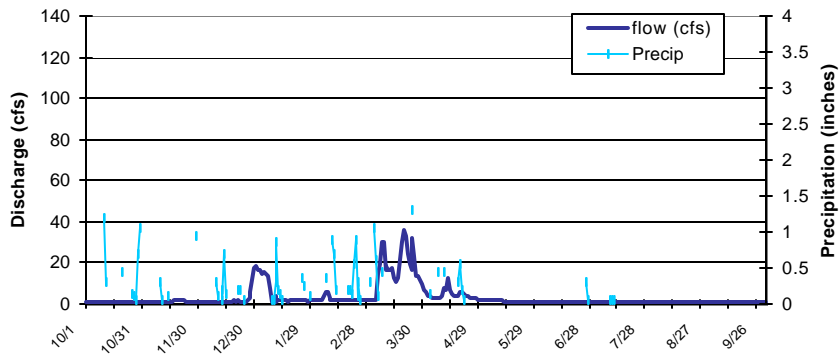


Last Chance Creek at Doyle Crossing Daily Average Flow and Precipitation at Genesee - Water Year 2002

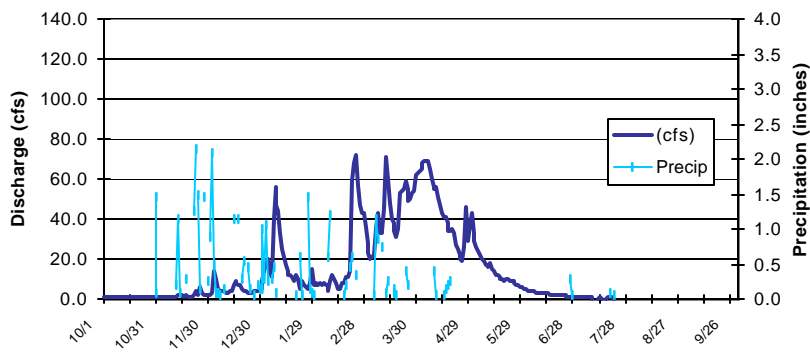


Last Chance Creek at Doyle Crossing Daily Average Flow and Precipitation at Genesee - Water Year 2003

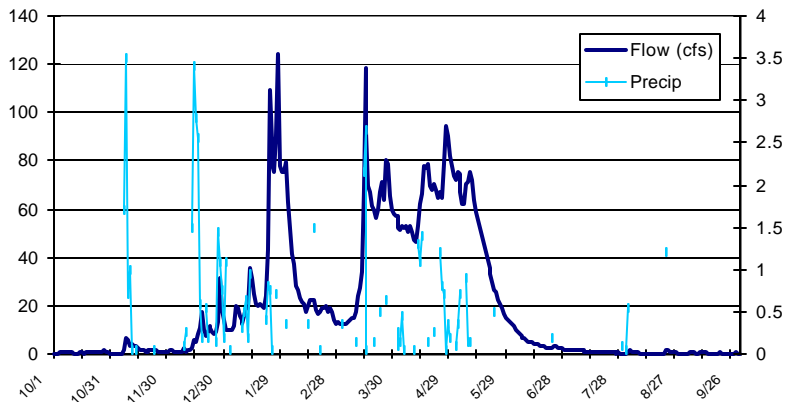


Red Clover Cr@Notson Br; Monthly Summaries of Avg Daily Flow

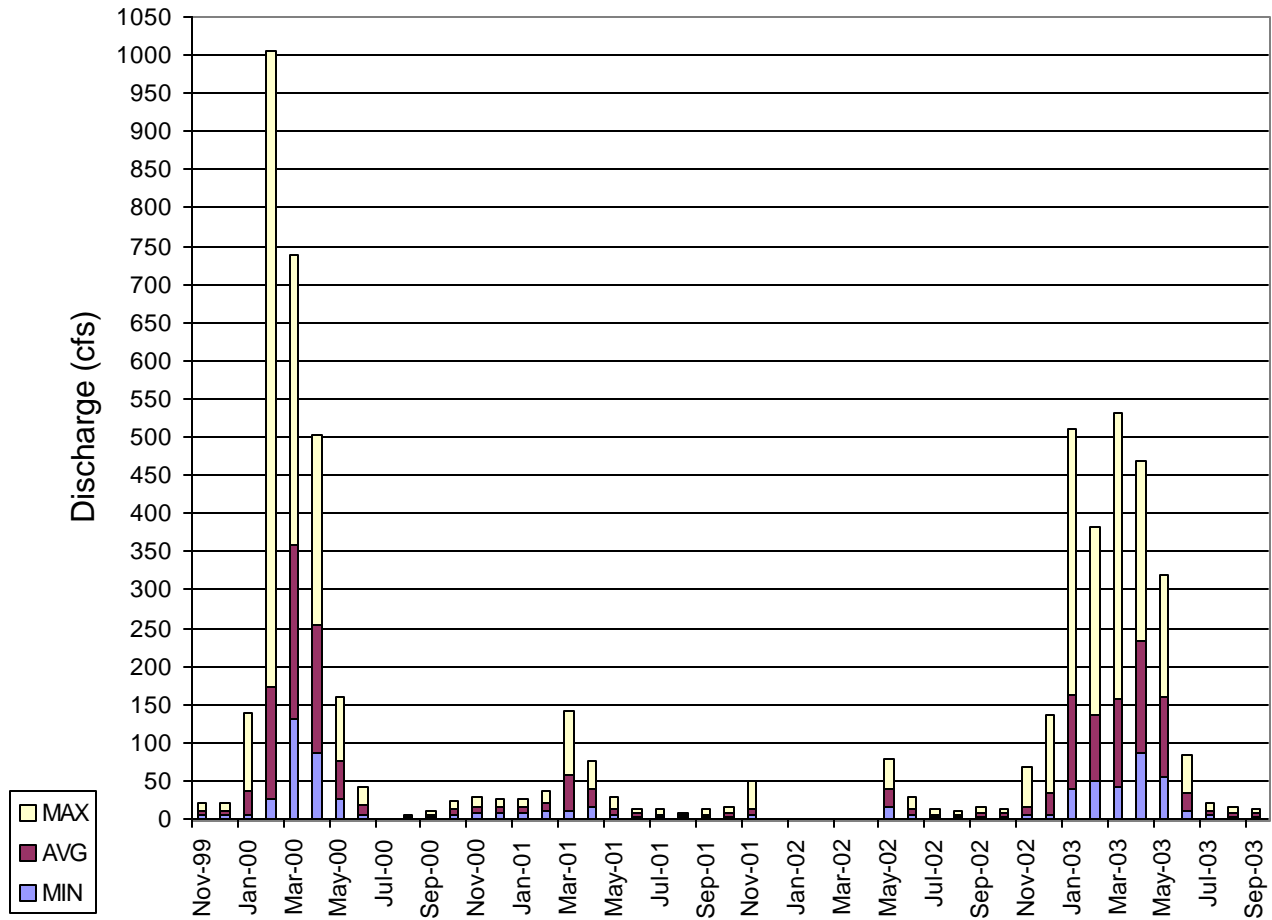


Red Clover Creek at Notson Bridge Daily Average Flow and Precipitation at Genesee - Water Year 2001

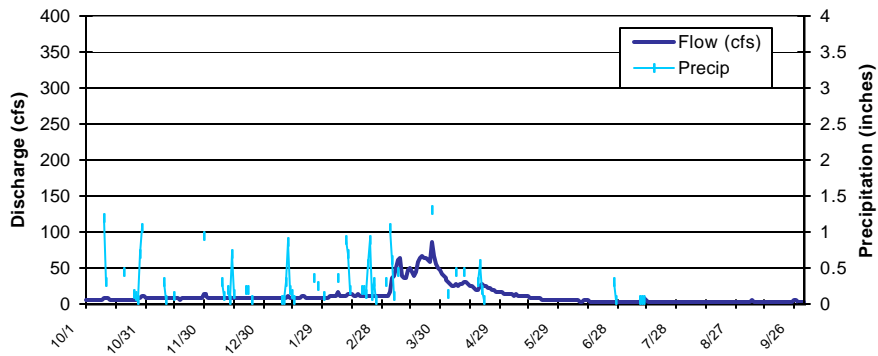


Red Clover Creek at Notson Bridge Daily Average Flow and precipitation at Genesee - Water Year 2002

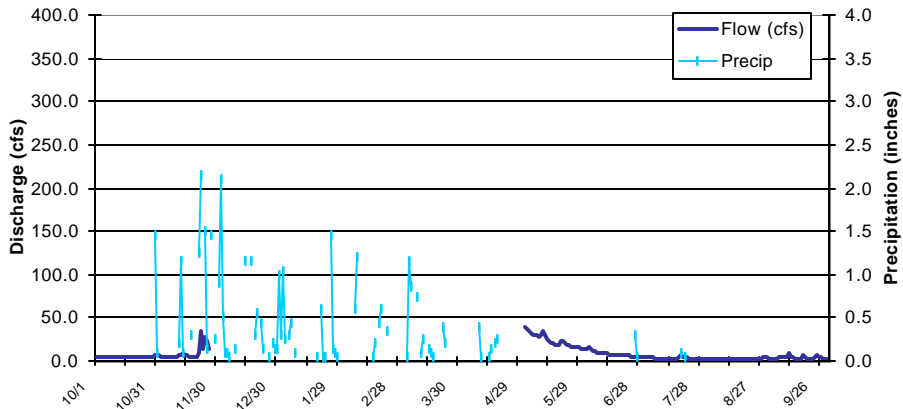


Red Clover Creek at Noston Bridge Daily Average Flow and Precipitation at Genesee - Water Year 2003

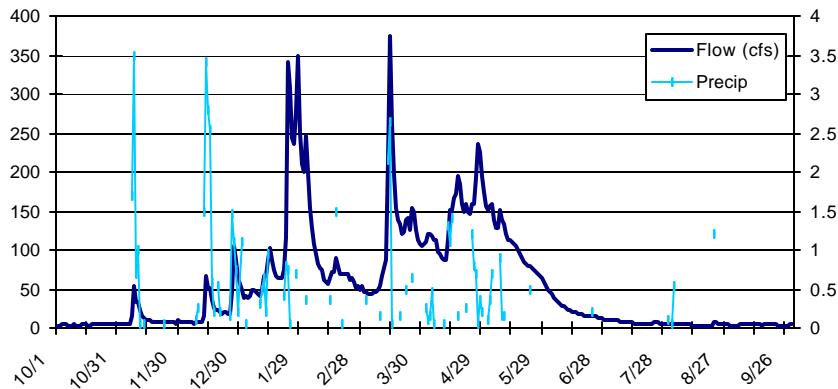


Indian Cr abv Red Clover monthly summaries of avg daily flow

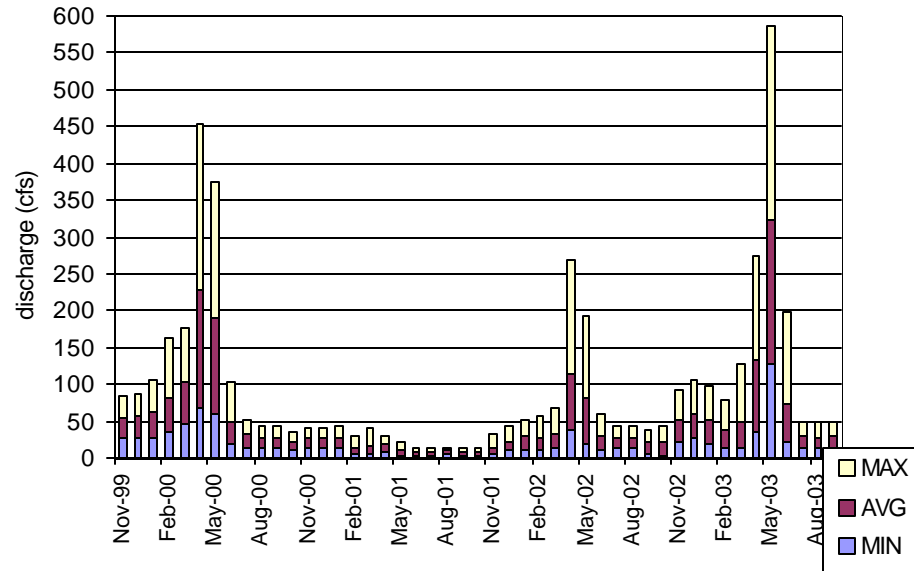


Indian Creek abv Red Clover Daily Average Flow and Precipitation at Genesee - Water Year 2001

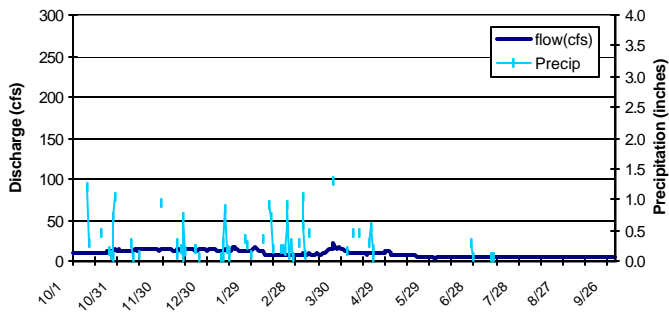

Indian Creek abv Red Clover Daily Average Flow and Precipitation at Genesee - Water Year 2002

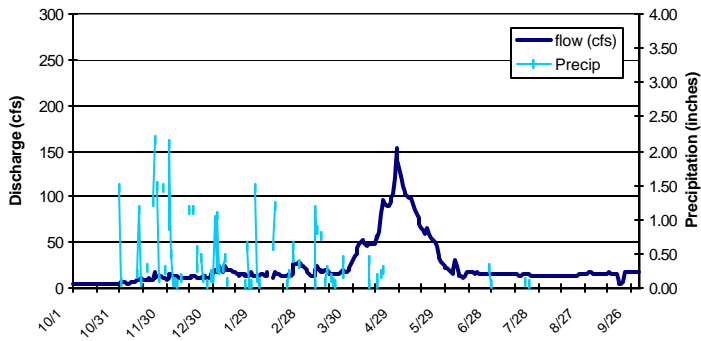





Indian Creek abv Red Clover Daily Average Flow and Precipitation at Genesee - Water Year 2003

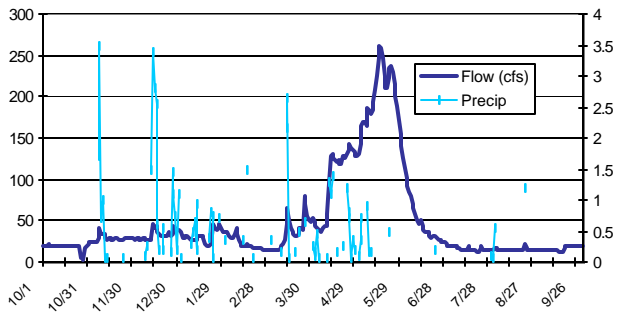

Note: Winter flows may appear higher than actual due to ice build-up on weir.
 This station, more than any other is affected by operations at Antelope dam.


Indian Cr @Flournoy Br; Monthly Summaries of Avg Daily Flow

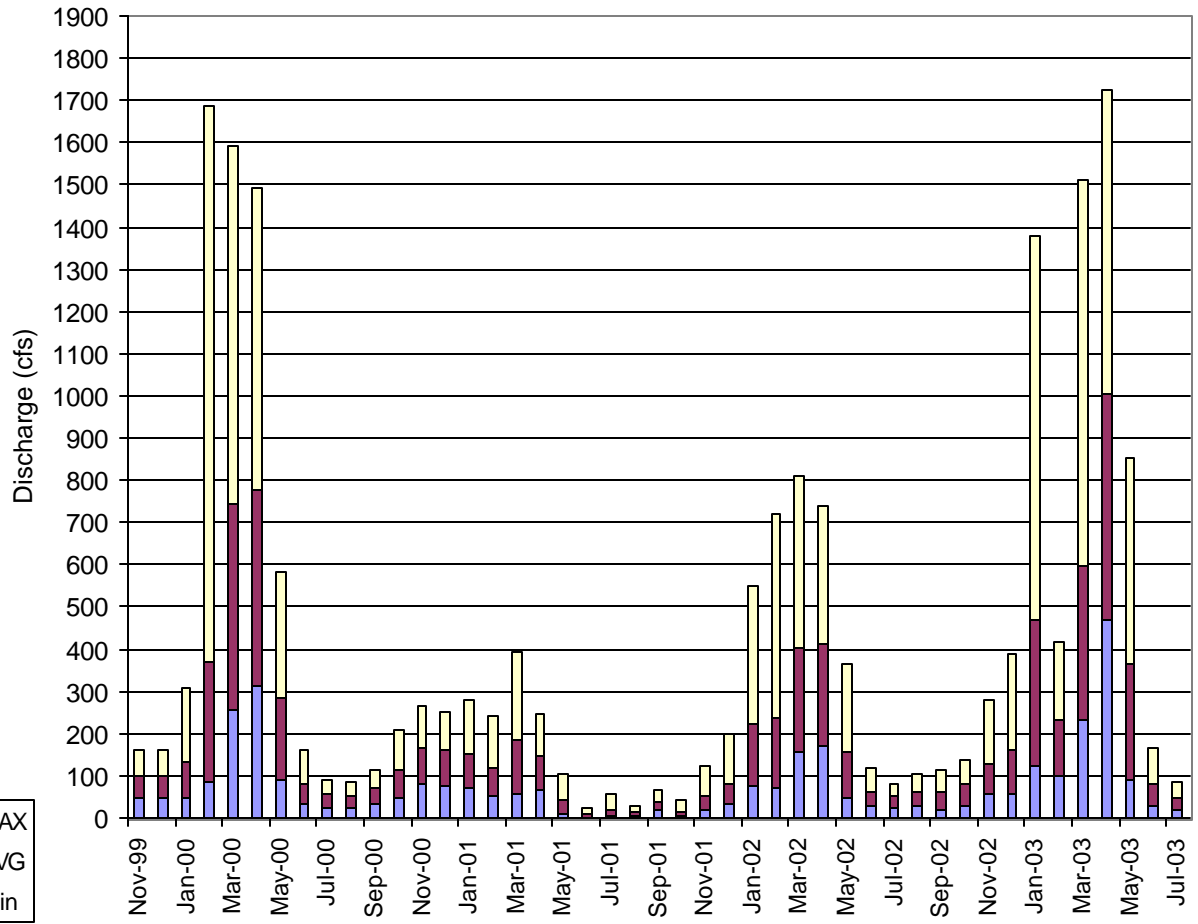

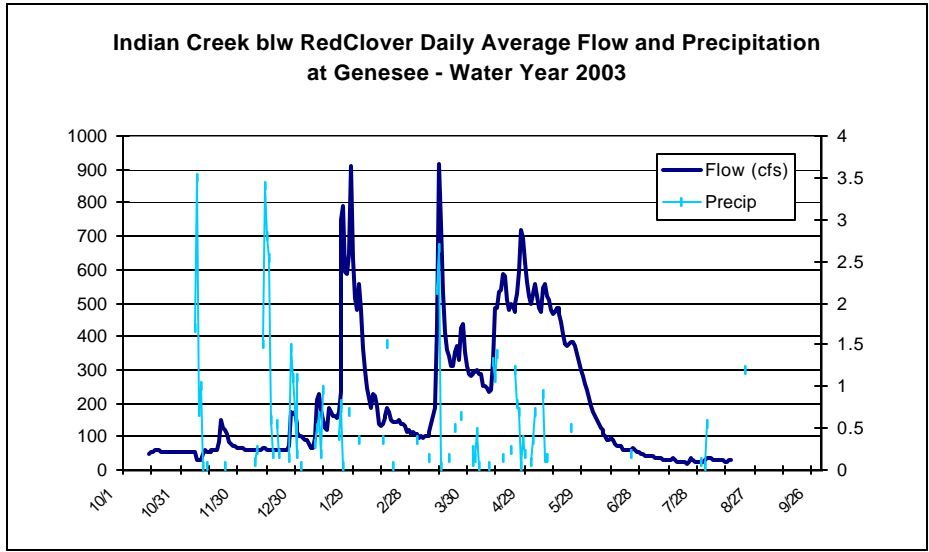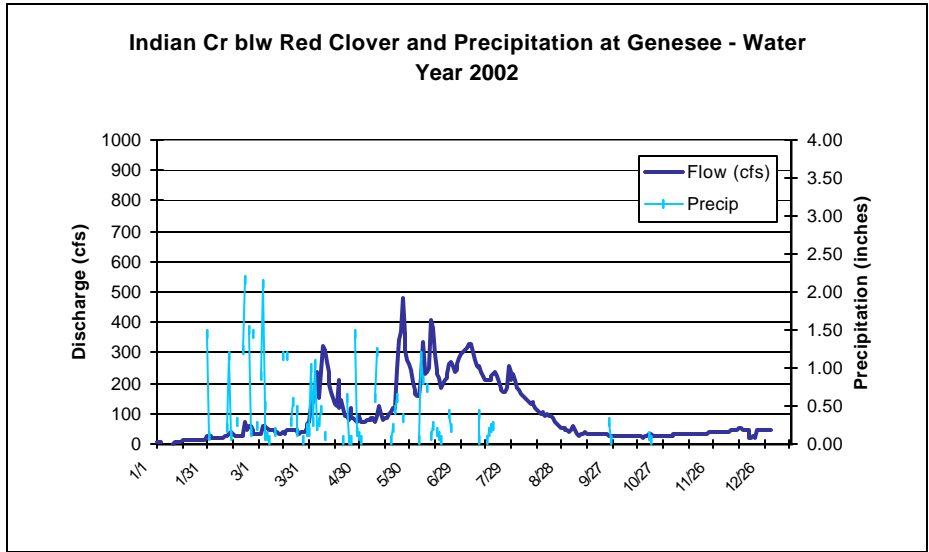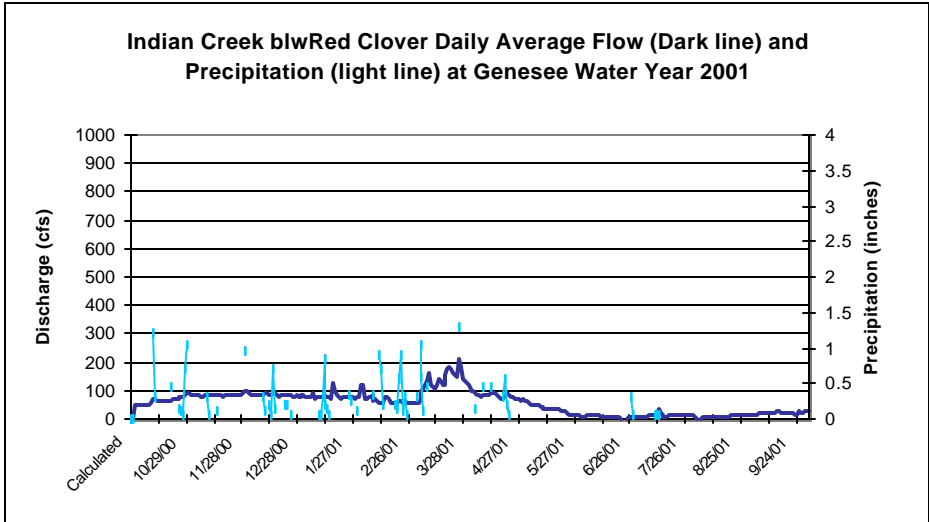


This station should be checked for accuracy.


Indian Cr @ Tville Br. Monthly Summaries of Avg Daily Flow

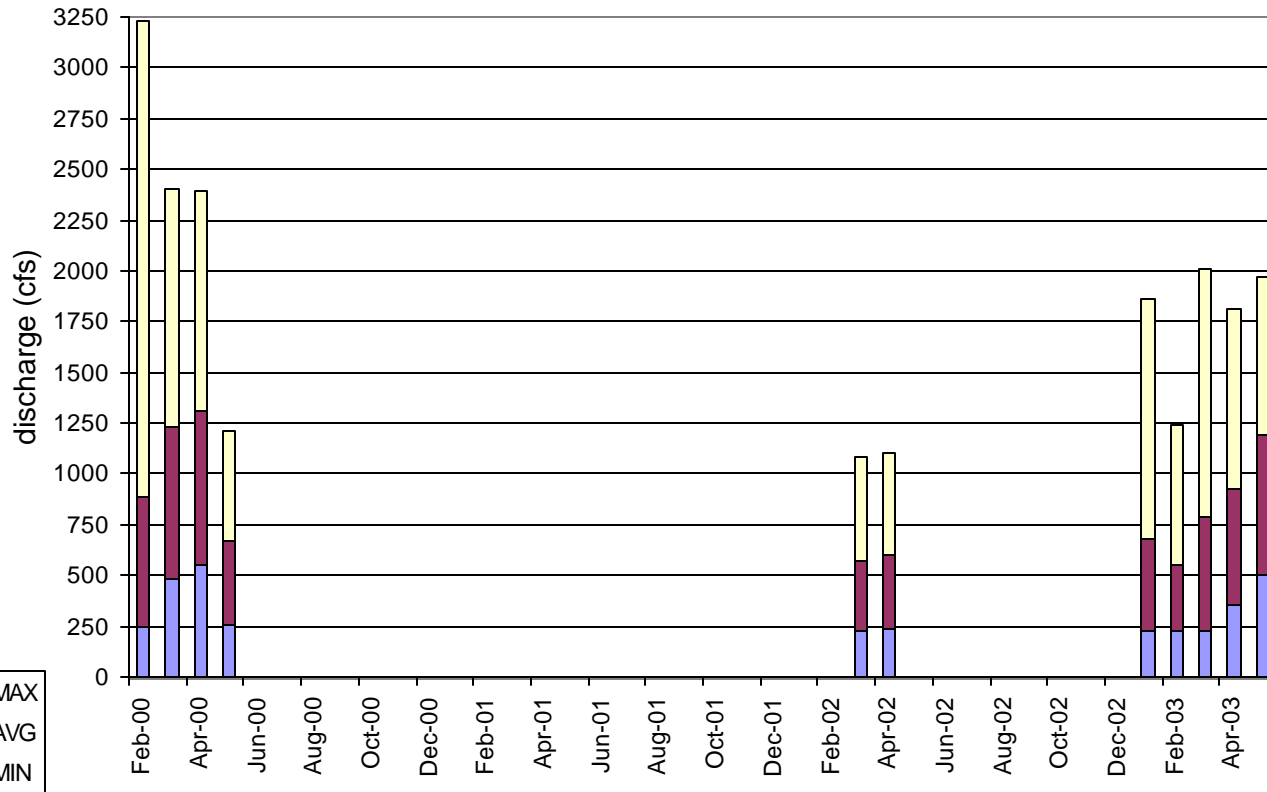


Indian Creek at Taylorsville Bridge Daily Average Flow and Precipitation at Genesee - Water Year 2002

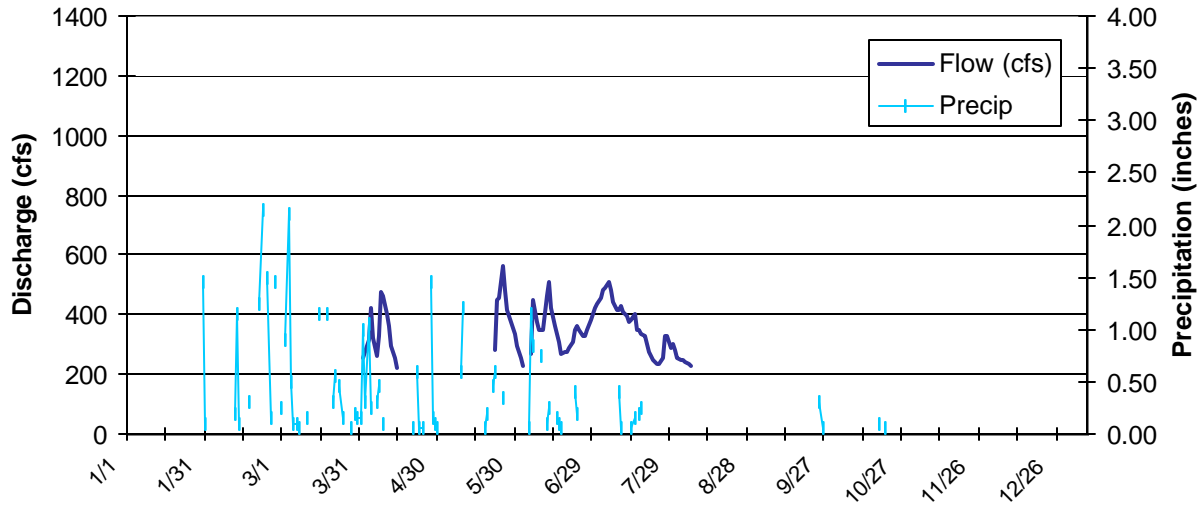


Indian Creek at Taylorsville Bridge Daily Average Flow and Precipitation at Genesee - Water Year 2003

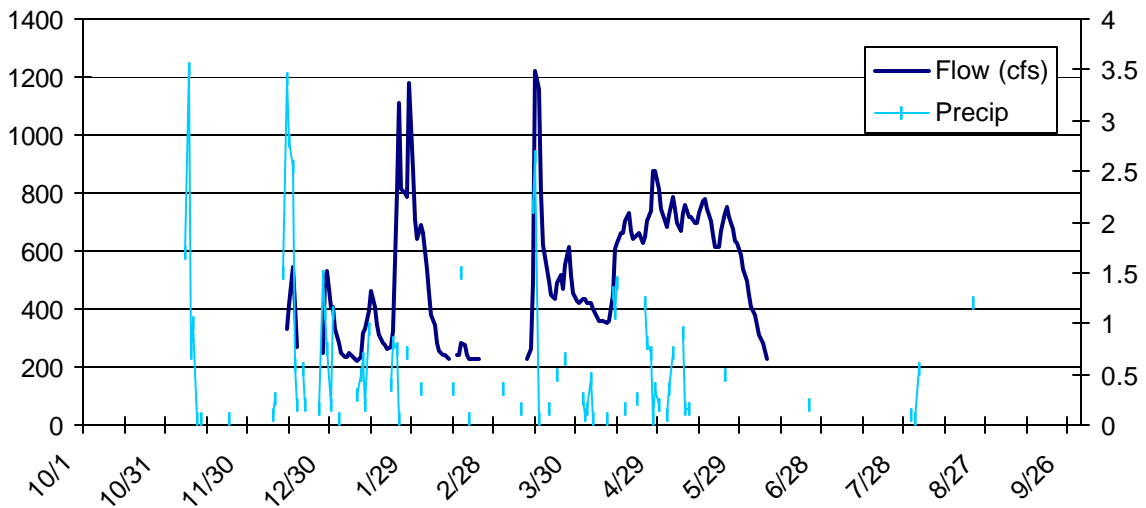


Lights Cr@Deadfall Br; Monthly Summaries of Avg Daily Flow

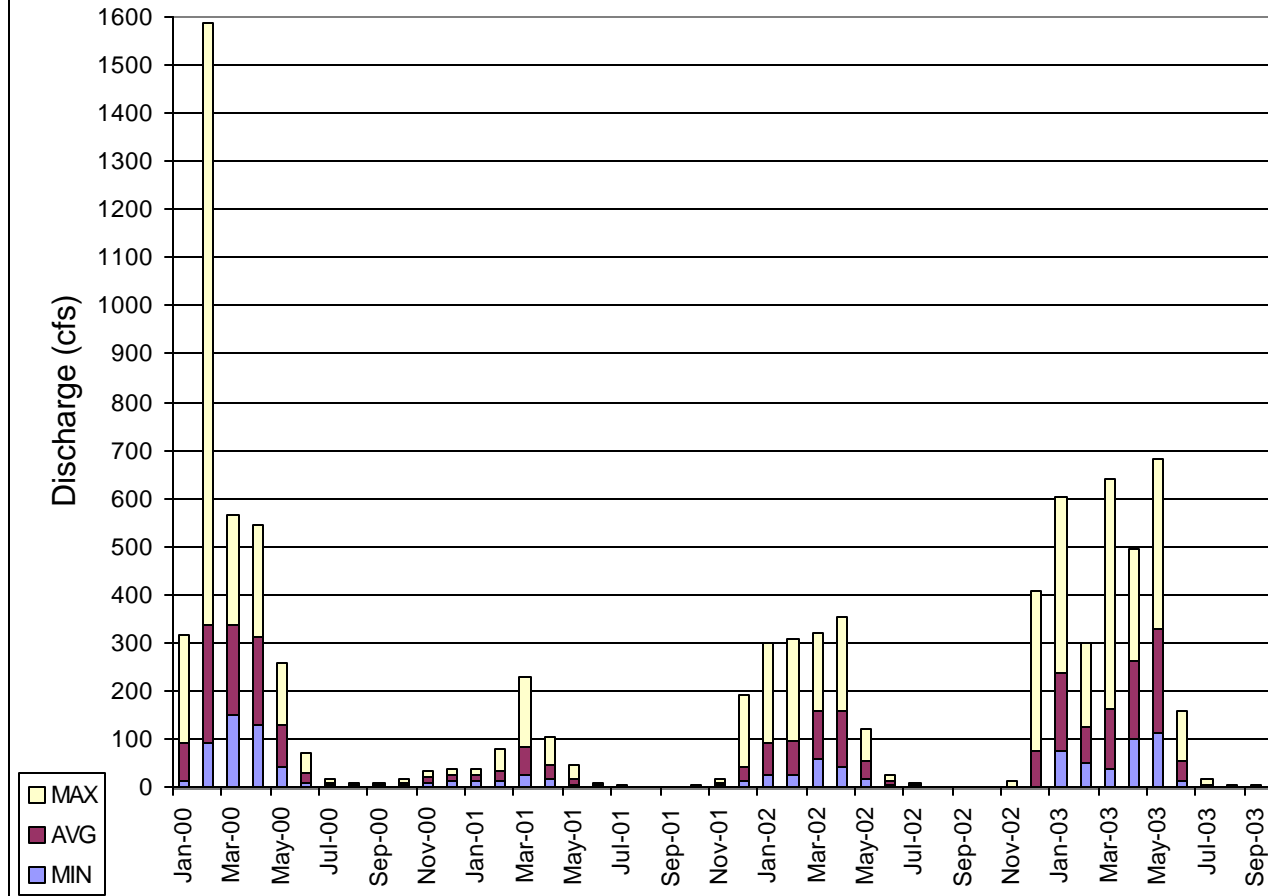


Lights Creek at Deadfall Bridge Average Daily Flow and Precipitation at Genesee - Water Year 2001

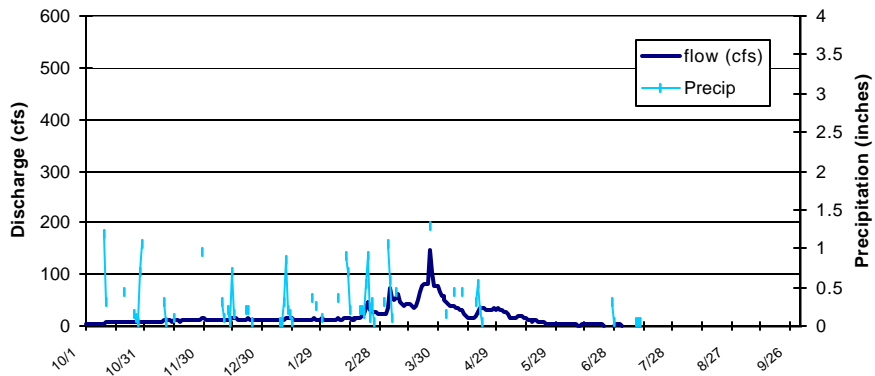


Lights Creek at Deadfall Bridge Daily Average Flow and Precipitation at Genesee - Water Year 2002

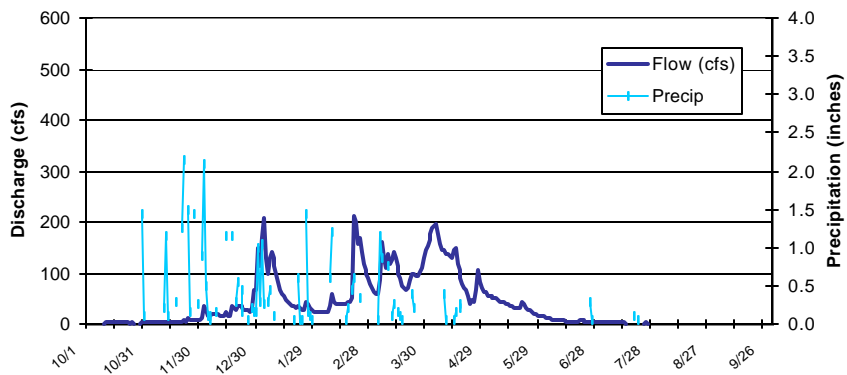


Lights Creek at Deadfall Bridge Daily Average Flow and Precipitation at Genesee - Water year 2003

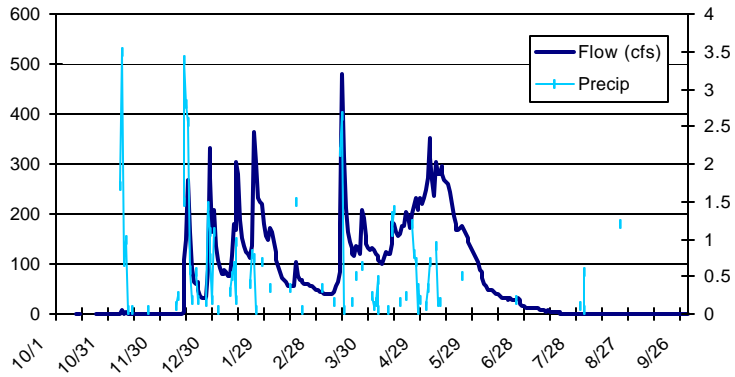


Wolf Cr @ Main St Br; Summaries of Avg Daily Flow

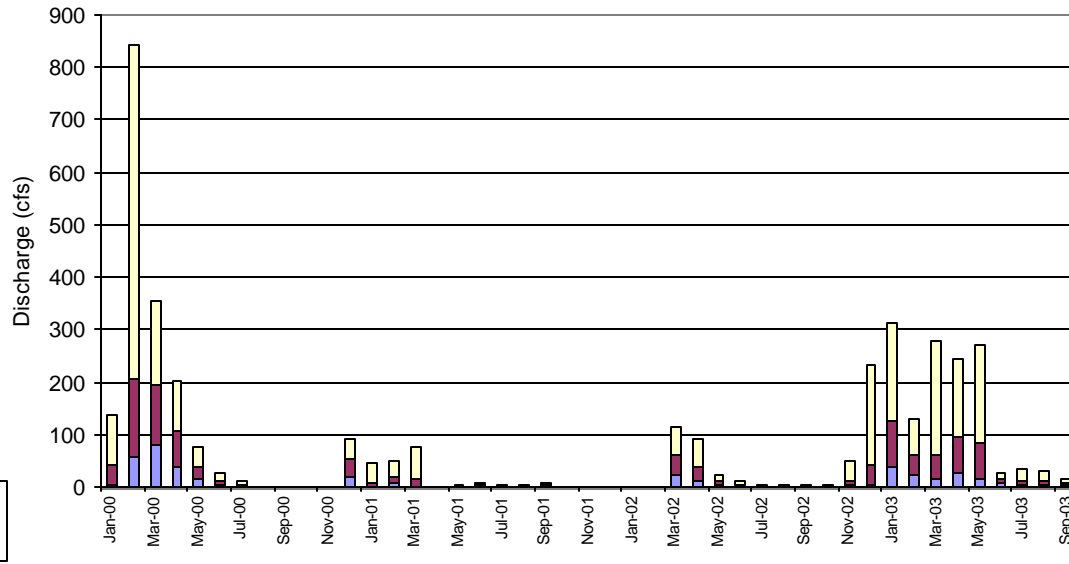


Wolf Creek at Main St Bridge Daily Average Flow and Precipitation at Genesee - Water Year 2002

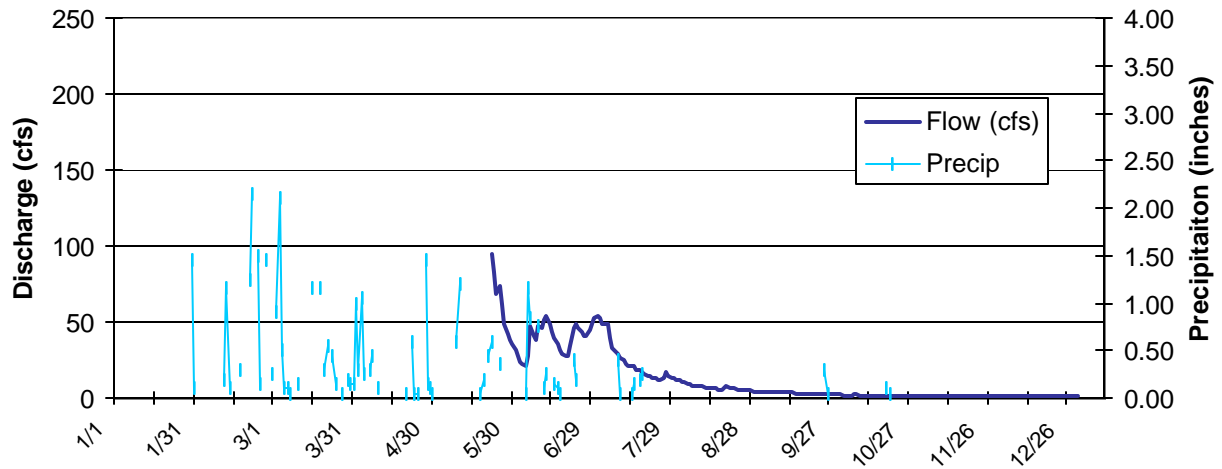


Wolf Creek at Main St Bridge Daily Average Flow and Precipitation at Genesee - Water Year 2003

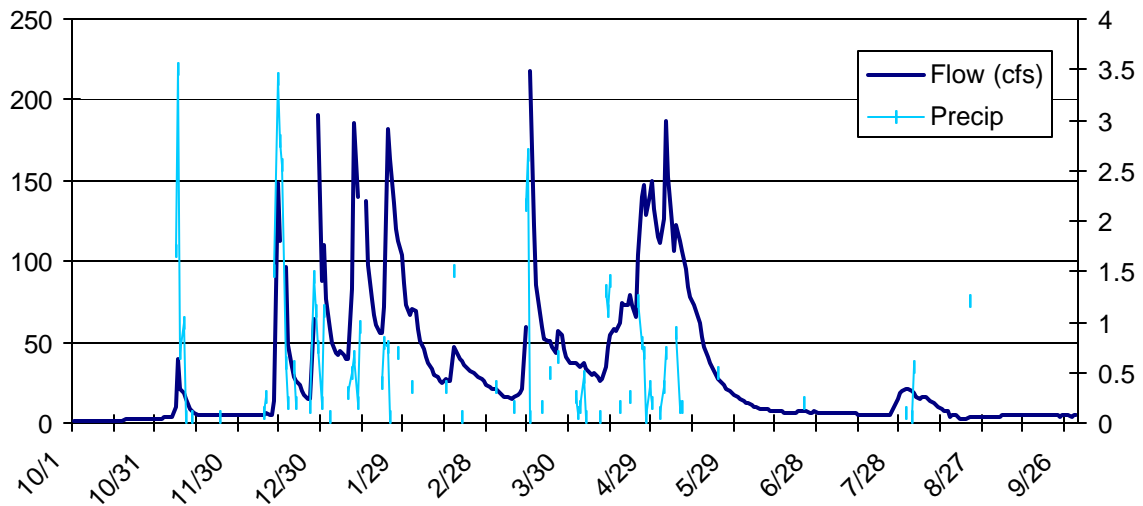


Spanish Cr at Gansner Bridge; Monthly Summaries of Avg Daily Flow

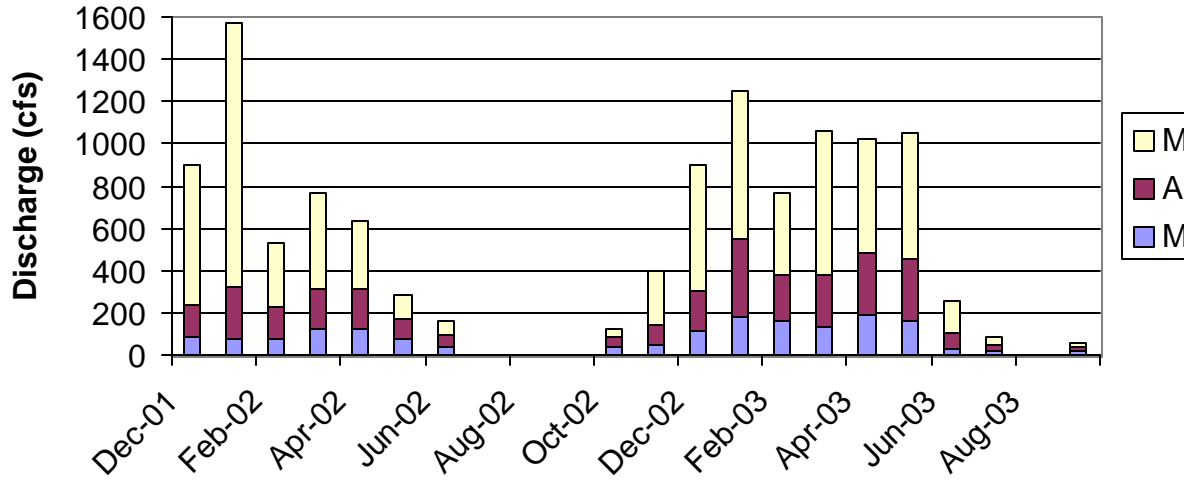

**Spanish Creek at Hwy 70 Bridge Daily Average Flow and
Precipitation at Genesee - Water Year 2002**

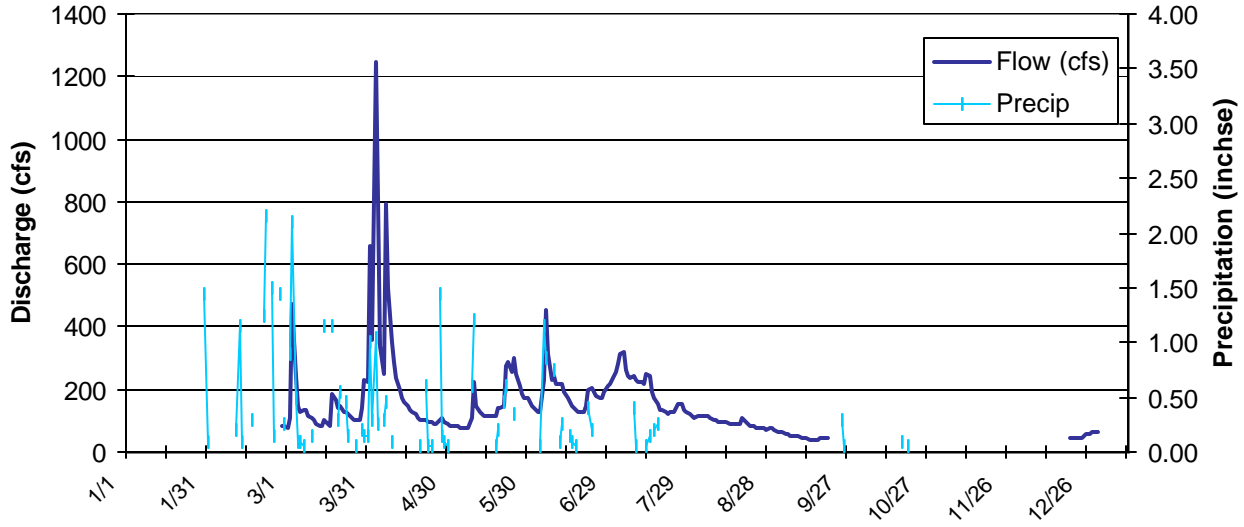

**Spanish Creek at Hwy 70 Bridge Daily Average Flow and
Precipitation at Genesee - Water Year 2003**

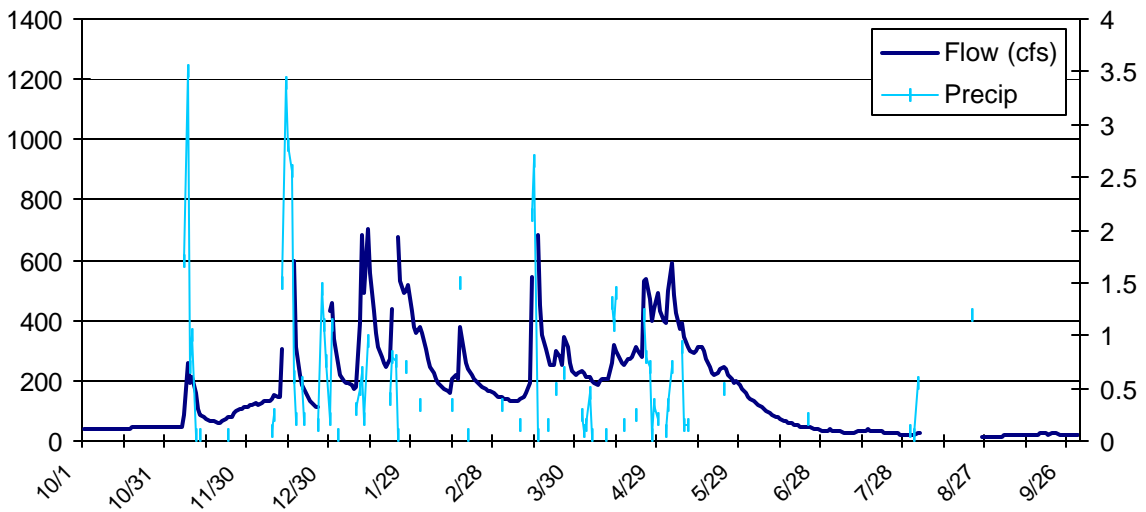

- MAX
- AVG
- MIN

APPENDIX G – FR-CRM Restoration Project Locations

In the following schema, monitoring sites are in bold. Watershed acres above each monitoring site are in parentheses, followed by a list, in smaller font, of FR-CRM restoration activities that have occurred in each sub-watershed (Project name, year, project type, units restored). Many of these watersheds also contain significant National Forest lands, where restoration activities, and other land management have taken place. Unfortunately, we were not able to include those activities in this report. (Except that the Stream Fire around Antelope Lake in 2000 (the DWR weir and Indian abv Red Clover are the closest monitoring sites) should be mentioned because it burned fairly hot along Indian Creek just below Antelope Dam on erosive decomposed granite soils.) Project locations are shown on a map at www.feather-river-crm.org.

North Fork Feather River watershed (704,000 total watershed acres)

NFFR @ Caribou acw East Branch ()

Chester Park Bank Stabilization (abv a dam); 2001; bank stabilization; 0.08 miles channel.

Butt Cr ()

Benner Cr; 1997; various techniques; 0.19 miles channel.

Goodrich Cr ()

NFFR @ Domingo Springs ()

East Branch mouth (approx 661,880)

Rush Cr & Soda Cr fish ladders; 1989; fish ladders; 2 tribs spawning habitat.

Spanish mouth (129, 305)

Spanish Cr acw Greenhorn (61,041)

Greenhorn Cr mouth (44,695)

Greenhorn Cr Trout Enhancement Project, 1991, C-channel re-construction, 17.6 acres of floodplain & 0.53 miles of channel.

Labbe Ranch ditch obliteration; 2002; pond & plug; 10 acres.

Spanish @ Gansner (approx 55,500)

Spanish Cr Gravel Vortex Sampler, 1997, sustainable gravel harvester pilot, acres improved tba.

Elizabethtown @ West Ranch; 2002; pond and plug/ hiway rehab; 5 acres floodplain; 0.07 miles channel.

Elizabethtown Archeology Site; 2003; 0.25 mi channel stabilization.

Rock Cr mouth (24,416)

Indian Cr @ Indian Falls (approx 478,590)

Wolf Cr ()

Wolf Cr Restoration phases I-IV, 1989-2002, C-channel reconstruct & Bank stab.; 29 acres floodplain & 2 miles channel.

North Canyon Cr; 2002; bank stabilization; 0.03 miles channel.

Lights Cr (67,721)

Indian @ T-ville (343,289)

Hosselkus Cr; 2002; pond & plug; 25 acres floodplain & 0.28 miles channel.

Walker Mine Tailings Project; 1994; wetland development & various techniques; 100 acres tailings.

Indian @ Fournoy (279,804)

Ward Cr; 1999; pond & plug; ?? acres floodplain & 0.76 miles channel.

Indian @ DWR weir (abv Red Clover) (approx 71,300)

Boulder Cr (abv a dam); 1997; woody debris & various techniques; ?? acres floodplain & 0.57 miles channel.

Willow Cr (abv a dam); 1996; headcut treatments; failed 1997.

Red Clover @ Chase Bridge

Red Clover Cr @ Drum (77,866)

Red Clover @ Notson (69,190)

Red Clover Cr Demo Project; 1985; check dams; 70 acres floodplain & 1 mile channel.

Poco Cr; 1986; check dams; 0.23 miles channel.

Dotta Canyon Project; 1988; rock drop dams; ?

Noble-Red Clover; 1990; rock drop dams; 25 acres floodplain & -- miles channel.

Red Clover II; 1994; bank stabilization; 0.5 miles channel.

Bagley Creek; 1993; various techniques; 700 acres watershed.

Bagley Cr II; 1996; pond & plug; -- acres floodplain & 0.27 miles channel.

Last Chance Cr @ Murdock (approx 81,790)

Clarks Cr; 1992; bank stabilization; 0.38 miles channel.

Dunn Pasture; 1992; bio-engineering & exclusion; 9 acres meadow.

Clarks Cr; 2001; pond & plug; 50 acres floodplain & 0.81 miles channel.

Last Chance @ Doyle x-ing (approx 62, 100)

Big Flat Meadow Re-watering Project; 1995; pond and plug; 47 acres floodplain & 0.77 miles channel.

Stone Dairy; 2001/2; pond & plug/ headcut treatments; 20 acres floodplain & 0.44 miles channel.

McClellan Cr (3412 total)

Little Stoney Cr (approx 3,200)

Little Stony Cr; 1996; step-pool headcut treatment; 0.15 miles channel (damage 1997).

Willow Cr (5491 total)

LC @ Alkali Flat low water x-ing (DWR)

Upper Last Chance Watershed Restoration; 2003; pond and plug; 240 acres floodplain & 3.8 miles channel.

Ferris Cr (4545 total) (DWR)

Last Chance @ Bird-Jordan Neck (staff gage & DWR)

Upper Last Chance Cr Watershed Restoration (Matley); 2002; pond & plug; 250 acres floodplain & 1.23 miles channel.

Middle Fork Feather River watershed (768,000 total watershed acres)

Nelson Cr (29,172)

Poplar Cr Crossing; 2003-4; 0.1 mi channel; 100 acres floodplain

MFFR @ Sloat (212,391+ more Sierra Valley)

Jamison Cr

Jamison Cr; 1995; C-channel reconstruction & bank stabilization; 0.38 miles channel.

Sulphur Cr @ Hwy 89 (approx 25,300)

Boulder Cr (1,287)

Barry Cr (3,678)

Sulphur @ Lower Loop Bridge

Sulphur @ Upper Loop Bridge

MFFR @ Beckwourth

Carmen Cr. Knudsen meadow; 2001; pond & plug; 200 acres floodplain & 1.5 miles channel.

Carmen Cr Three Corner meadow; 2002; pond & plug; 45 acres floodplain & 1 mile channel.

Rowland Cr (abv a dam); 1997; large wood & veg placement; 2 miles channel.